
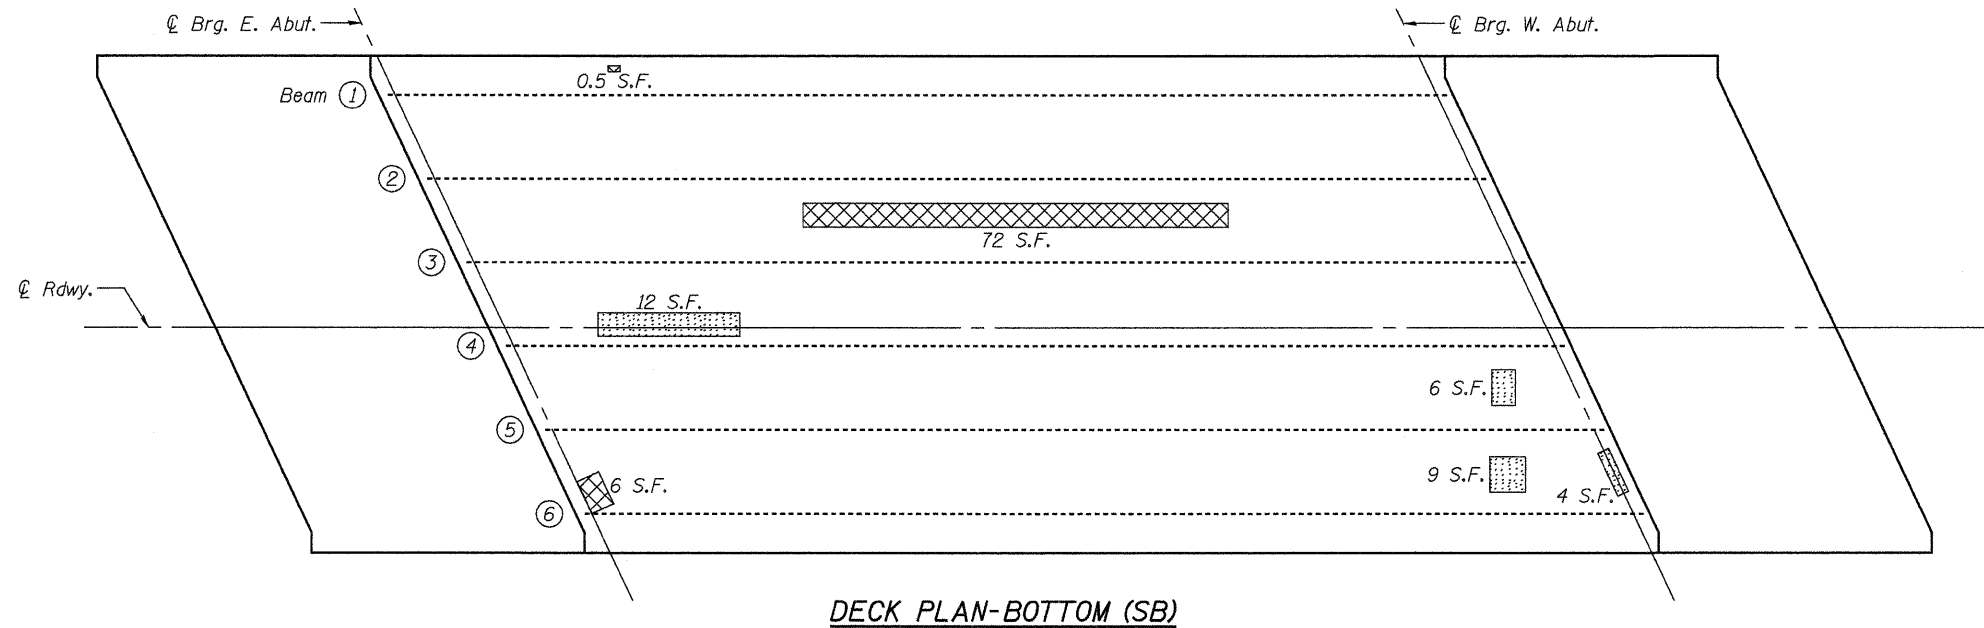


STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

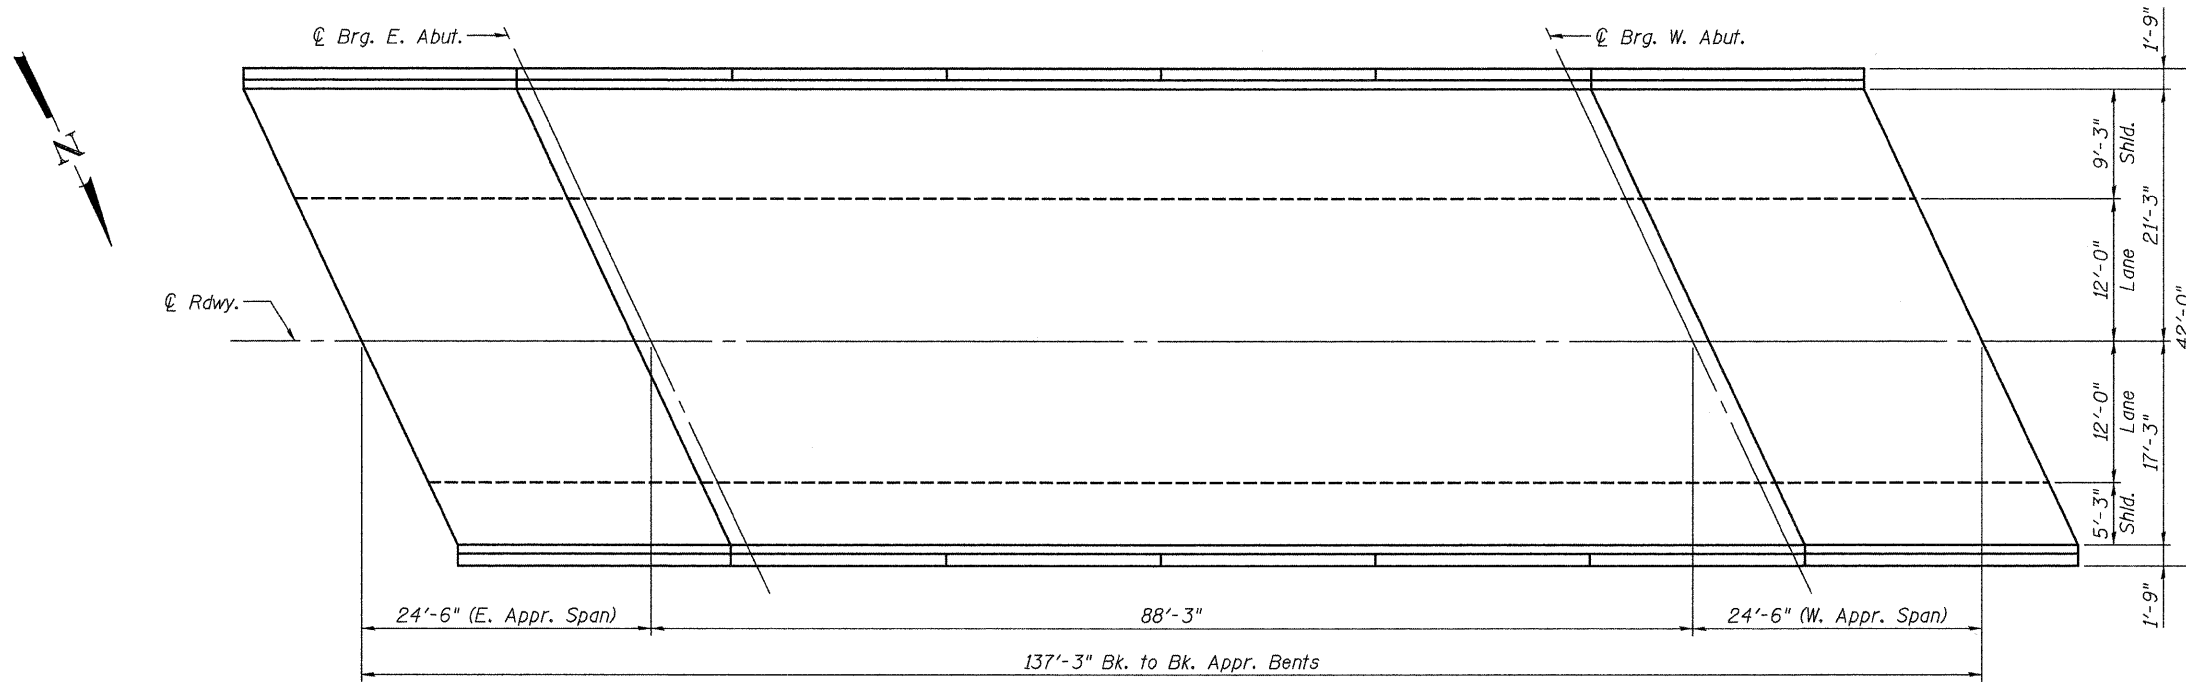

DECK PLAN-BOTTOM (SB)

LEGEND

- Hollow or Unsound Concrete
- Spalled Concrete
- Spalled Concrete with Exposed Reinf.
- Hairline Crack

Notes:

Deck Condition Survey performed 9/16/2009.

Plan quantities assume that areas of "exposed reinforcing" greater than 5 sq. ft. will use Full-depth Type II repair.

Repair areas are estimated, the Engineer shall determine actual repair locations and record them on the As-Built plans.

Partial depth repairs are included with Bridge Deck Hydro-scarification, see Special Provision for Bridge Deck Microsilica Concrete Overlay.

BILL OF MATERIAL

Item	Unit	Total
Deck Slab Repair (Full Depth, Type II)	Sq. Yd.	8

JD Johnson, Depp & Quisenberry
CONSULTING ENGINEERS
Springfield, Illinois

DESIGNED: JDQ	DRAWN: SJS
CHECKED: DCD	CHECKED: DCD

DECK PLAN (SB)
STRUCTURE NO. 058-0104(NB) & 0105(SB)

SHEET 3 OF 11	F.A.P. RTE. 322	SECTION (58-20)RS	COUNTY MACON	TOTAL SHEETS 151	SHEET NO. 94
	STA. 142+55.53			CONTRACT NO. 74150	
FED. ROAD DIST. NO.		ILLINOIS FED. AID PROJECT			

FILE: J:\JDD\101077 IL-DTVM#8 US51 Bridge Repairs\2-TaylorRoad\0580104-74150-003-supersheet-SB.dgn
USER: DCD
DATE: 04/09/2010 10:50:58