
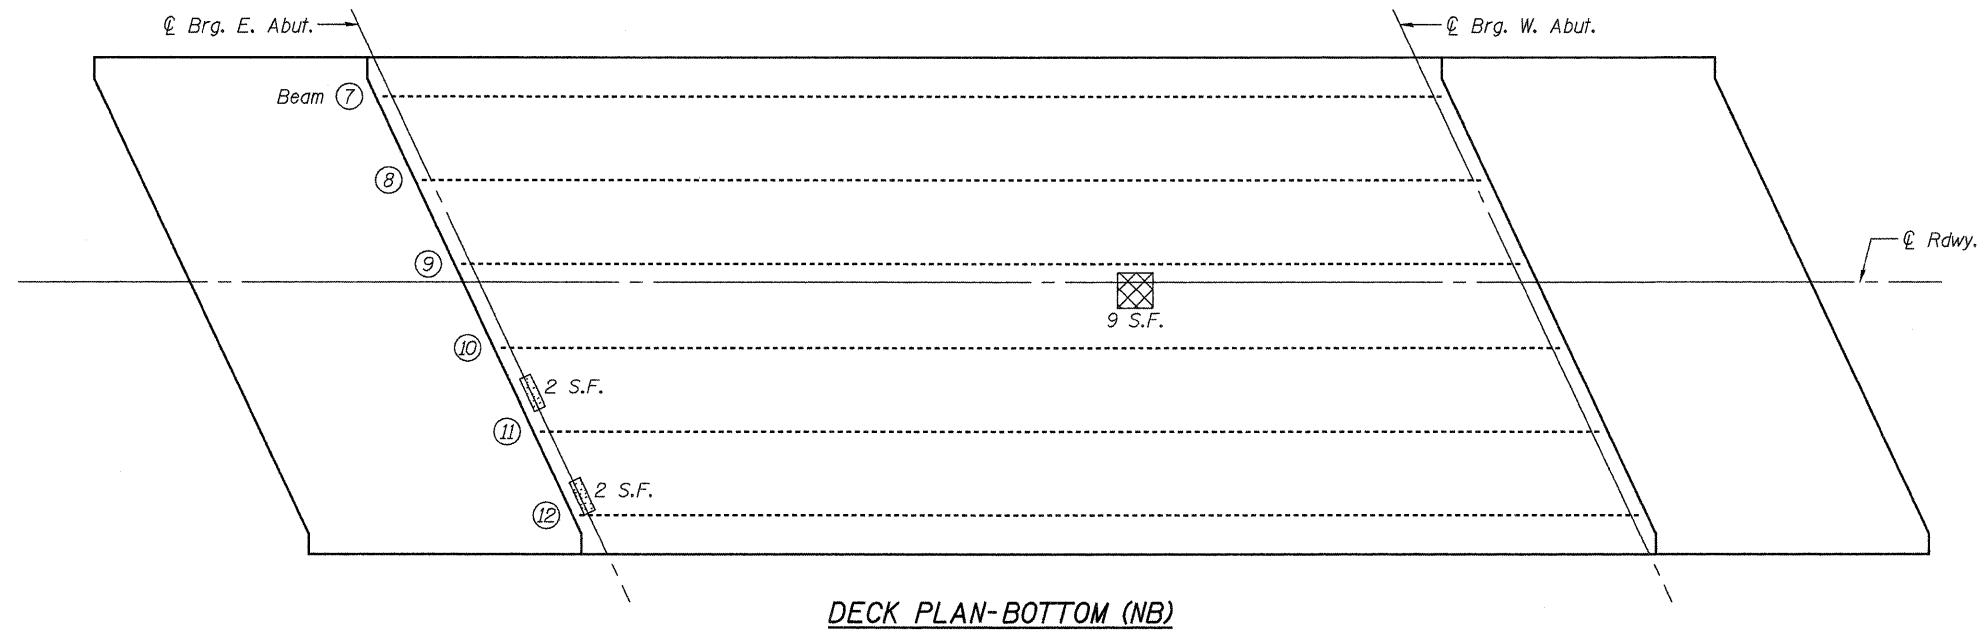


STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

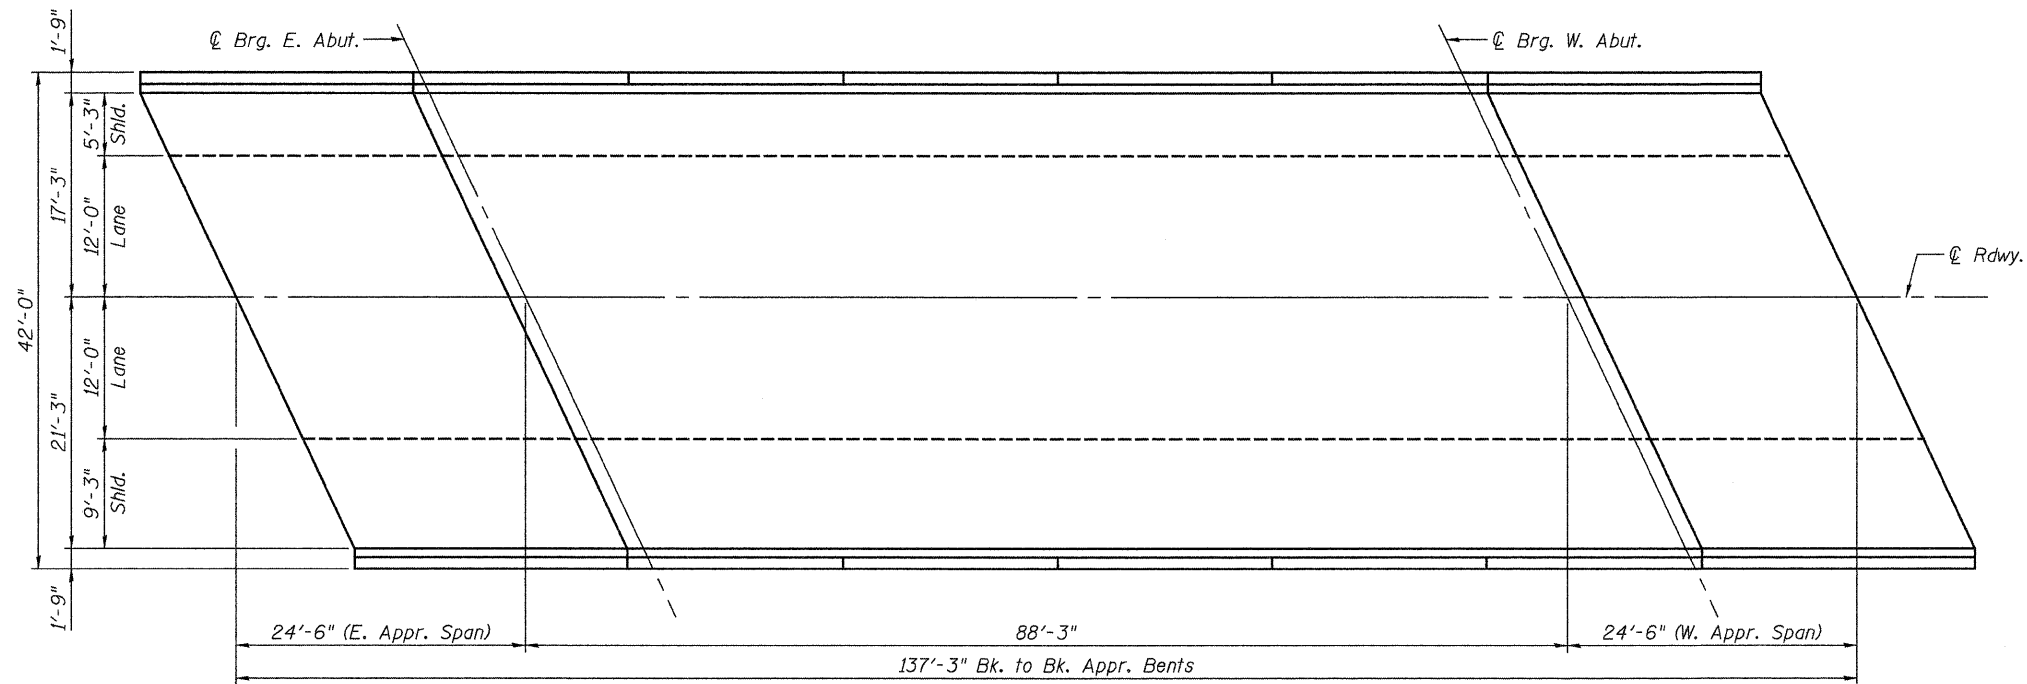

LEGEND

- Hollow or Unsound Concrete
- Spalled Concrete
- Spalled Concrete with Exposed Reinf.
- Hairline Crack

Notes:

Deck Condition Survey performed 9/16/2009.

Plan quantities assume that areas of "exposed reinforcing" greater than 5 sq. ft. will use Full-depth Type II repair.

Repair areas are estimated, the Engineer shall determine actual repair locations and record them on the As-Built plans.

Partial depth repairs are included with Bridge Deck Hydro-scarification, see Special Provision for Bridge Deck Microsilica Concrete Overlay.

BILL OF MATERIAL

Item	Unit	Total
Deck Slab Repair (Full Depth, Type II)	Sq. Yd.	1

Johnson, Depp & Quisenberry
CONSULTING ENGINEERS
Springfield, Illinois

DESIGNED: JDQ	DRAWN: SJS
CHECKED: DCD	CHECKED: DCD

DECK PLAN (NB)
STRUCTURE NO. 058-0104(NB) & 0105(SB)

SHEET 4 OF 11	F.A.P. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
	322	(58-20)RS	MACON	151	95
		STA. 142+55.53	CONTRACT NO. 74150		
		FED. ROAD DIST. NO.	ILLINOIS FED. AID PROJECT		