


FILE NAME = W:\Projects\2010\100120 PTB 157\25\cadd\Structural\Drawn\0 - 280 over Mud Creek\Cross Check Plans\0372008-64G80-005-Repair-Dtls-SouthEndSection.dgn

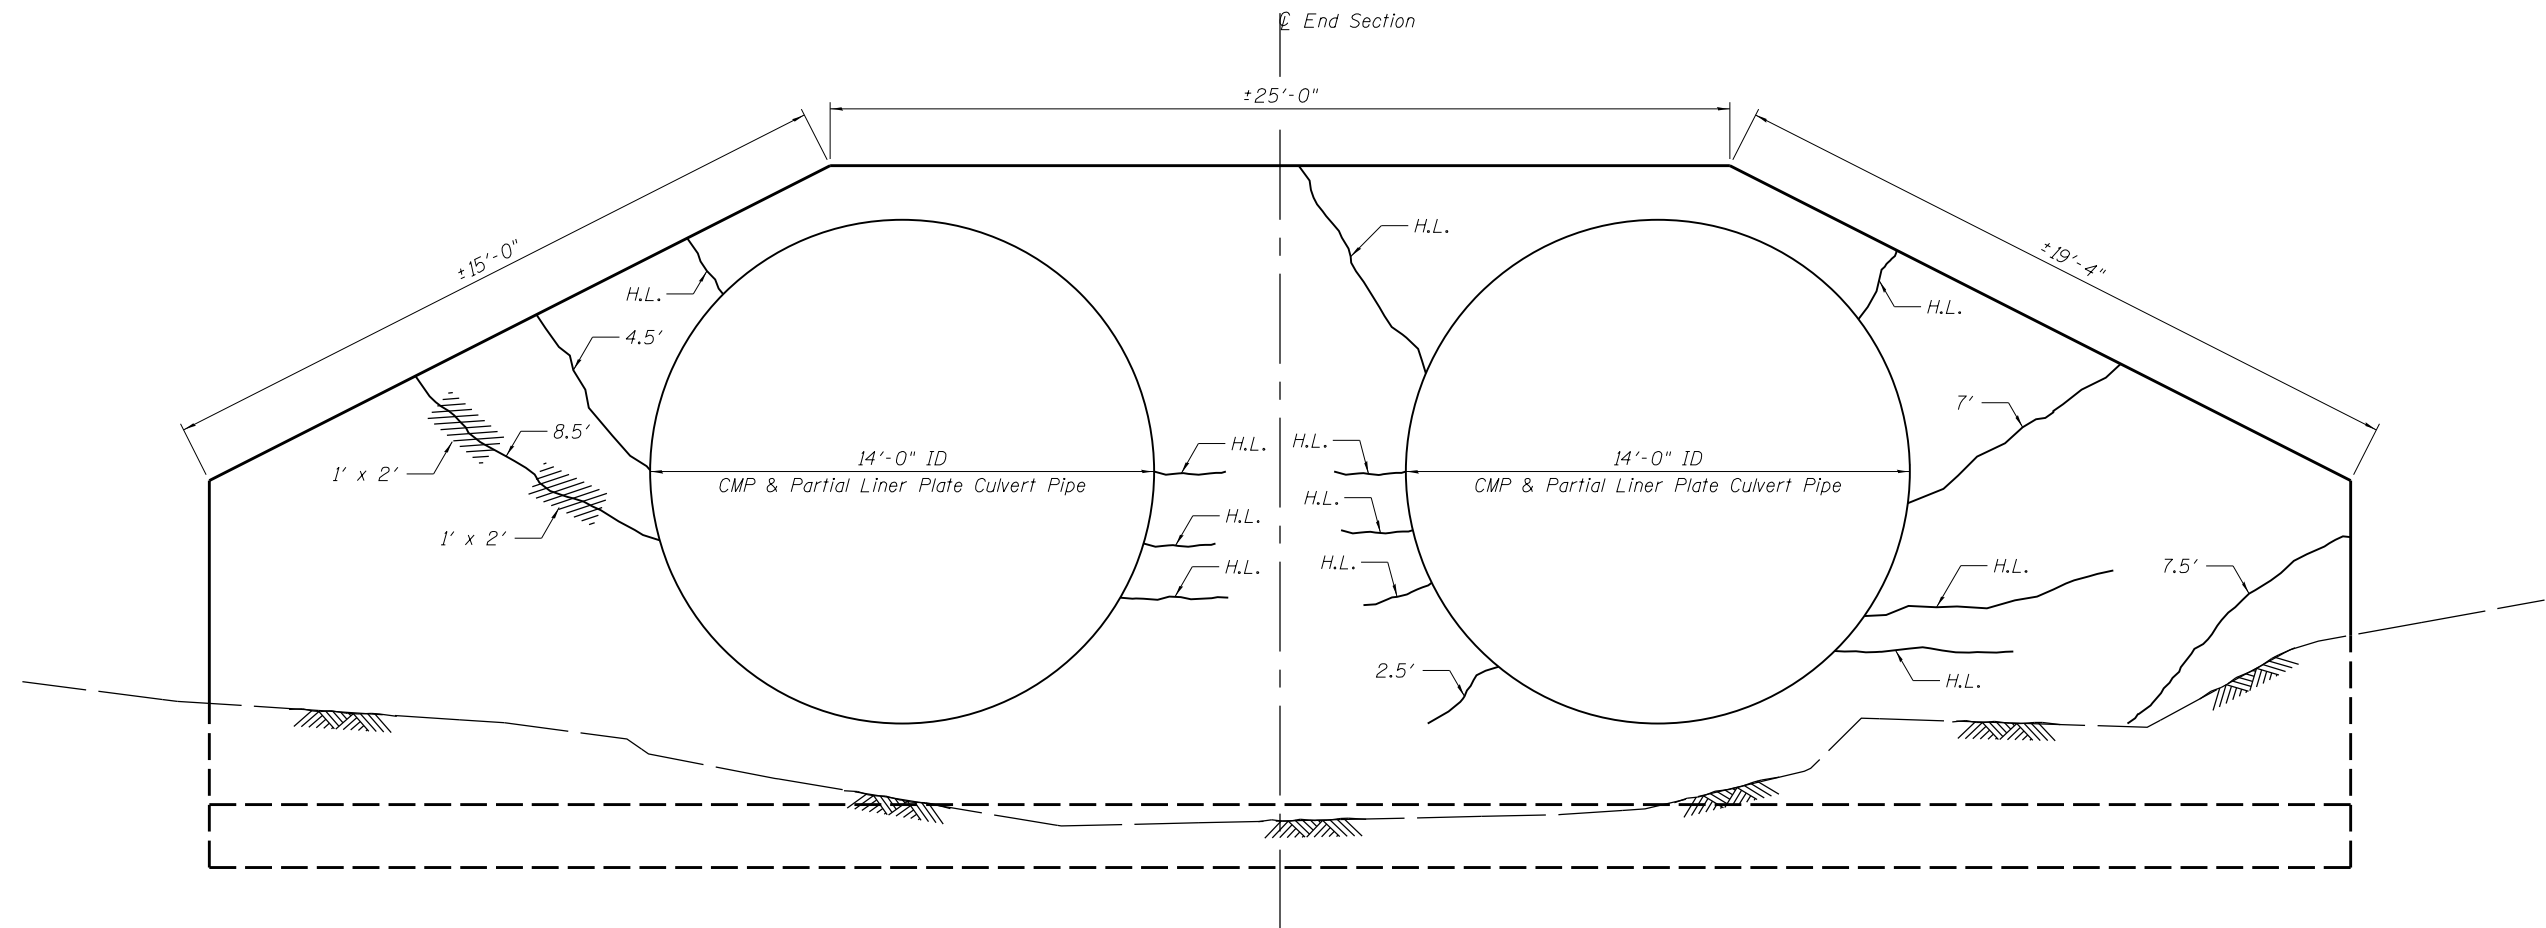

**SOUTH END SECTION
(UPSTREAM)**

LEGEND

- Structural Repair of Concrete (Depth Equal To Or Less Than 5 Inches)
- 6' — } Epoxy Crack Injection
- H.L. — } Hairline Crack - Not to be sealed
- Existing ground line

BILL OF MATERIAL

ITEM	UNIT	TOTAL
Epoxy Crack Injection	Foot	70
Structural Repair of Concrete (Depth Equal To Or Less Than 5 Inches)	Sq. Ft.	10

NOTES

1. Repair quantities have been estimated based on a field inspection. The quantities given in the Bill of Material have been increased to account for changes from the time of inspection to construction. Structural repairs to the end section will be approved by the Engineer and the Contractor will be paid for the actual quantities of the repairs.