



STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

ROUTE NO.	SECTION	COUNTY	POST MILE	SHEET NO.	SHEET NO. 11
FAP 328	*	WHITE	42	22	17 SHEETS
FED. ROAD DIST. NO.	ILLINOIS	FED. AID PROJECT	*(105X)BR		
98997					

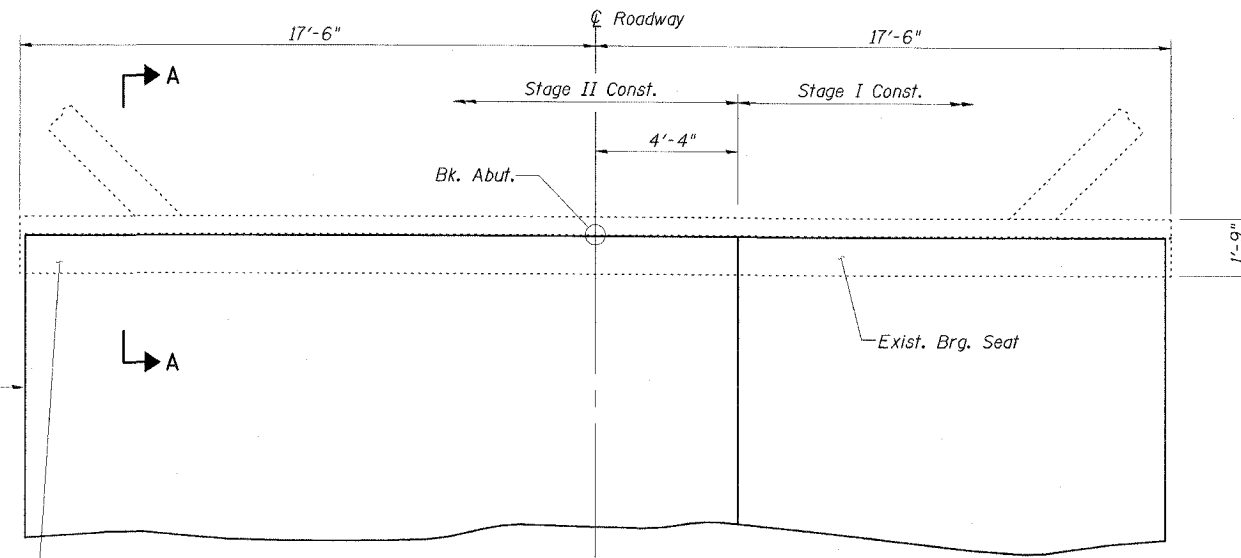

PLAN

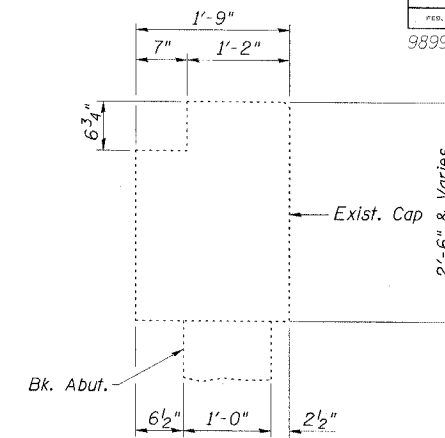

SECTION A-A

**SOUTH ABUTMENT
BILL OF MATERIAL**

Concrete Sealer	Sq. Ft.	15
Epoxy Crack Injection	Foot	26
Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	21


Edge of new superstructure (Typ.)

EXISTING BEARING SEAT TO BE INSPECTED BY THE ENGINEER AFTER DECK BEAM REMOVAL. DETERIORATED CONCRETE AREAS SHALL BE REPAIRED (ESTIMATED 15 S.F. STRUCTURAL REPAIR OF CONCRETE DEPTH ≤ 5") AND CRACKS SHALL BE SEALED (ESTIMATED 20' EPOXY CRACK INJECTION) IF FOUND. CONCRETE SEALER SHALL BE APPLIED TO CONCRETE REPAIR AREAS.

REPAIR LEGEND

Inspection Date: 12/14/06

- C.-6' Crack to be epoxy injected
- S.F. Delaminated or Spalled Area - Use Structural Repair of Concrete

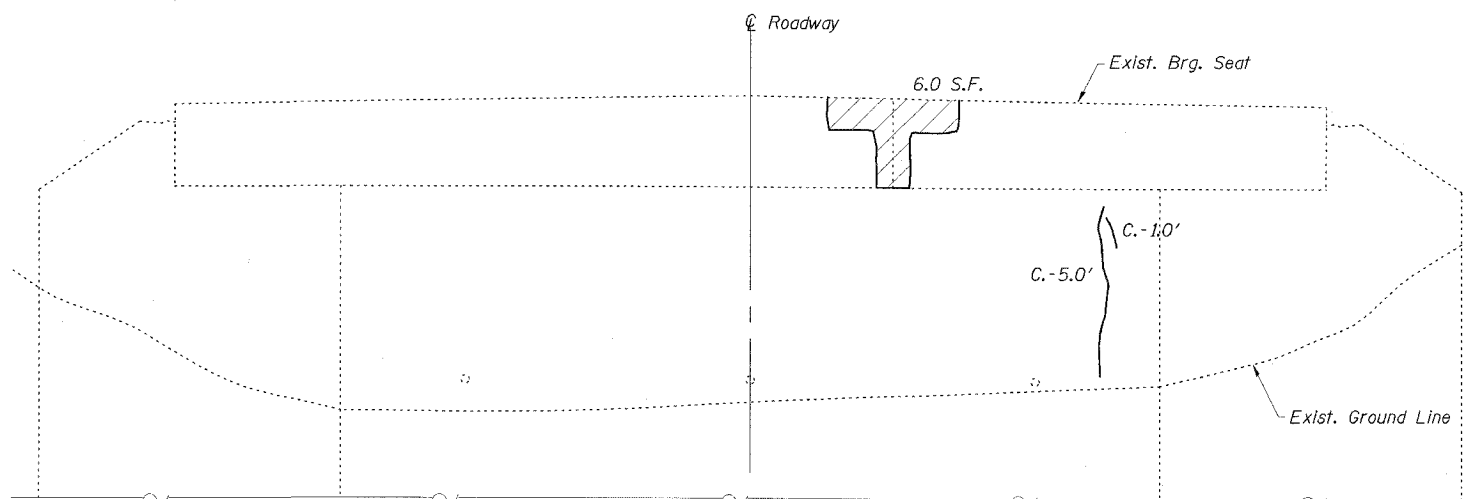

ELEVATION

NOTE: ABUTMENT CRACK REPAIR LENGTHS AND STRUCTURAL REPAIR OF CONCRETE AREAS ARE ESTIMATED FROM 12-14-06 SURVEY WORK. ACTUAL LOCATIONS AND QUANTITIES OF REPAIRS SHALL BE SHOWN BY THE ENGINEER ON THE AS-BUILT PLANS FOR THIS SECTION.

ESCA
CONSULTANTS, INC.

DESIGNED BY:	RDP	01/07
DRAWN BY:	DWH	01/07
CHECKED BY:	JMS/MTD	01/07
APPROVED BY:	RDP	04/07

**SOUTH ABUTMENT
US 45 OVER SKILLET FORK OVERFLOW
FAP ROUTE 328 - SECTION (105X)BR
WHITE COUNTY
STATION 598+76.00
STRUCTURE NO. 097-0019**