

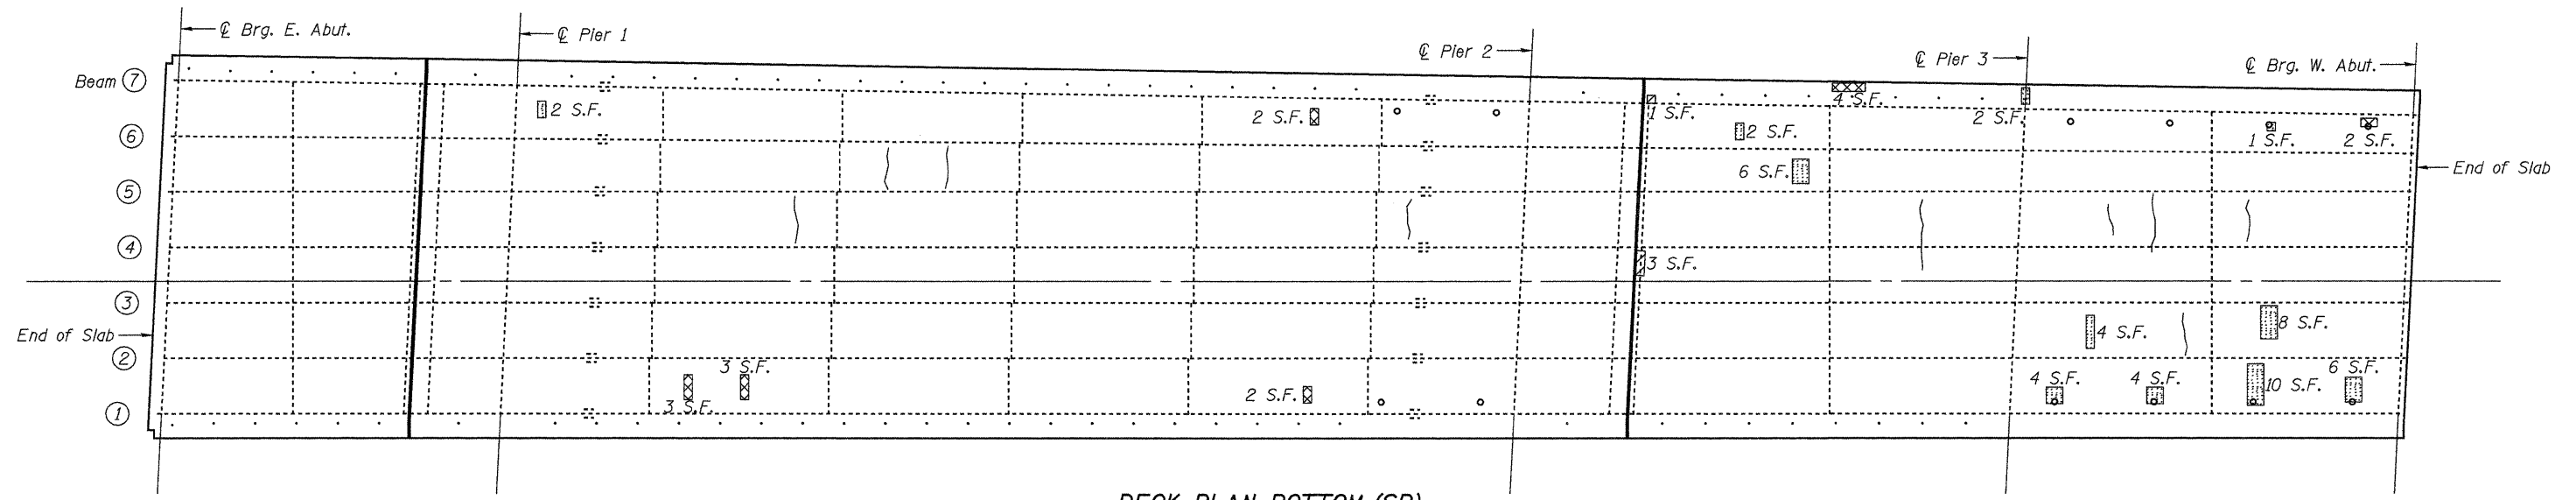


STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

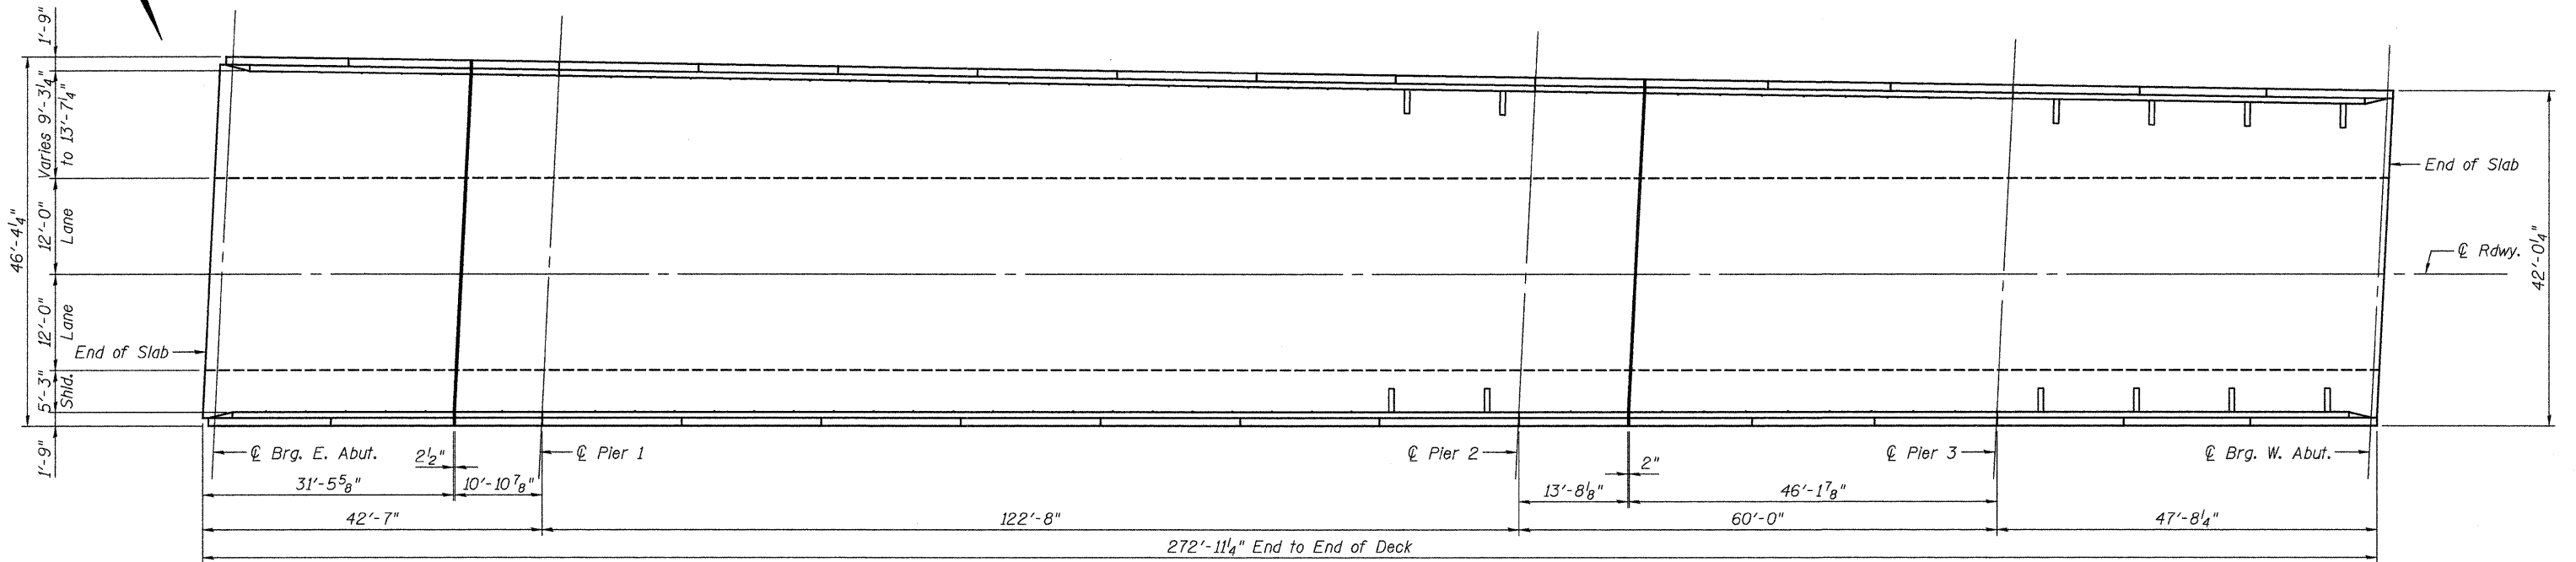

DECK PLAN-BOTTOM (SB)

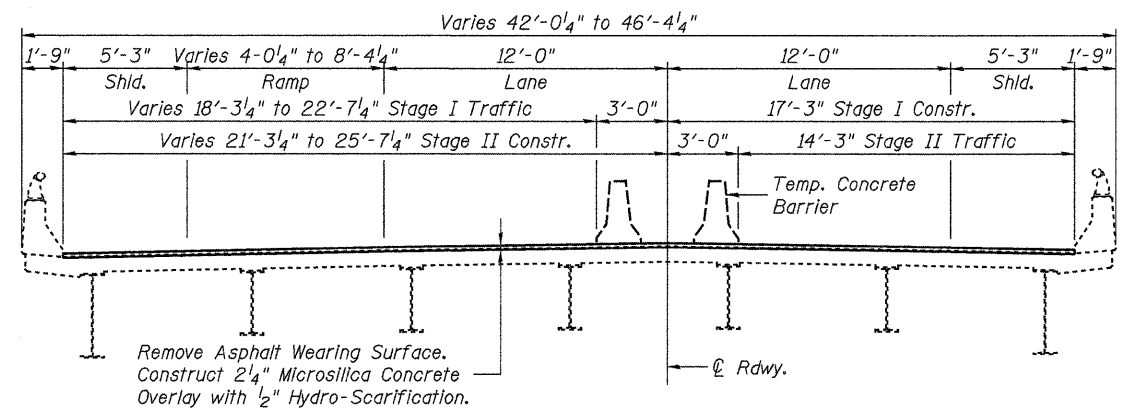

CROSS SECTION
(Southbound, Looking West)

LEGEND

- Hollow or Unsound Concrete
- Spalled Concrete
- Spalled Concrete with Exposed Reinf.
- Hairline Crack

Notes:
 Deck Condition Survey performed 9/17/2009.
 Plan quantities assume that areas of "exposed reinforcing" greater than 5 sq. ft. will use Full-depth Type II repair.
 Repair areas are estimated, the Engineer shall determine actual repair locations and record them on the As-Built plans.
 Partial depth repairs are included with Bridge Deck Hydro-scarification, see Special Provision for Bridge Deck Microsilica Concrete Overlay.

BILL OF MATERIAL

| Item | Unit | Total |
|--|---------|-------|
| Deck Slab Repair (Full Depth, Type II) | Sq. Yd. | 0 |

Johnson, Depp & Quisenberry
CONSULTING ENGINEERS
Springfield, Illinois

| | |
|---------------|---------------|
| DESIGNED: JDQ | DRAWN: P. Ray |
| CHECKED: DCD | CHECKED: DCD |

DECK PLAN (SB)
STRUCTURE NO. 058-0108(SB) & 0109(NB)

| | | | | | |
|---------------------|-----------------|---------------------------|--------------------|------------------|---------------|
| SHEET 4 OF 26 | F.A.P. RTE. 322 | SECTION (58-20)RS | COUNTY MACON | TOTAL SHEETS 151 | SHEET NO. 106 |
| | STA. 235+00.78 | | CONTRACT NO. 74150 | | |
| FED. ROAD DIST. NO. | | ILLINOIS FED. AID PROJECT | | | |

FILE: J:\JDD\10177 IL-DTVM#8 USS1Brdge Repairs\3-IL48-NSRR\058008-74150-004-supersftr1-SB.dgn
USER: DCD
DATE: 04/09/2010 10:02:32