


PIER 3 ELEVATION EAST FACE
Looking West

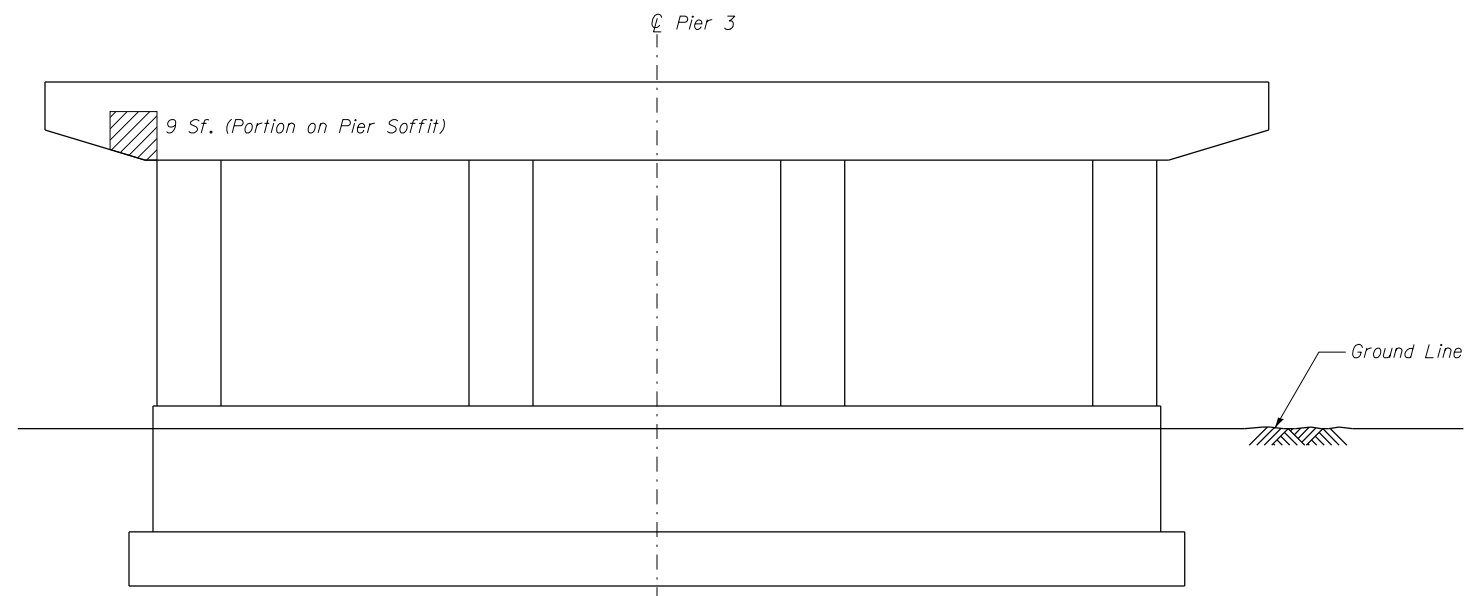

PIER 3 ELEVATION WEST FACE
Looking East

INTERIOR GIRDER REACTION TABLE		
Pier 3		
R_{DL}	(k)	62.4
R_{SDL}	(k)	29.4
R_{LL}	(k)	48.2
R_{Imp}	(k)	12.6
R_{TOTAL}	(k)	152.6

Note:
Lighting conduits are located along each abutment. The Contractor is responsible for protection, support, re-hanging, etc. of all conduits for the duration of the project. Cost included in the pay item "Protection and Maintenance of Existing Underpass Luminaires." The Contractor will be required to repair any damage done to the conduit to the satisfaction of the Engineer. No splicing will be allowed to any cable damage resulting from this work, instead the Contractor will be required to repair the entire span of any damaged cable at no additional cost to the Department.

BILL OF MATERIAL

SYMBOL	ITEM	UNIT	QUANTITY
	Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	63
	Temporary Shoring and Cribbing	Each	1