


ASBESTOS CONTAINING MATERIAL TO REMOVED - PARCEL # 6148115 (BUILDING NO. 3)						
MATERIAL NO.	MATERIAL DESCRIPTION	LOCATION	FRIABLE	ASBESTOS TYPE	ASBESTOS %	QUANTITY (SQ FT)
3	MULTI-LAYER EDGE FLASHING	ORIGINAL ROOFS 1, 2, 3, 4, 5	NO	CHRYSOTILE	3%	400 LF
5	BLACK ASPHALT PITHED ROOFING	SECOND SUB-LAYER, ROOF 1	NO	CHRYSOTILE	2%	1,150 SF
7	PATCHING MATERIAL	ROOF 1, VARIOUS LOCATIONS	NO	CHRYSOTILE	2%	50 LF
8	MULTI-LAYER ROOFING	ROOF 6	NO	CHRYSOTILE	5%	3,700 SF
9	MULTI-LAYER EDGE FLASHING	ROOF 6	NO	CHRYSOTILE	5%	360 LF
13	12" X 12" WHITE WITH BROWN SPLOTCHES VINYL FLOOR TILE/MASTIC	SECOND FLOOR, ROOMS 7 AND 8	NO	CHRYSOTILE	MASTIC 5%	135 SF
15	BLACK PANEL MASTIC	ROOM 13	NO	CHRYSOTILE	5%	450 SF
16	GRAY INSULATION	SECOND FLOOR HALLWAY, FUSE BOX	YES	CHRYSOTILE	70%	5 SF
22	12" X 12" WHITE VINYL FLOOR	ROOM 3	NO	CHRYSOTILE	MASTIC 7%	1,100 SF
23	BROWN VINYL SHEET FLOORING	ROOM 3, SUB FLOOR	NO	CHRYSOTILE	5%	1,100 SF

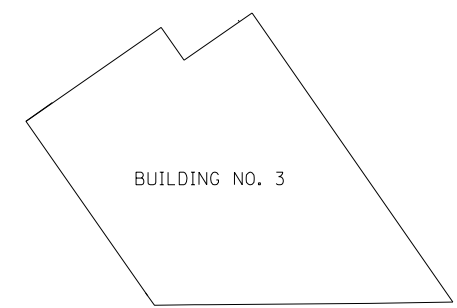

PARCEL NO. 6148115