




SILICONE JOINT SEALER END TREATMENT

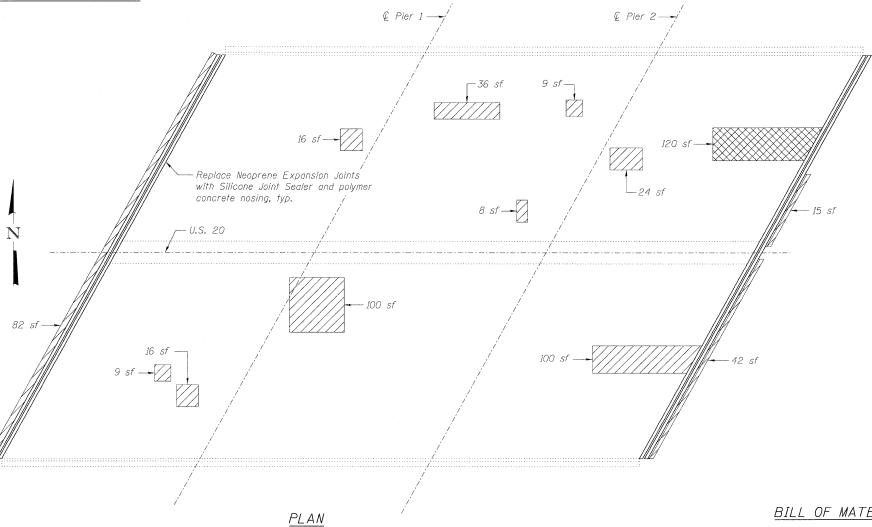

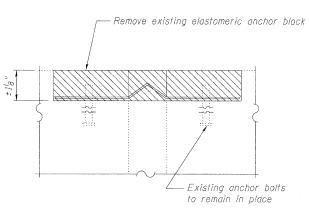

### EXISTING JOINT DETAIL @ ABUTMENTS

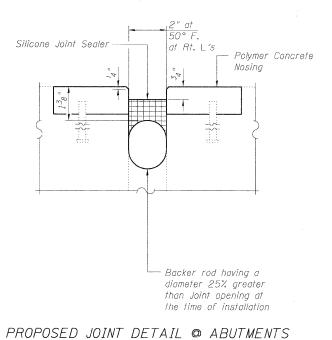

# BILL OF MATERIAL

ITEM	UNIT	TOTAL	
Silicone Joint Sealer, 2"	Foot	167	
Polymer Concrete	Cu. Ft.	11.4	
Deck Slab Repair (Partial)	Sq. Yd.	50.8	
Deck Slab Repair (Full Depth, Type II)	Sq. Yd.	13.3	

## LEGEND

Removal of Existing Joint material



Deck Slab Repair (Full Depth, Type II)



Deck Slab Repair (Partial)

Square Feet

Repair of the existing deck slab shall include but may not be limited to the areas shown. The actual area to be repaired will be determined by the Engineer at the time of construction.

Cost of concrete overlay removal for deck slab repair is included with the cost of Deck Slab Repair.

Cost of existing joint removal is included in the cost of Silicone Joint Sealer.

LIN ENGINEERING, LTD. Consulting Engineers

	USER NAME =	DESIGNED -	TBP	REVISED -
Э.	FILE NAME =	CHECKED -	ADB	REVISED -
	PLOT SCALE =	DRAWN -	AJF	REVISED -
	PLOT DATE =	CHECKED -	MTH	REVISED -
	**************************************			

STATE	E OF	ILLINOIS
DEPARTMENT	0F	TRANSPORTATION

SUPERSTRUCTURE REPAIR		SECTION	COUNTY	TOTAL SHEETS	SHEE
STRUCTURE NO. 016-0217	345	8R-1-RS-4	соок	124	92
			CONTRACT	NO. 6	OM4
SHEET NO. 3 OF 4 SHEETS		ILLINOIS FED. A	ID PROJECT		