


Legend

Potential Deck Slab Repair (Partial)

Date of Survey 10/2009

PLAN

Areas shown for repair are potential areas of deck slab repair. Actual locations and quantities to be determined in the field. Resident Engineer to contact District Bridge Office for assistance with locating patches.

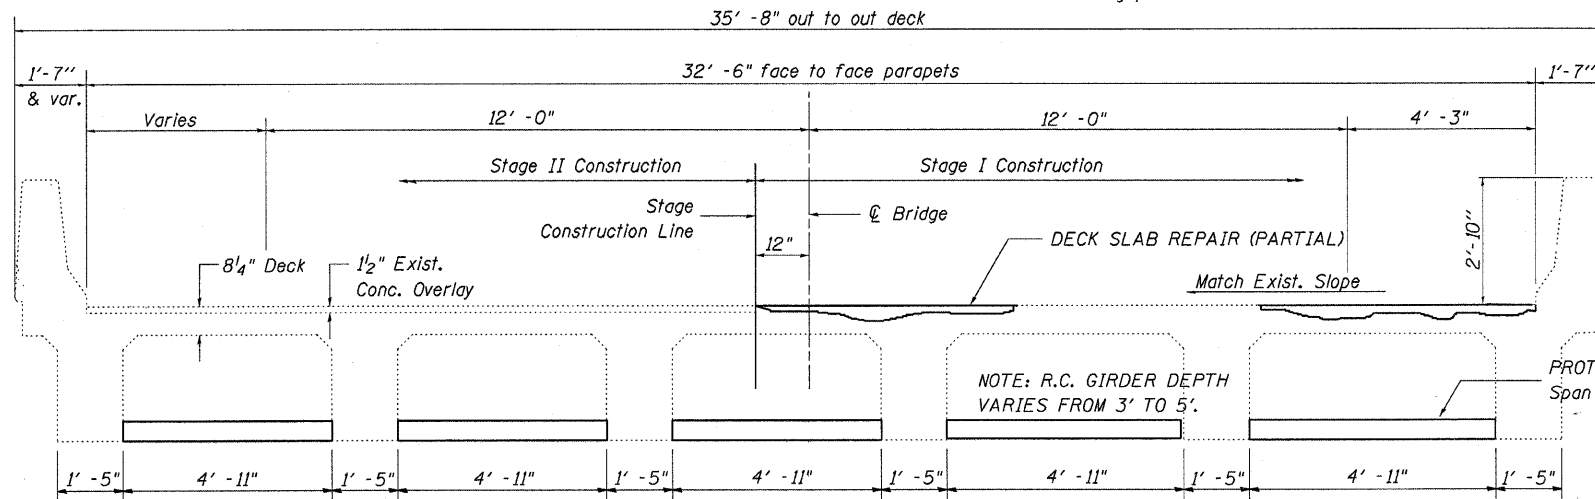

CROSS SECTION
(Looking East)

BILL OF MATERIAL
Eastbound

| | | |
|-------------------------------|-------|-----|
| PROTECTIVE SHIELD | SQ YD | 178 |
| DECK SLAB REPAIR (FULL DEPTH) | SQ YD | 32 |
| DECK SLAB REPAIR (PARTIAL) | SQ YD | 158 |

SUPERSTRUCTURE
EAST BOUND LANES
STRUCTURE NO. 081-0020 (E.B.)
FAI ROUTE 280 Section D2 Br Wear Surf I-280
Rock Island County
Sta. 241+69.27

Contractor is not allowed to drill into the stems of the T-girders in order to anchor the required Protective Shield system.

| | | | | | | | | | | | |
|---|-------------------|------------|--------------|---|--|---------------------------------|--------------------------|---------------------------|-----------------|--------------------|--|
| FILE NAME = G:\BRV\CADD plans\Rock Island County\2010 | USER NAME = lmkdj | DESIGNED - | REVISED - | STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION | SUPERSTRUCTURE 081-0020 | F.A.J. RTE. 280 | SECTION * | COUNTY ROCK ISLAND | TOTAL SHEETS 19 | SHEET NO. 9 | |
| 280 deck repair\PLANeng.dgn | DRAWN - | REVISED - | SCALE: _____ | | | SHEET NO. _____ OF _____ SHEETS | STA. _____ TO STA. _____ | ILLINOIS FED. AID PROJECT | | CONTRACT NO. 64F92 | |
| PLOT SCALE = 58,0000' / IN. | CHECKED - | REVISED - | | | | | | | | | |
| PLOT DATE = Thu Nov 05 11:02:10 2009 | DATE - | REVISED - | | | | | | | | | |