

Table

Table 1. Asbestos Homogeneous Areas Summary
 IDOT - Asbestos Abatement Survey
 WO # 44
 331A East Ford St., Harrisburg, Illinois

HA No.	Material Description	Material Location	Sample Number	Condition	Friability	Asbestos Content	Estimated Quantity	Unit	Notes
1	White 12" x 12" Ceiling Tile	Office 1	1A, 1B, 1C	Good	Friable	NAD	110	SF	
2	White with Brown Swirls 12" x 12" Ceiling Tile	Bathroom	2A, 2B, 2C	Good	Friable	NAD	30	SF	
3	White 12" x 12" Ceiling Tile	Office 2, Office 3	3A, 3B, 3C	Good	Friable	NAD	238	SF	
4	Beige and Green Linoleum	Kitchen	4A, 4B, 4C	Good	Non-Friable	NAD	121	SF	
5	Clear Adhesive associated with HA-4	Kitchen	5A, 5B, 5C	Good	Non-Friable	NAD	121	SF	
6	Beige and Brown Linoleum	Kitchen, Bathroom, Closet	6A, 6B, 6C	Good	Non-Friable	Chrysotile 15-20%	200	SF	Under HA-4 in the kitchen
7	Clear Adhesive associated with HA-6	Kitchen, Bathroom, Closet	7A, 7B, 7C	Good	Non-Friable	Chrysotile 1-5%	200	SF	Under HA-4 in the kitchen
8	Brown Linoleum	Garage	8A, 8B, 8C	Good	Non-Friable	NAD	20	SF	
9	Brown Adhesive associated with HA-8	Garage	9A, 9B, 9C	Good	Non-Friable	NAD	20	SF	
10	Gray Concrete Foundation	Building Exterior, Garage	10A, 10B, 10C	Good	Non-Friable	NAD	2,880	SF	
11	White Rose Patterned Wallpaper	Office 2	11A, 11B, 11C	Good	Non-Friable	NAD	200	SF	
12	Brown and Tan Vermiculite	Attic	12A, 12B, 12C	Good	Friable	Assumed ACM	480	CF	
13	White Skim Coat Plaster	Walls Throughout	13A, 13B, 13C, 13D, 13E	Good	Non-Friable	NAD	4,500	SF	
14	Gray Basecoat Plaster	Walls Throughout	14A, 14B, 14C, 14D, 1E	Good	Non-Friable	NAD	4,500	SF	
15	White Gypsum Board	Kitchen Ceiling	15A, 15B, 15C	Good	Non-Friable	NAD	140	SF	

Table 1. Asbestos Homogeneous Areas Summary
IDOT - Asbestos Abatement Survey
WO # 44
331A East Ford St., Harrisburg, Illinois



HA No.	Material Description	Material Location	Sample Number	Condition	Friability	Asbestos Content	Estimated Quantity	Unit	Notes
16	Black Asphalt Shingles	House Roof	16A, 16B, 16C	Good	Non-Friable	NAD	1,500	SF	
17	Black Felt Paper under HA-16	House Roof	17A, 17B, 17C	Good	Non-Friable	NAD	1,500	SF	
18	Red Asphalt Shingles Under Siding	House Siding	18A, 18B, 18C	Good	Non-Friable	NAD	2,020	SF	
19	White Window Caulk	Exterior Windows	19A, 19B, 19C	Good	Non-Friable	NAD	80	LF	
20	White Marble Patterned Wallboard	Bathroom	20A, 20B, 20C	Good	Non-Friable	NAD	200	SF	
21	Black Sink Undercoating	Kitchen	21A, 21B, 21C	Good	Non-Friable	Chrysotile 1-5%	4	SF	
22	Silver Heat Shield Paper	Under Baseboard Heaters in Office 1, Office 2, Office 3, Kitchen	22A, 22B, 22C	Good	Non-Friable	NAD	85	LF	
23	Black Felt Paper associated with HA-18	House Siding	23A, 23B, 23C	Good	Non-Friable	NAD	2,020	SF	
24	Red and Gray 9" x 9" Floor Tile	Garage	24A, 24B, 24C,	Good	Non-Friable	NAD	20	SF	
25	Gray Mastic associated with HA-24	Garage	25A, 25B, 25C, 24A Mastic, 24B Mastic, 24C Mastic	Good	Non-Friable	NAD	20	SF	The laboratory analyzed additional samples of the mastic associated with HA-24 (24A Mastic, 24B Mastic, 24C Mastic)
26	Black Felt Paper under HA-24	Garage	26A, 26B, 26C	Good	Non-Friable	NAD	20	SF	

Notes:

ACM = Asbestos-Containing Material

Assumed ACM = A material determined by the inspector to be suspect ACM and is considered asbestos-containing until laboratory analysis can prove otherwise.

NAD = No Asbestos Detected


EA = Each

LF = Linear Foot

SF = Square Foot


Figures

G:\Shared drives\Project\2025\0529 Arcadis Work Order 44\2025\0529_CADD_Arcadis WO #44 - 331A East Ford Street, Harrisburg, IL_SC_20250819.dwg LAYOUT: 1 SAVED: 8/19/2025 6:53 PM ACADVER: 25.1S (LMS TECH) PAGES: 1 PLOT: 8/22/2025 11:18 AM BY: SARAH CLARK

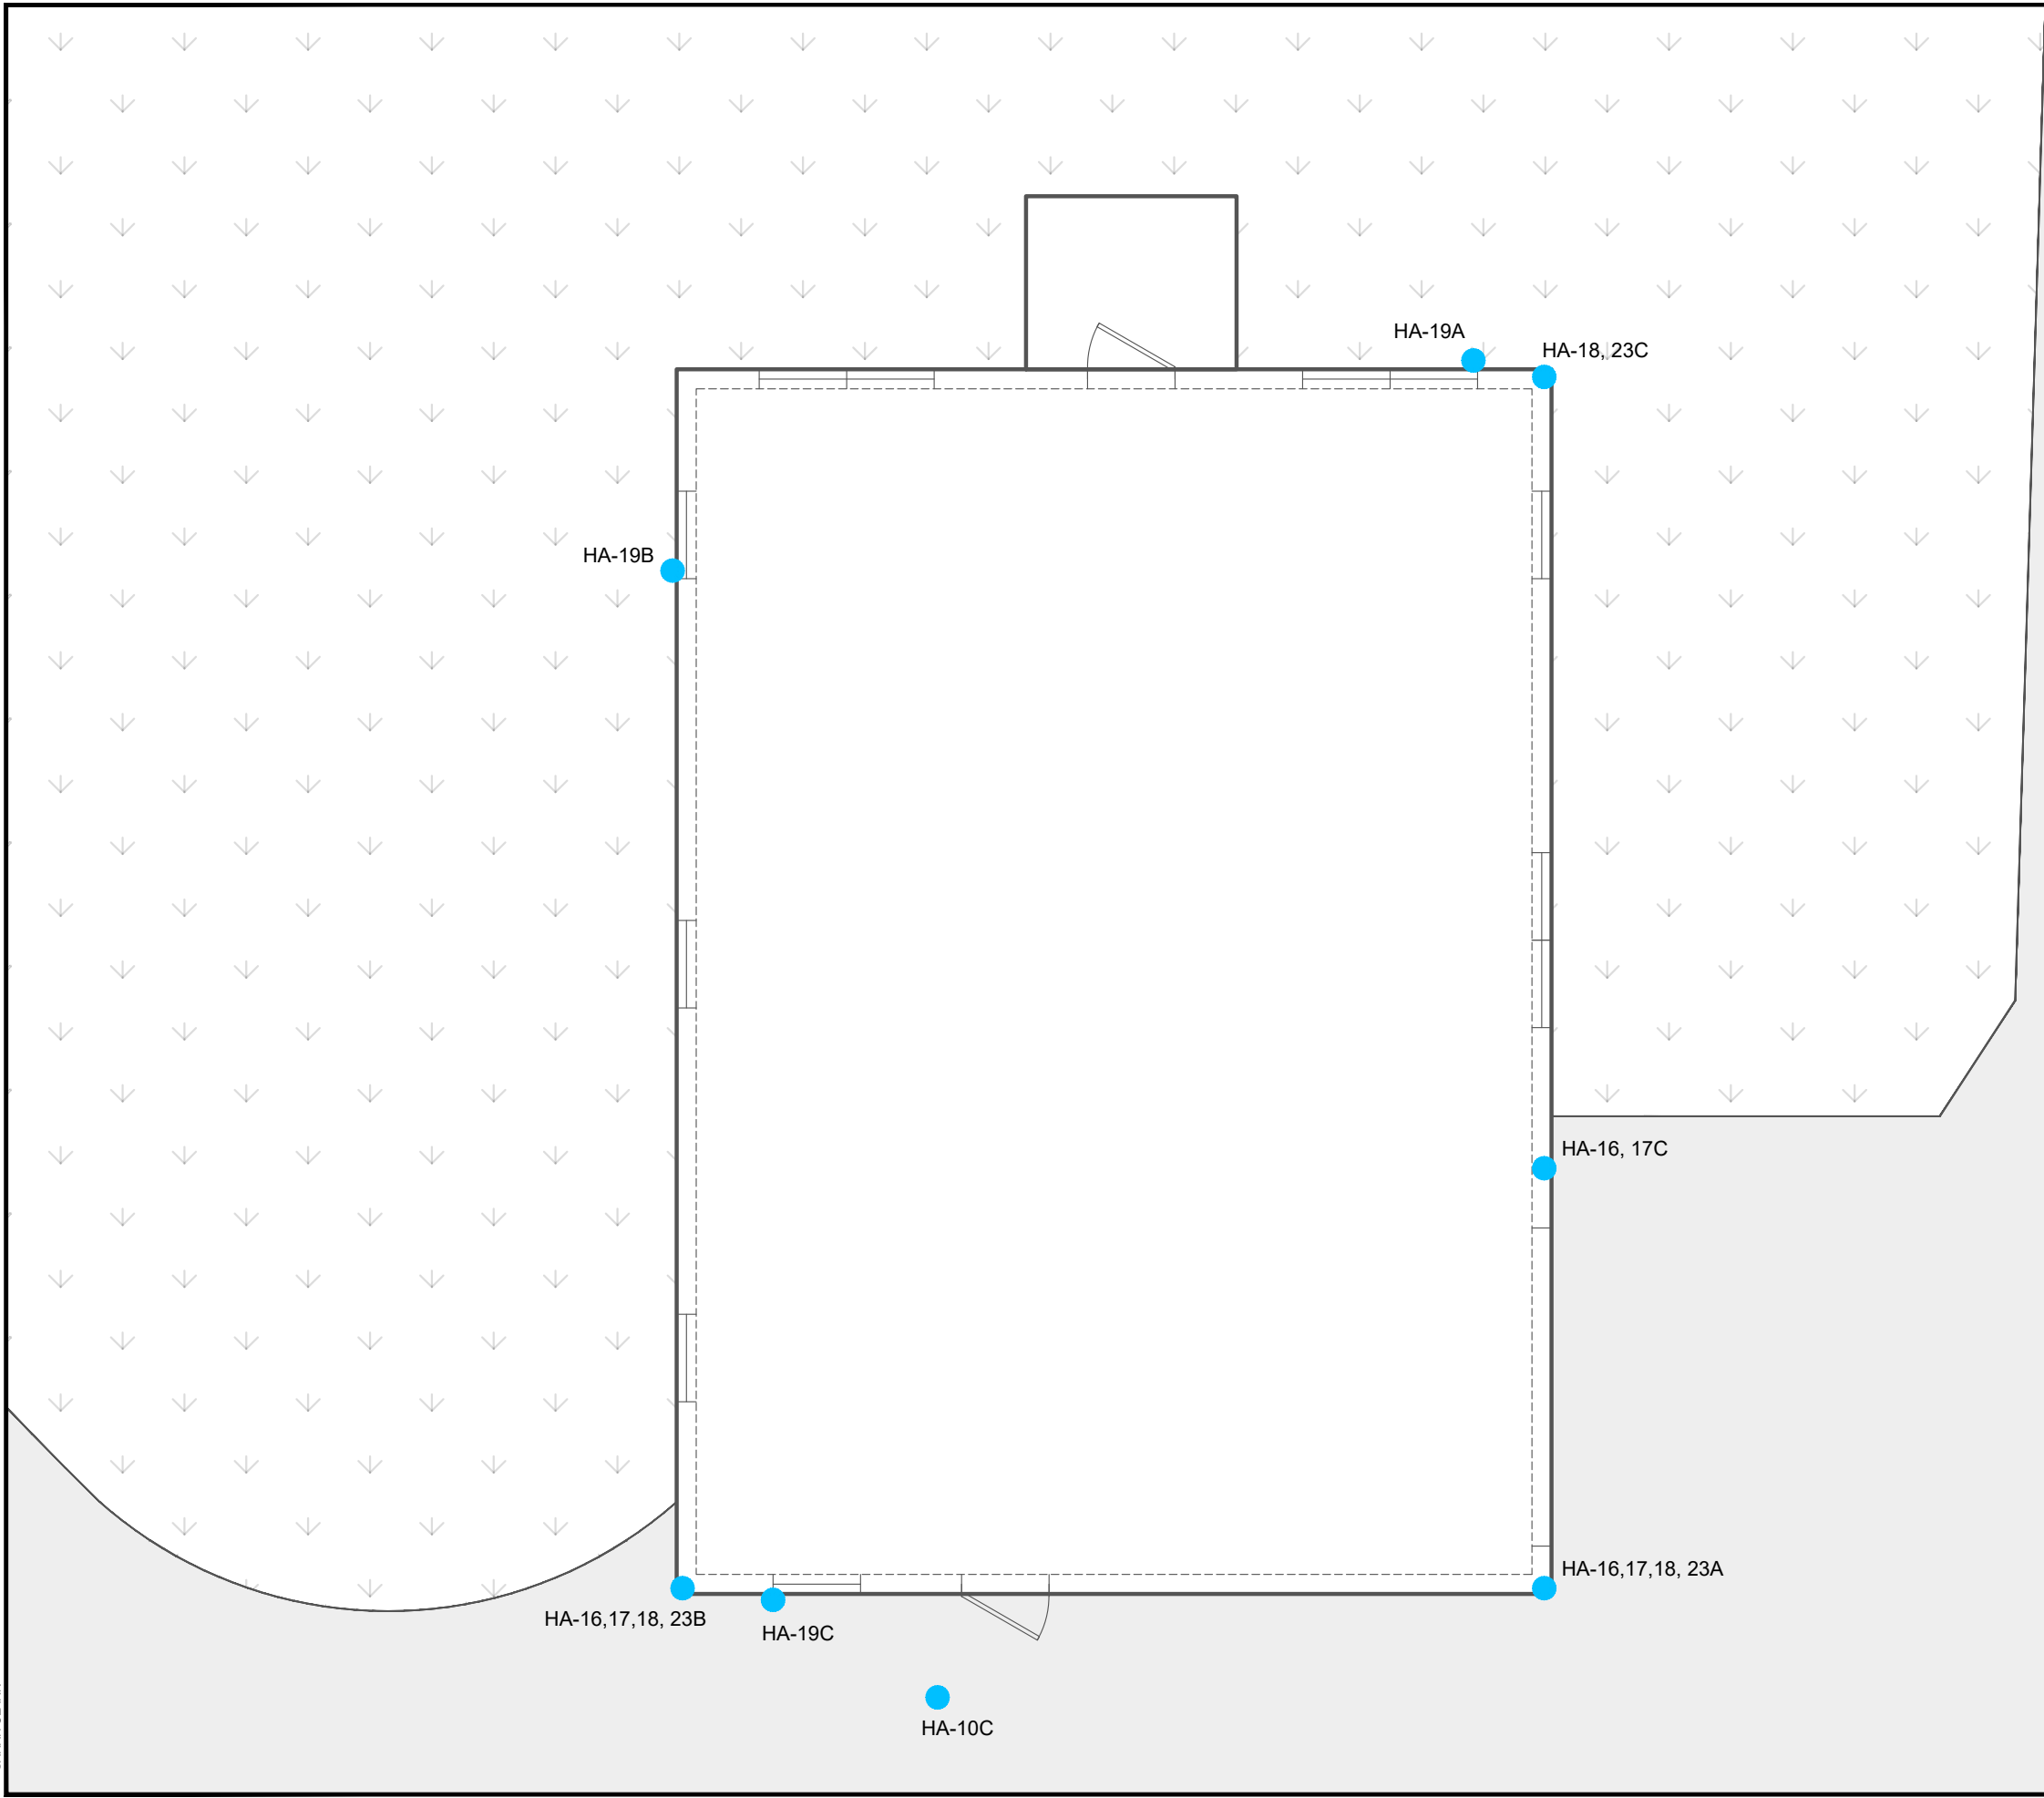

LEGEND
● ASBESTOS SAMPLE


NOTE
BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

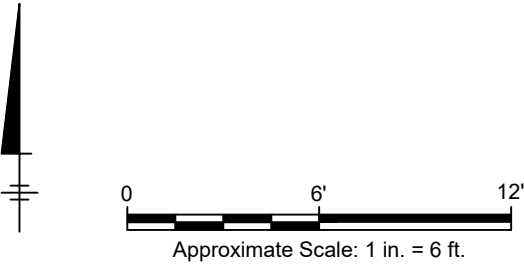

30291391.01 - IDOT / Asbestos Surveys WO #44
Job No. R-99-005-73
Route IL13 (FAP 331) Parcel 9015698
331A East Ford St.
Harrisburg, Saline County, Illinois
ASBESTOS ABATEMENT SURVEY

**SAMPLING LOCATIONS -
EXTERIOR**



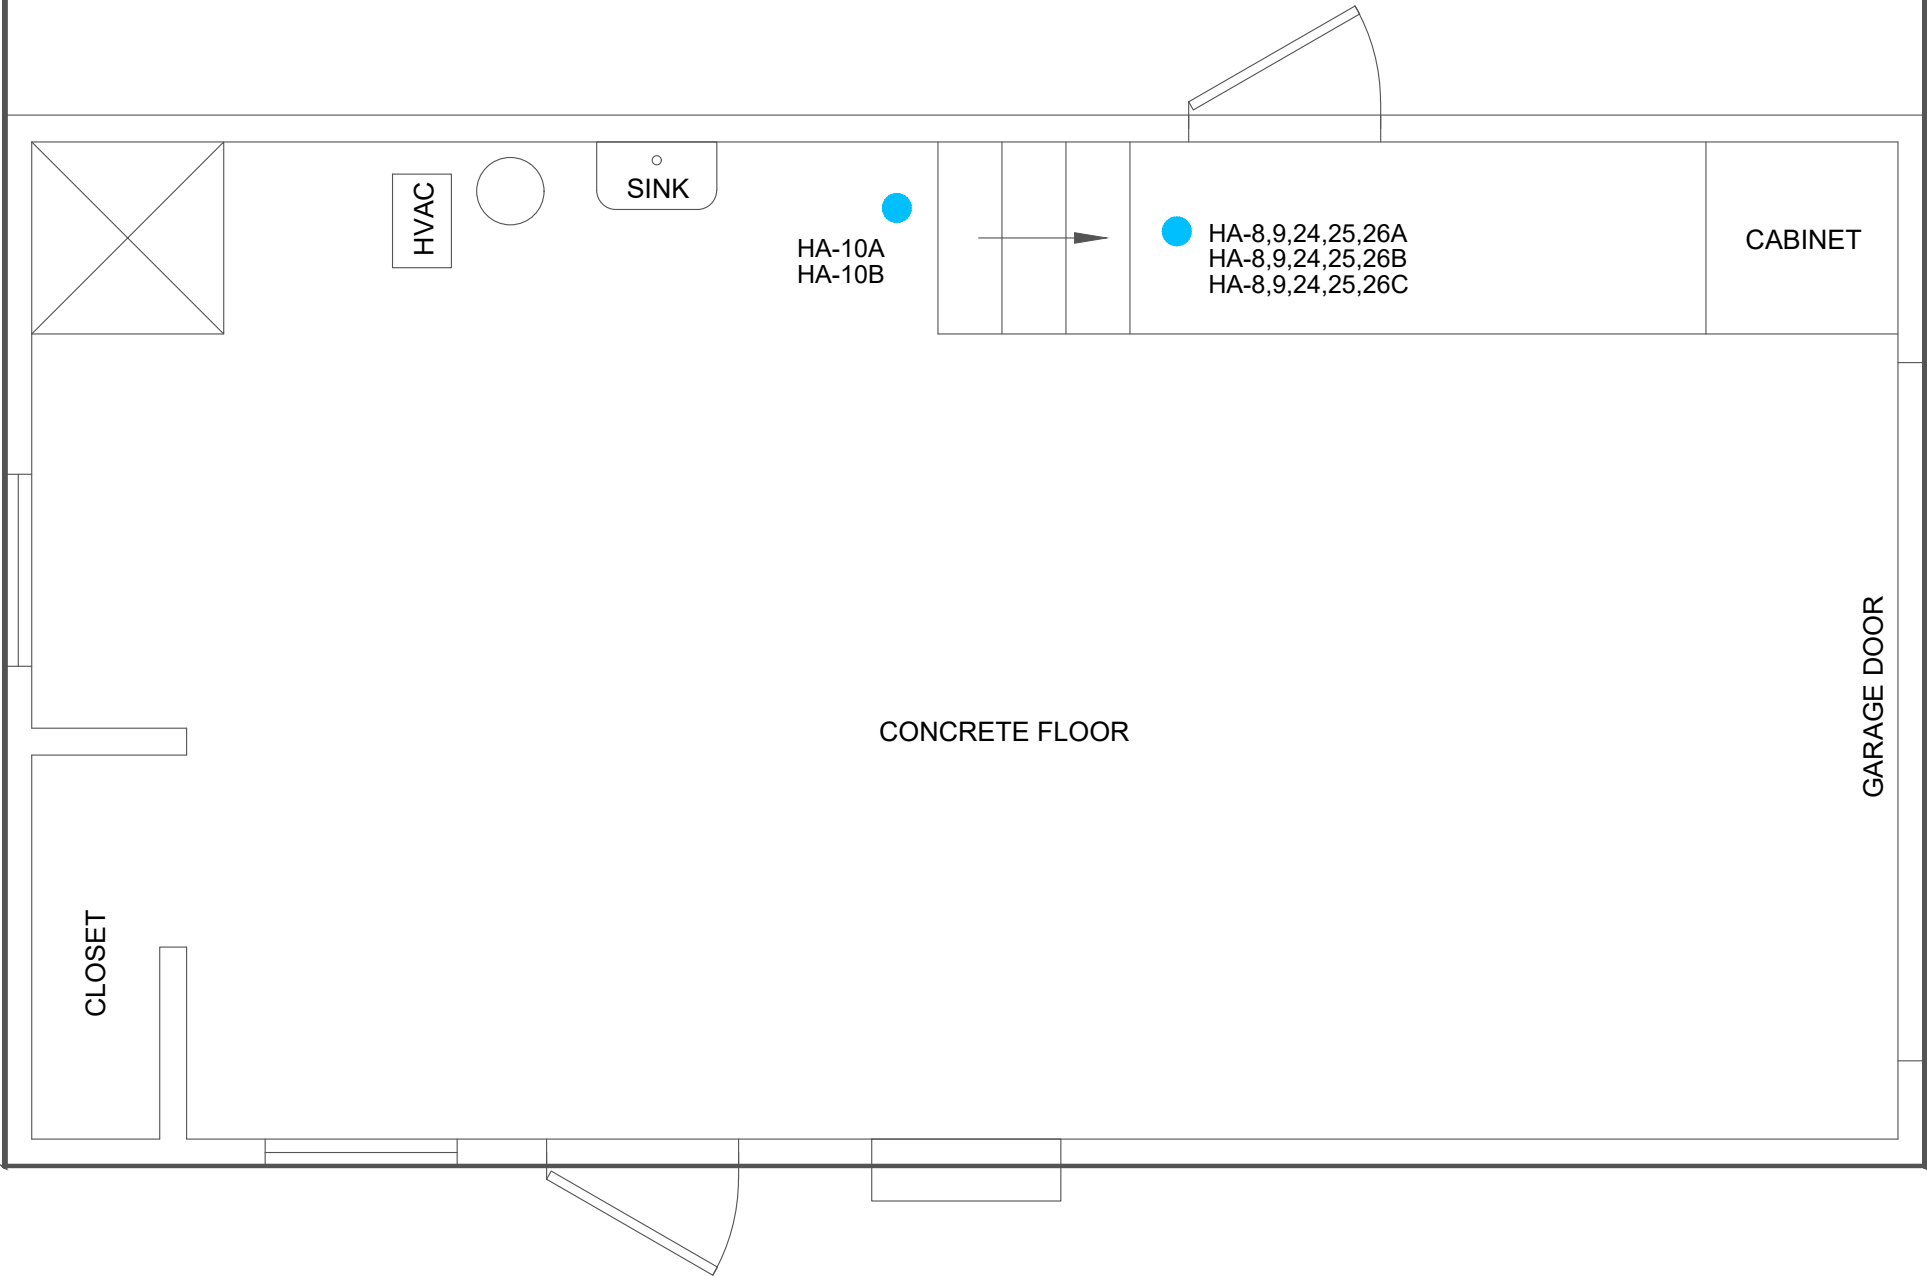


LEGEND

● ASBESTOS SAMPLE

NOTE


BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

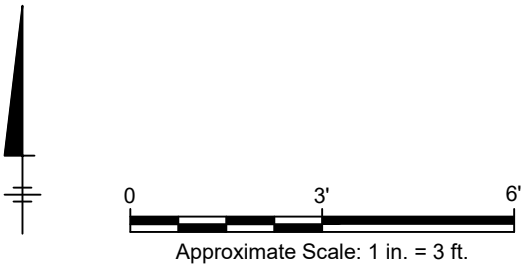

30291391.01 - IDOT / Asbestos Surveys WO #44
Job No. R-99-005-73
Route IL13 (FAP 331) Parcel 9015698
331A East Ford St.
Harrisburg, Saline County, Illinois
ASBESTOS ABATEMENT SURVEY

**SAMPLING LOCATIONS -
GARAGE**



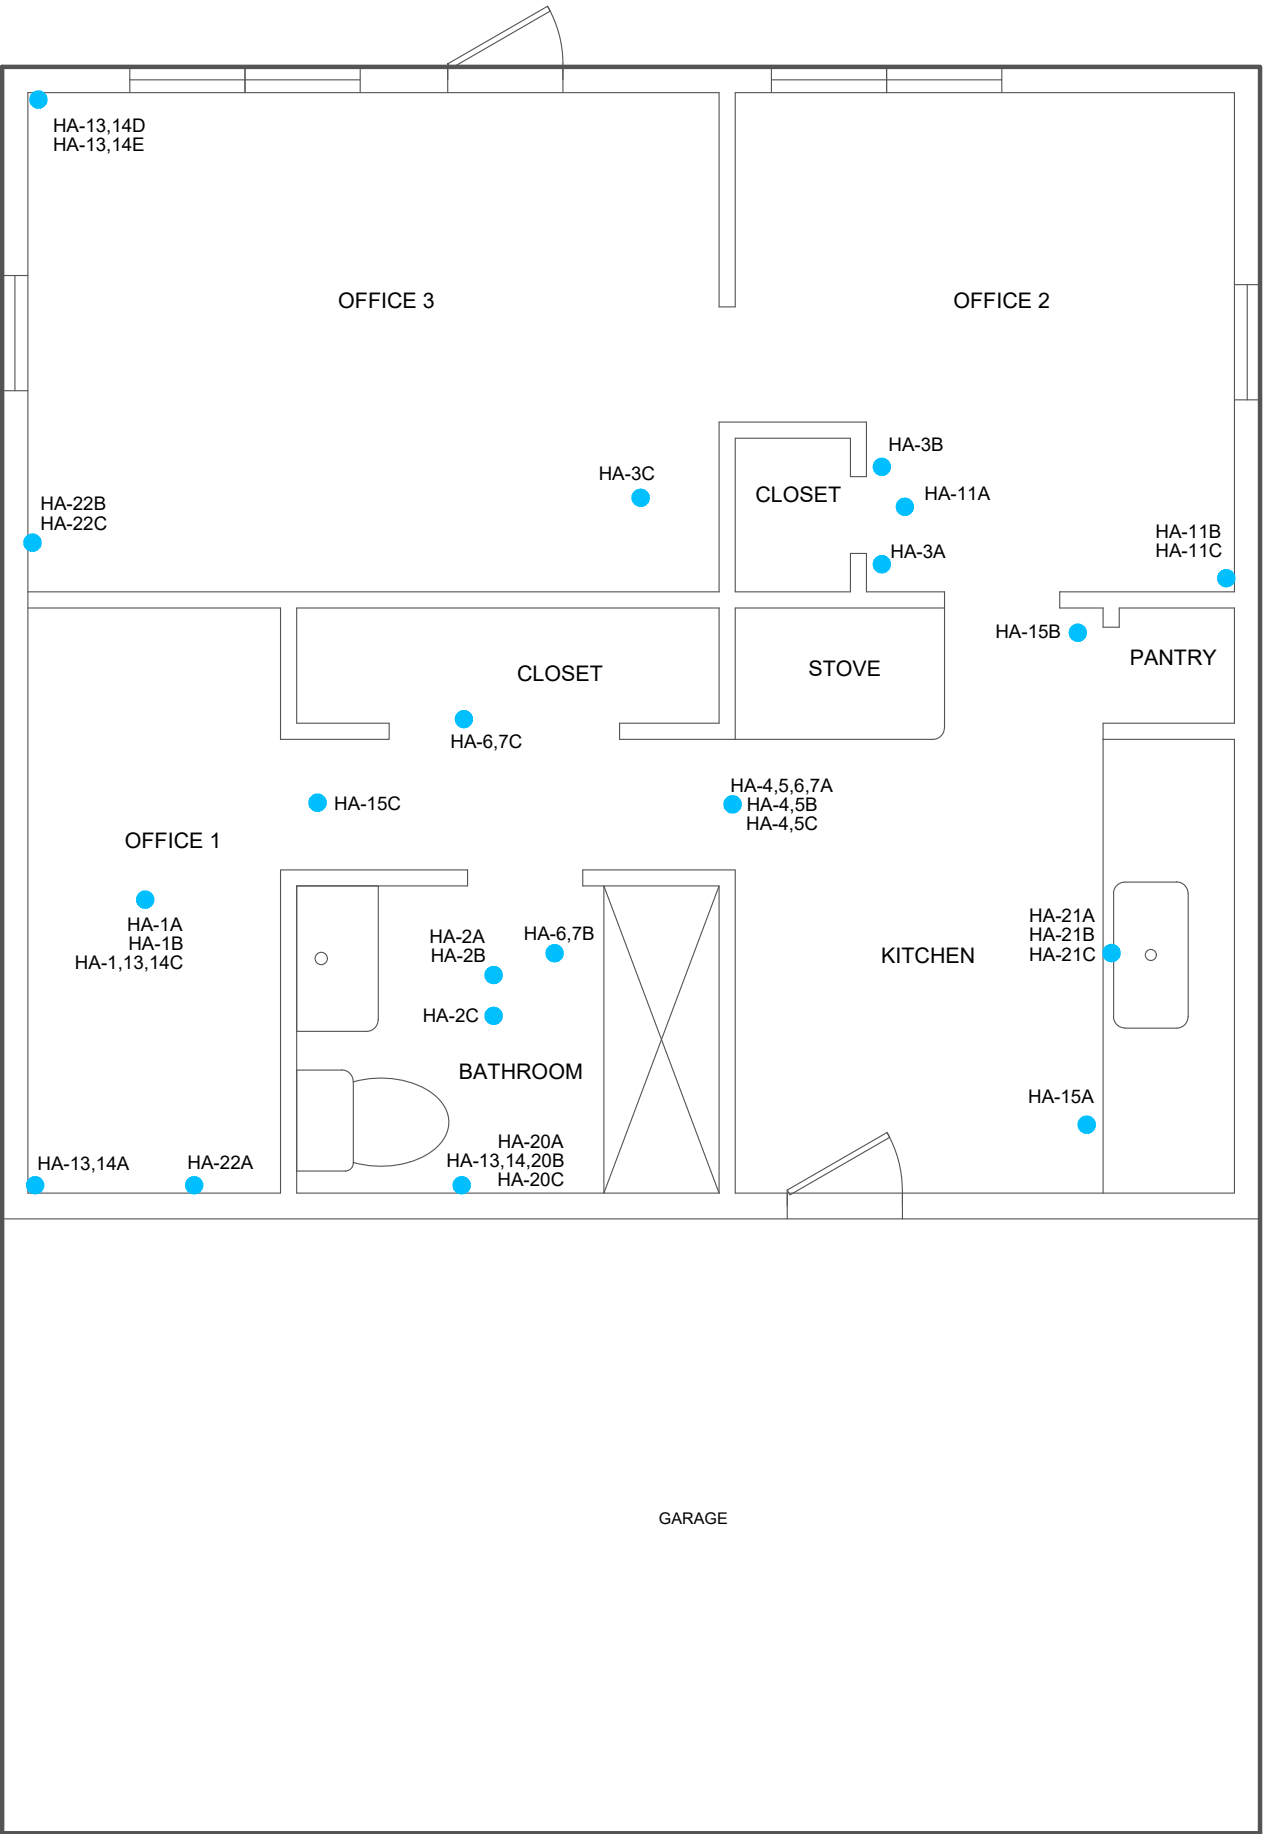


LEGEND

● ASBESTOS SAMPLE

NOTE


BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

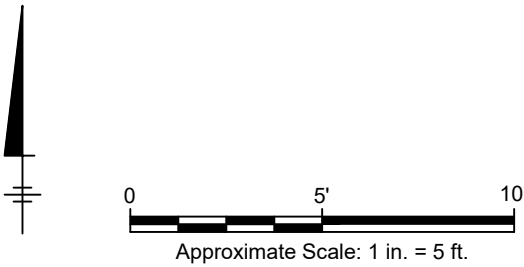

30291391.01 - IDOT / Asbestos Surveys WO #44
Job No. R-99-005-73
Route IL13 (FAP 331) Parcel 9015698
331A East Ford St.
Harrisburg, Saline County, Illinois
ASBESTOS ABATEMENT SURVEY

**SAMPLING LOCATIONS -
FIRST FLOOR**






LEGEND

- ASBESTOS SAMPLE

NOTE

BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

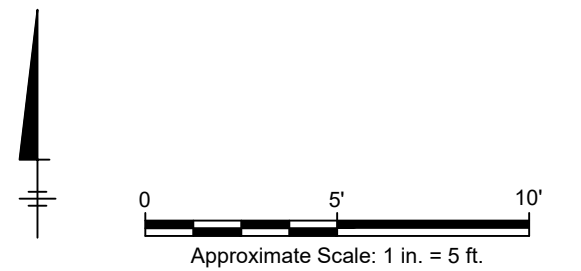


30291391.01 - IDOT / Asbestos Surveys WO #44
Job No. R-99-005-73
Route IL13 (FAP 331) Parcel 9015698
331A East Ford St.
Harrisburg, Saline County, Illinois
ASBESTOS ABATEMENT SURVEY

SAMPLING LOCATIONS - ATTIC




FIGURE 4

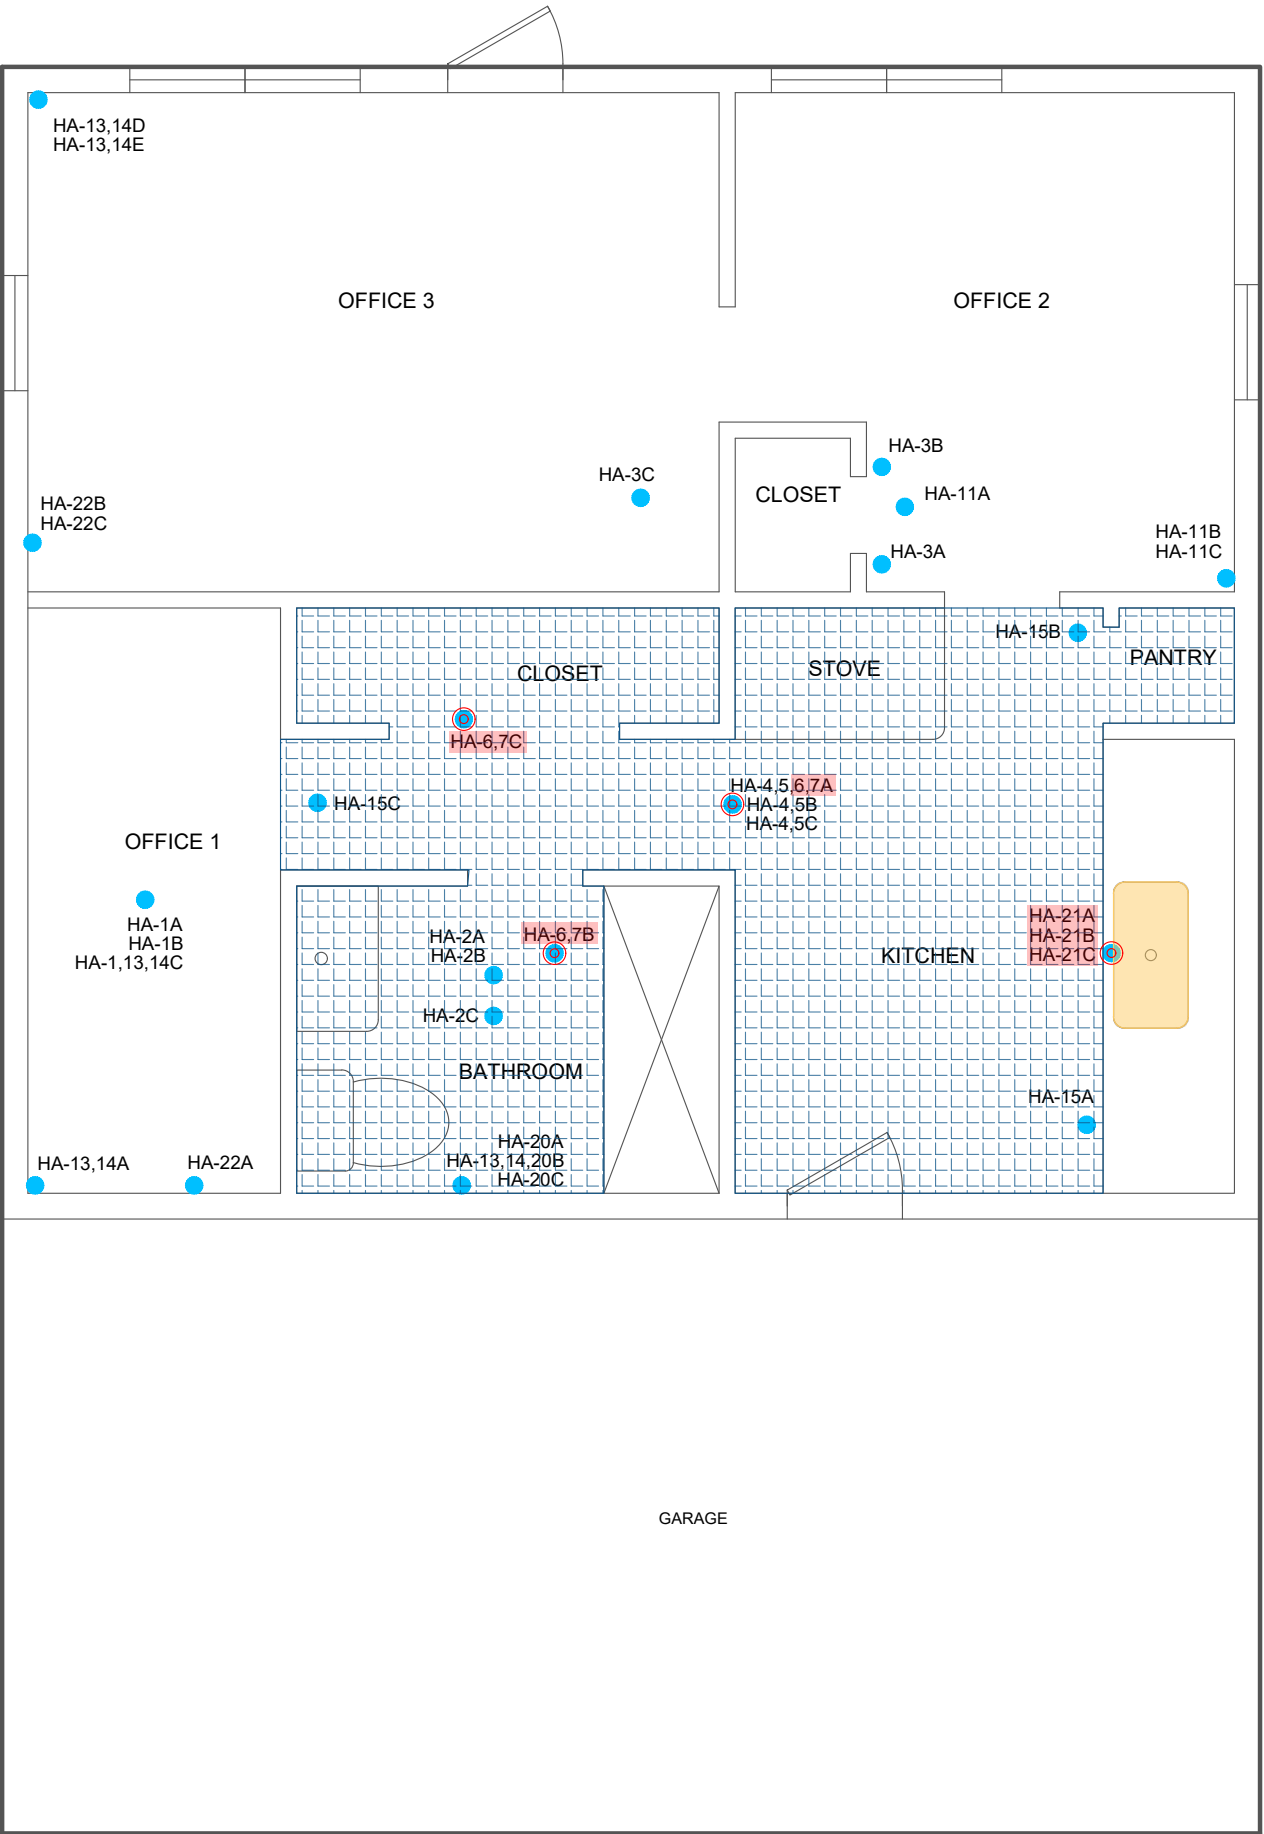


- LEGEND**
- ASBESTOS SAMPLE
 - ⊙ POSITIVE SAMPLE
 - HA-6: Beige & Brown Linoleum
HA-7: Clear Adhesive Assoc. w/ HA-6
 - HA-21: Black Sink Undercoating

NOTE
BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

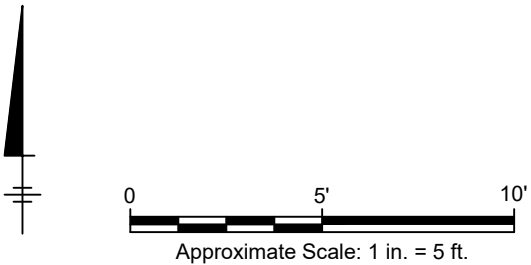


30291391.01 - IDOT / Asbestos Surveys WO #44 Job No. R-99-005-73 Route IL13 (FAP 331) Parcel 9015698 331A East Ford St. Harrisburg, Saline County, Illinois ASBESTOS ABATEMENT SURVEY	
ASBESTOS CONTAINING MATERIAL LOCATIONS - FIRST FLOOR	
	FIGURE 5

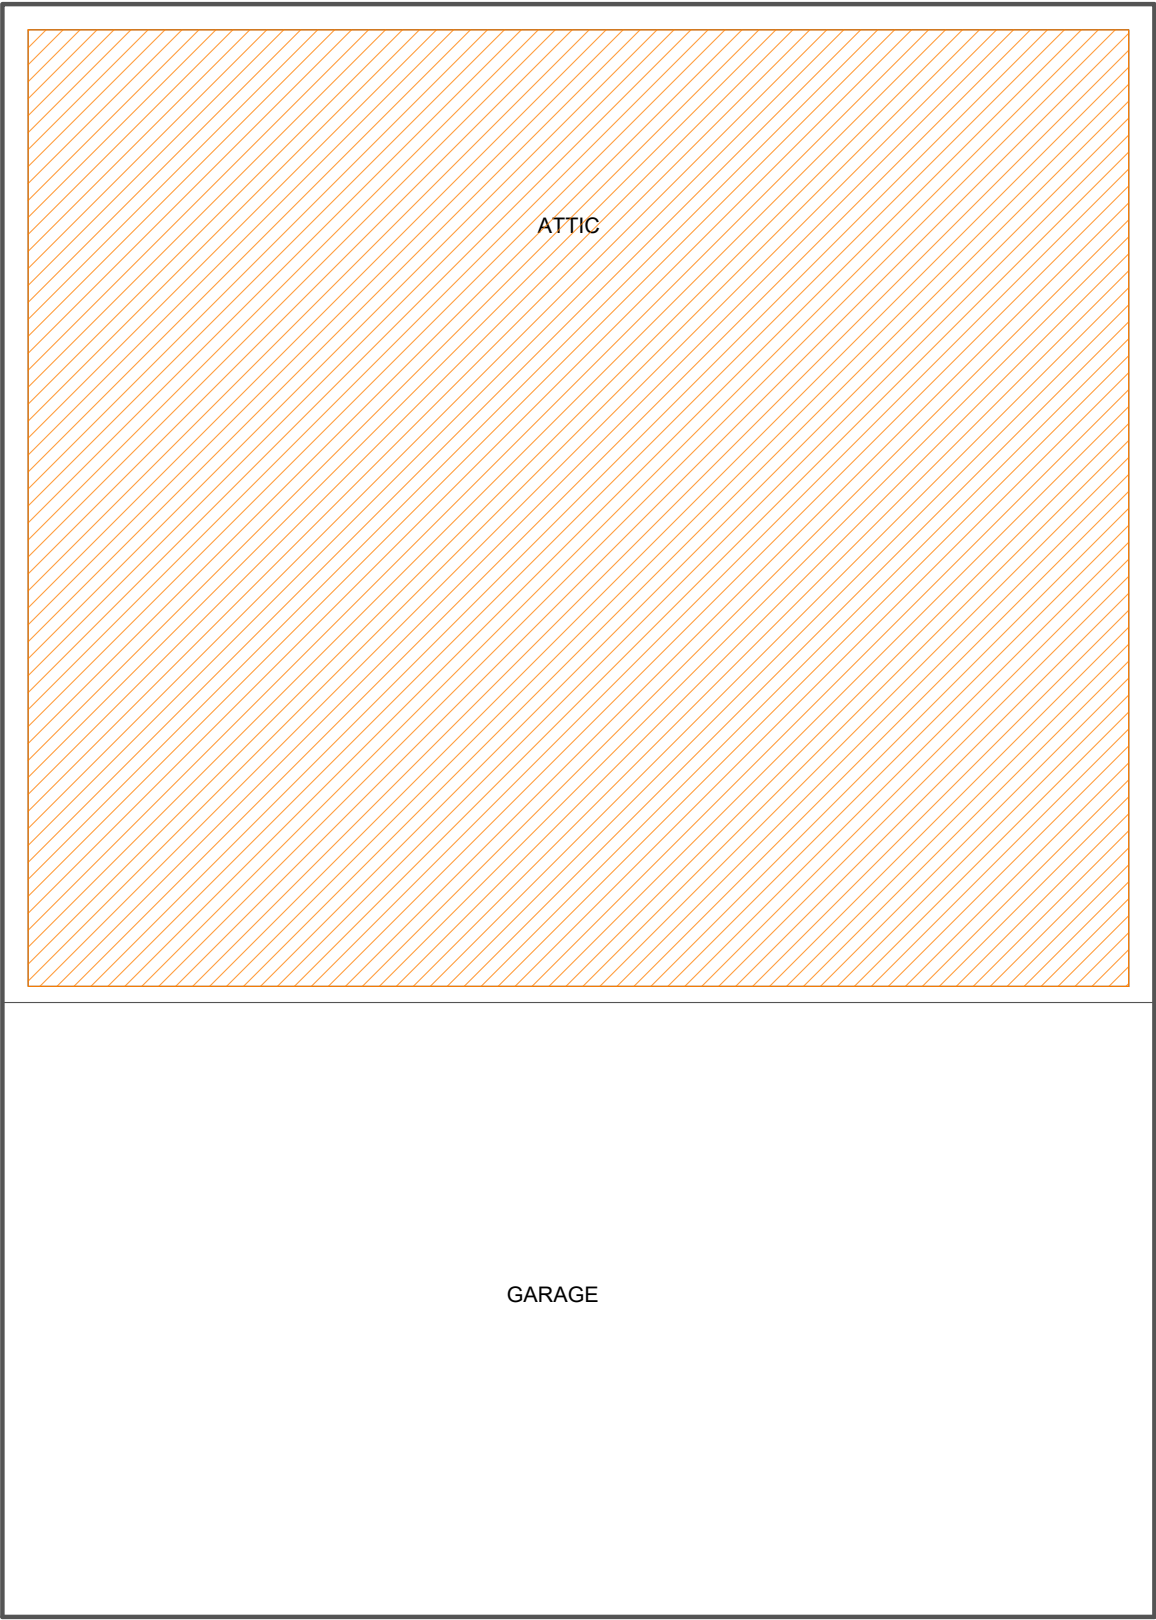

- LEGEND**
- ASBESTOS SAMPLE
 - ⊙ POSITIVE SAMPLE
 - ▨ HA-12: Brown & Tan Vermiculite (Not Sampled - Assumed ACM)

NOTE
BASE MAP DEVELOPED FROM ONSITE INVESTIGATION.

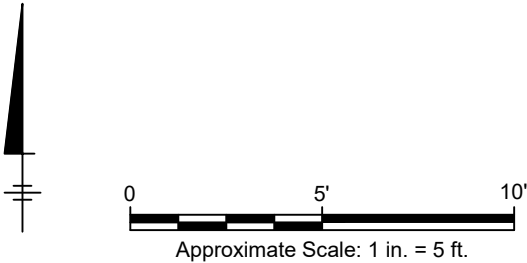

30291391.01 - IDOT / Asbestos Surveys WO #44 Job No. R-99-005-73 Route IL13 (FAP 331) Parcel 9015698 331A East Ford St. Harrisburg, Saline County, Illinois ASBESTOS ABATEMENT SURVEY	
ASBESTOS CONTAINING MATERIAL LOCATIONS - ATTIC	
ARCADIS	FIGURE 6