




**END VIEW - PIER 1**  
(I-72 E.B. North Side)

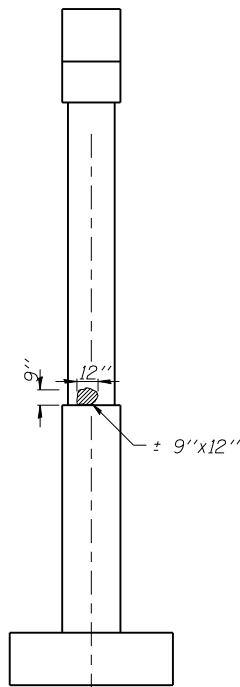


**END VIEW - PIER 1**  
(I-72 E.B. South Side)

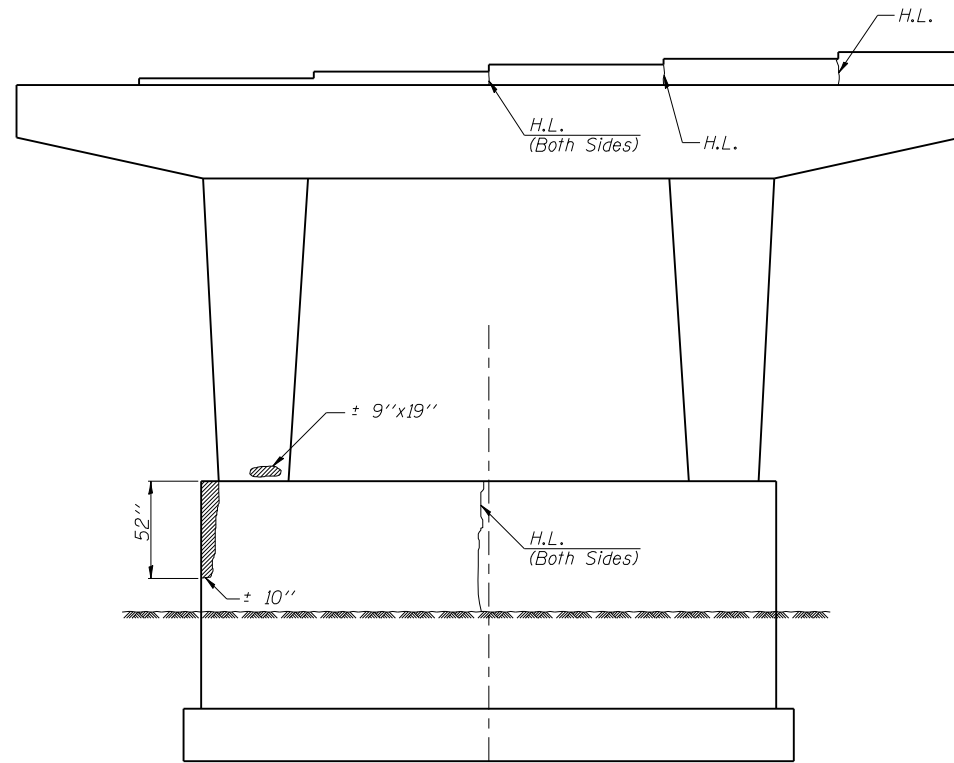


**PIER 1 I-72 E.B.**  
(Looking East)

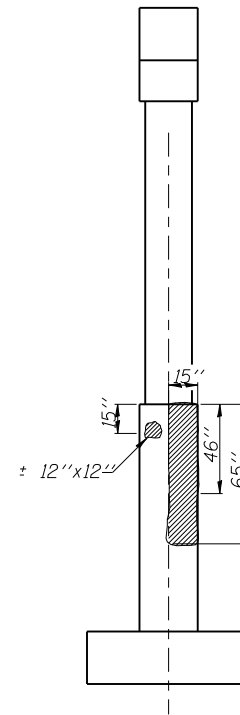


**END VIEW - PIER 1**  
(I-72 W.B. North Side)

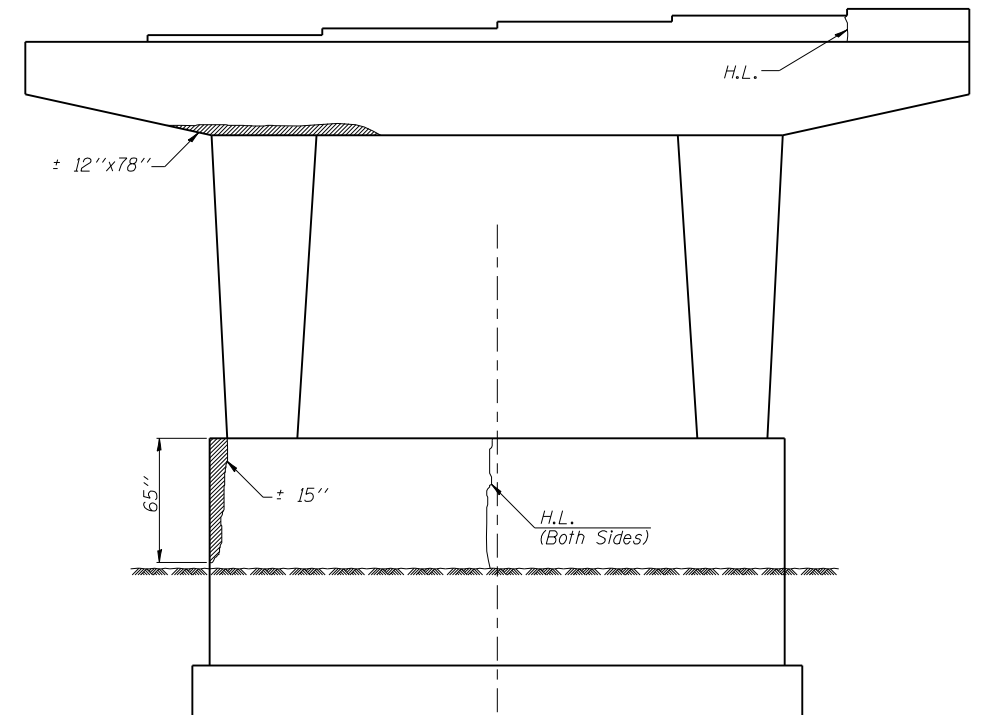


**PIER 1 I-72 W.B.**  
(Looking East)

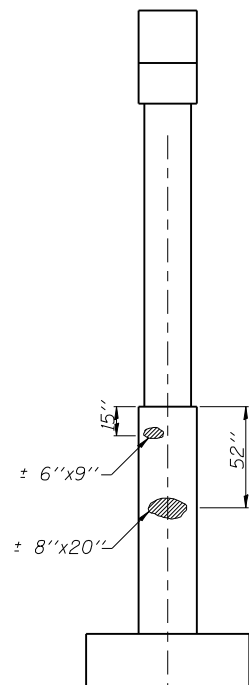

**END VIEW - PIER 2**  
(I-72 E.B. North Side)

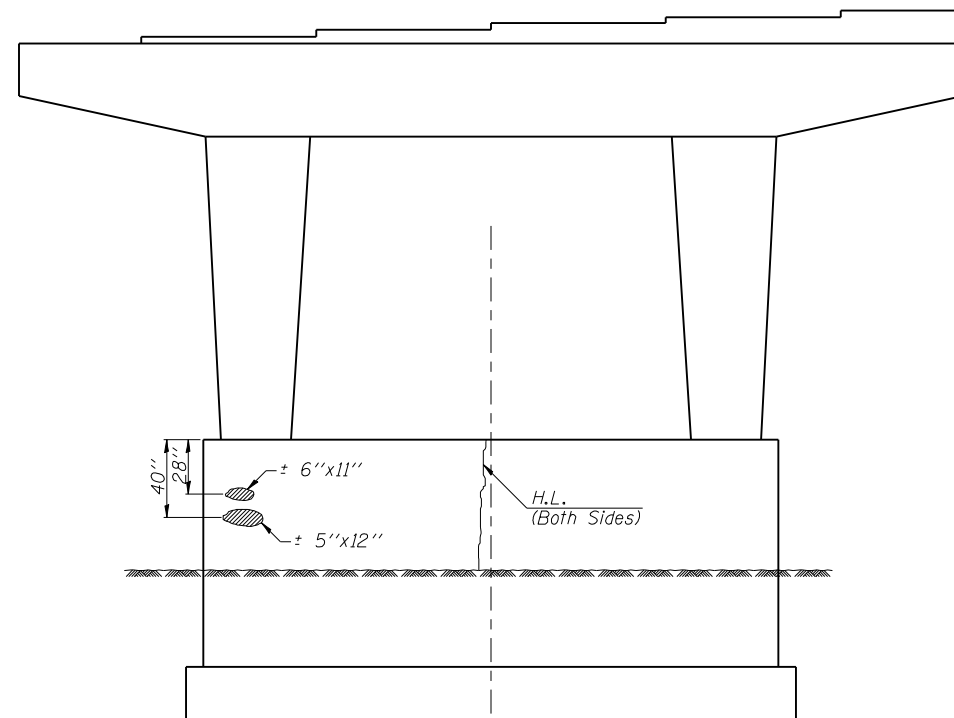

**PIER 2 I-72 E.B.**  
(Looking East)

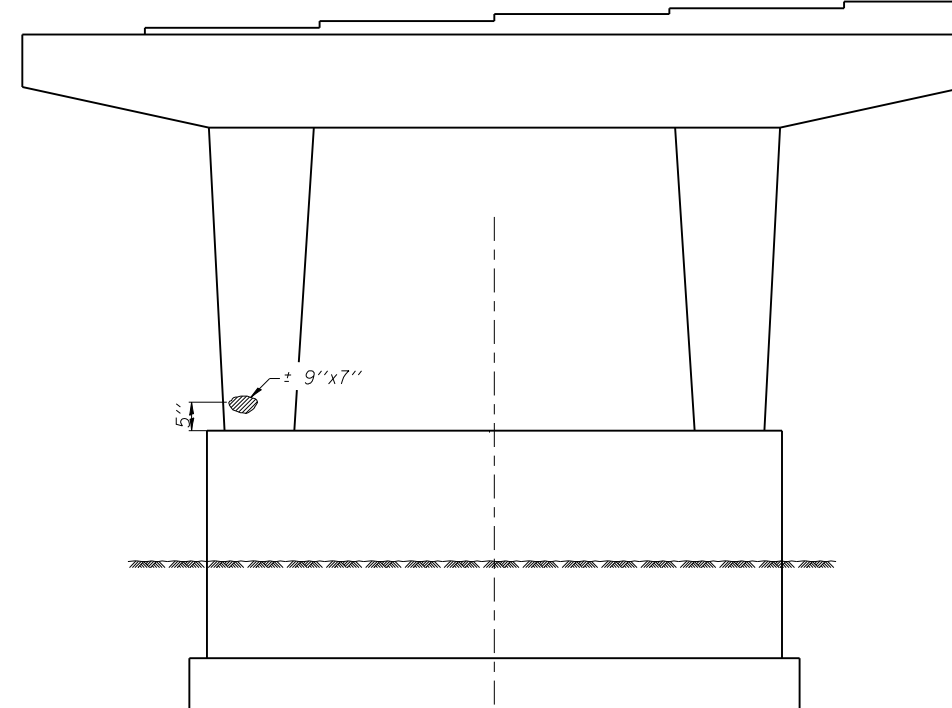

**PIER 2 I-72 W.B.**  
(Looking East)

**LEGEND**

- Structural Repair of Concrete (Depth equal to or less than 5 inches)
- (H.L.) - Hairline Crack not to be sealed

Note: Dimensions shown for repair are for estimating purpose only. Final limits of repair are to be determined in the field.

**BILL OF MATERIAL**

Item	Unit	Total
Structural Repair of Concrete (Depth equal to or less than 5 inches)	Sq. Ft.	33

Corporate License Number 184-001-084

**SUBSTRUCTURE REPAIRS**  
F.A.I. 72 OVER UNION PACIFIC RAILROAD  
SECTION (84-9-4)A,HBK,BY,BY-1  
SANGAMON COUNTY  
STATION 608+51.98  
STR NO. 084-0074 EB - 084-0075 WB

© Copyright Hanson Professional Services Inc. SMS\_YEARS



JOB#

96S2002B

DATE

01/12/06

LAYOUT MWM 06/27/03  
DRAWN DAP 07/17/03  
REVIEWED JMM 10/27/03

\$FILE# 12/16/2006