


**WEST ABUTMENT ELEVATION**

(Looking West, E.F. = Each Face)

\*See Section for placement  
 \*\*Elevations shown are located at top of seat and End of Beam

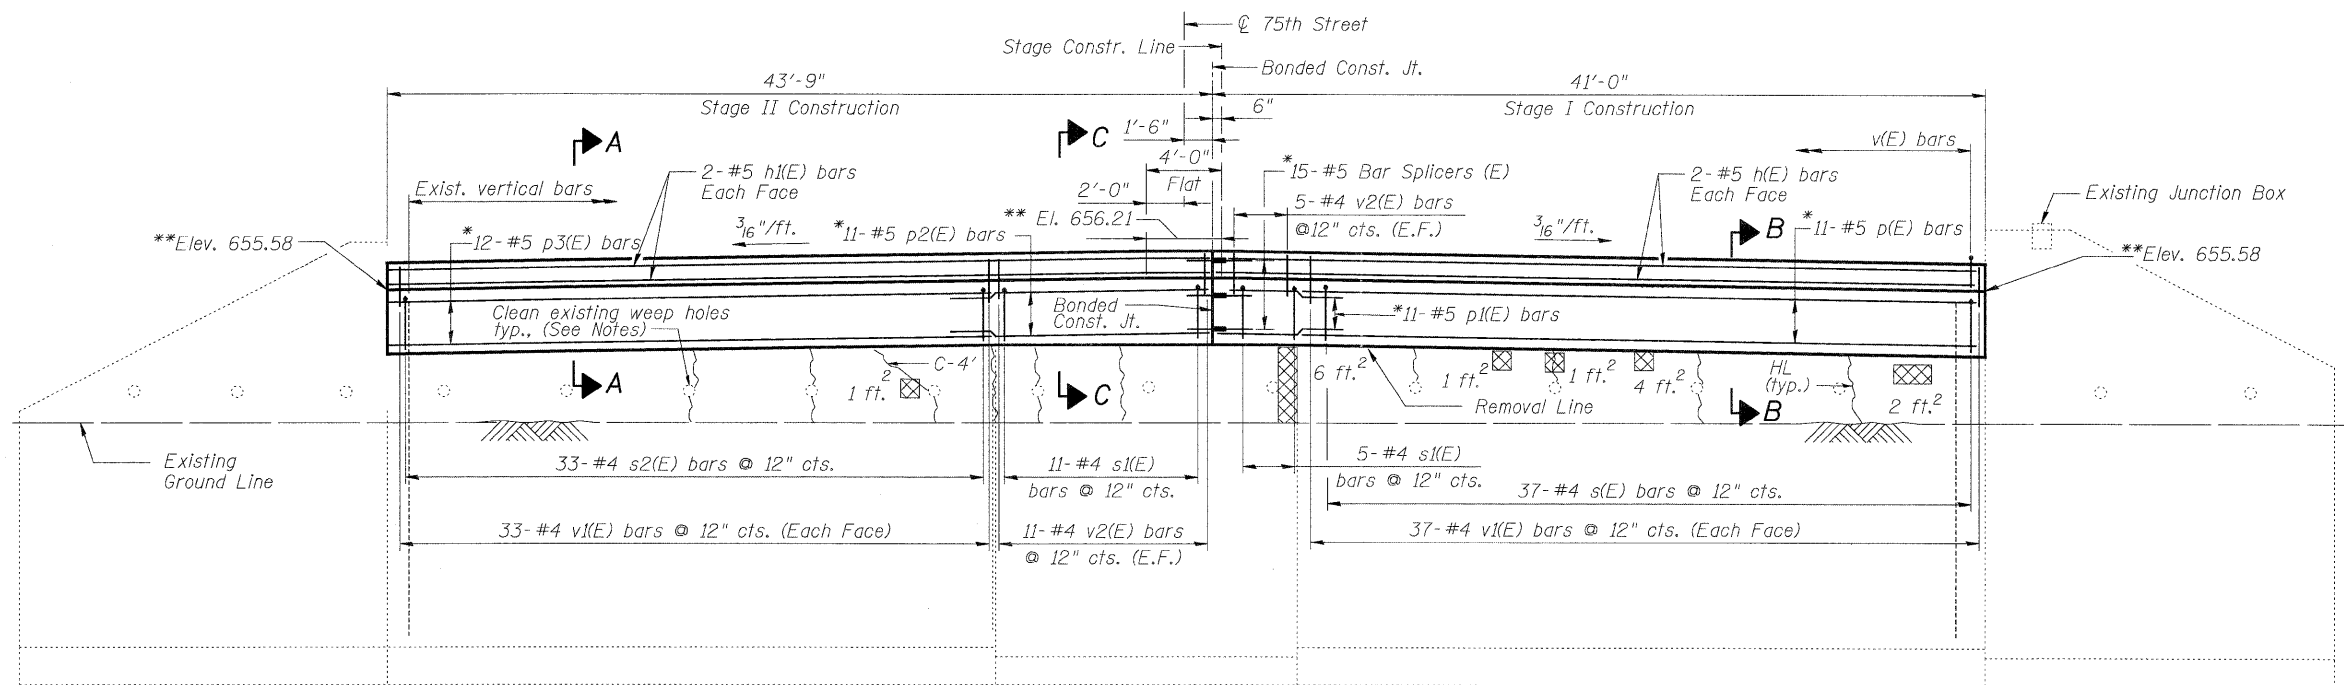

**EAST ABUTMENT ELEVATION**

(Looking East, E.F. = Each Face)

\*See Section for placement  
 \*\*Elevations shown are located at top of seat and End of Beam

**REPAIR LEGEND**

Inspection Date 12-2009:

C-4' } Epoxy Crack Injection (Crack Length)

⊗ Structural Repair of Concrete (Depth Equal to or Less than 5")

HL } Hairline Crack, For Information Only

Notes:

Structural Repair of Concrete and Epoxy Crack Injection locations and dimensions are estimated from inspection work. Actual locations and dimensions shall be shown by the Engineer on the as-built plans.

For Sections A-A, B-B and C-C See Sheet S19 of S24.

All costs for cleaning of weepholes to be included with "Concrete Structures".