

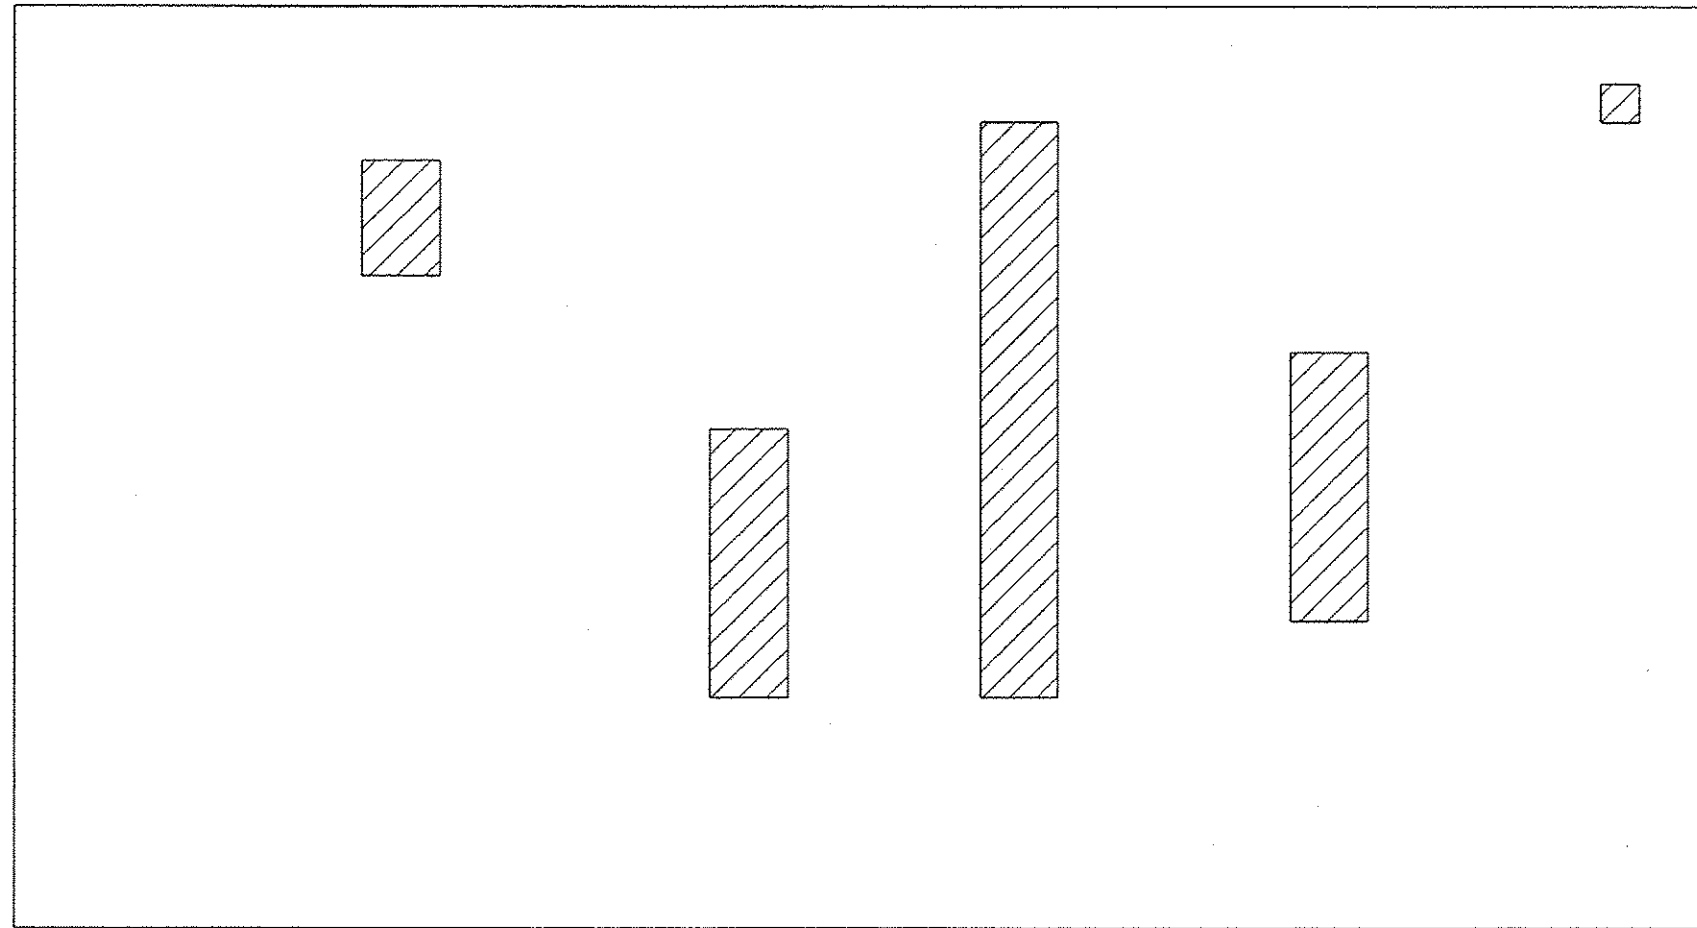


SUBSTRUCTURE REPAIR DETAIL

SN 098-0051 SOUTH ABUTMENT (LOOKING SOUTH)

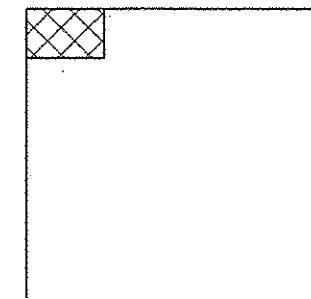

SN 098-0051
SOUTH ABUTMENT (LOOKING SOUTH)

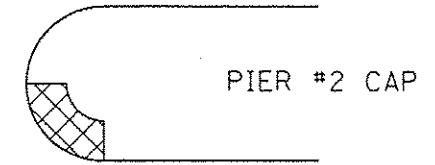

SN 098-0051
PIER #2 (EAST NOSE - SOUTH SIDE)

ITEM	QUANTITY
(*) STRUCTURAL REPAIR OF CONCRETE \leq 5"	47.0 (SQ FT)
(*) STRUCTURAL REPAIR OF CONCRETE $>$ 5"	2.0 (SQ FT)
TEMPORARY SHORING AND CRIBBING	1 (EACH)

(*) THIS IS AN ESTIMATED QUANTITY. THE ACTUAL LOCATION OF DELAMINATED AREAS AND QUANTITIES WILL BE DETERMINED BY THE RESIDENT ENGINEER IN THE FIELD.

- Ⓧ JACKING AND CRIBBING LOCATION
- ▨ DELAMINATED AREA $>$ 5"
- ▧ DELAMINATED AREA \leq 5"