



STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

|                       |         |           |                  |           |
|-----------------------|---------|-----------|------------------|-----------|
| ROUTE NO.             | SECTION | COUNTY    | TOTAL SHEETS     | SHEET NO. |
| F.A.P. 885            | 111BR-2 | POPE      | 69               | 59        |
| FED. ROAD DIST. NO. 7 |         | ALIGNMENT | FED. AID PROJECT |           |

Contract #78033

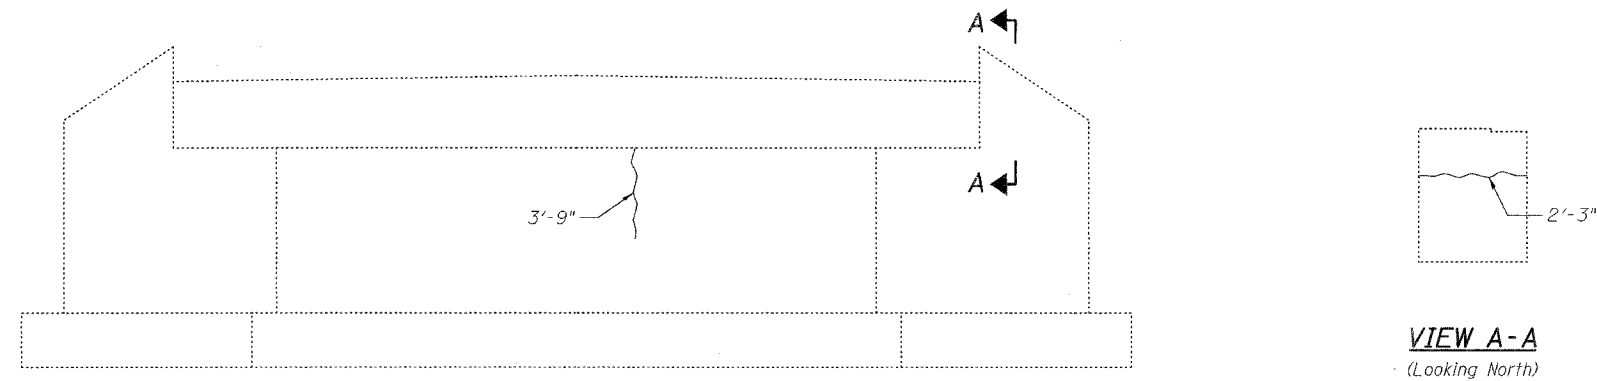

**ELEVATION - EAST ABUTMENT**  
(Looking East)

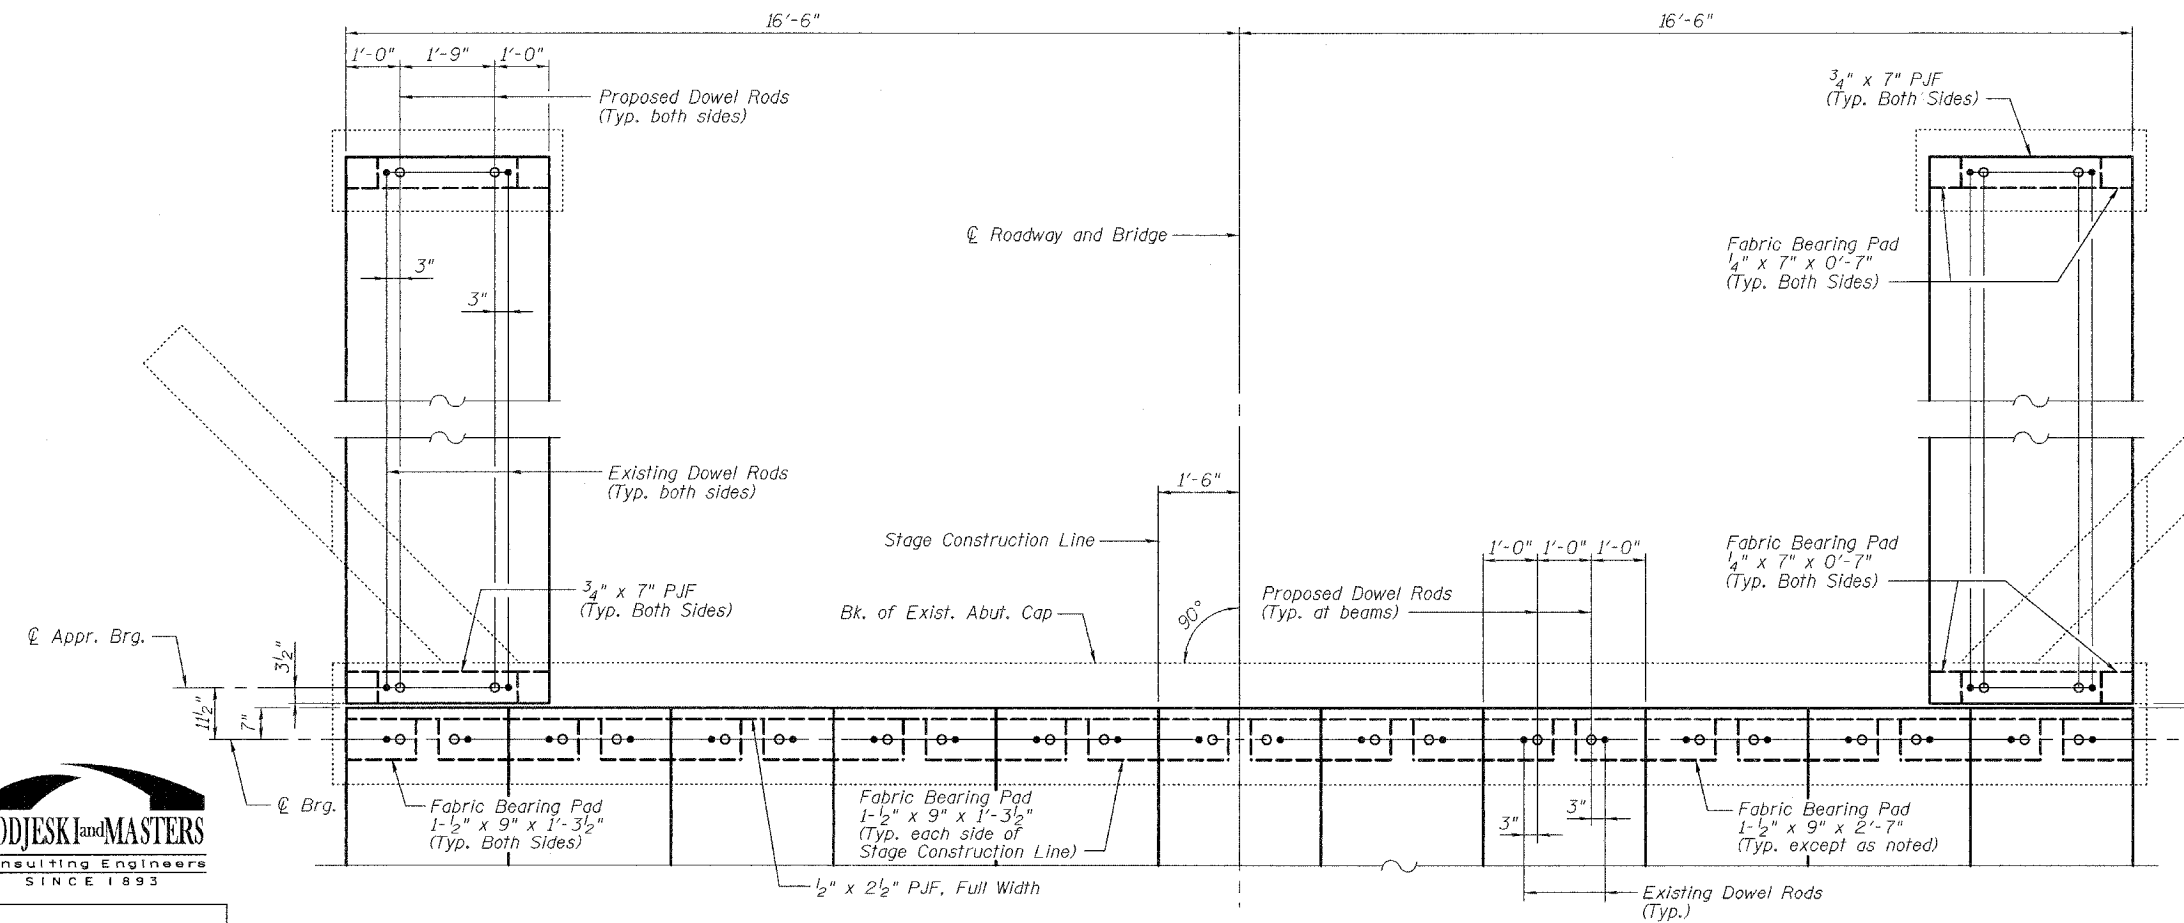

**PLAN - EAST ABUTMENT BEARING SEAT**  
(East Abutment shown, West Abutment similar)

Bituminous wearing surface and existing approach pavement not shown for clarity.

**BILL OF MATERIAL**

| Item                  | Unit | Total |
|-----------------------|------|-------|
| Epoxy Crack Injection | Foot | 6     |

**LEGEND**

- Crack Length — Epoxy Crack Injection
- Existing Dowel Rod
- Proposed Dowel Rod

Notes:  
Existing dowel rods shall be burned off flush with the existing concrete face, ground smooth, and sealed with epoxy. Cost to remove existing P.C. channel beam dowel rods is included with Removal of Existing Precast Concrete Units. Cost to remove existing P.P.C. deck beam dowel rods is included with Removal of Existing Superstructures.

**ABUTMENT REPAIRS**  
**ILL. ROUTE 146 OVER ROOT LICK BRANCH**  
**F.A.P. ROUTE 885 - SECTION 111BR-2**  
**POPE COUNTY**  
**STATION 818+03.50**  
**STRUCTURE NO. 076-0008**



|          |     |
|----------|-----|
| DESIGNED | YSS |
| CHECKED  | RLM |
| DRAWN    | PRC |
| CHECKED  | RLM |

03/17/08