
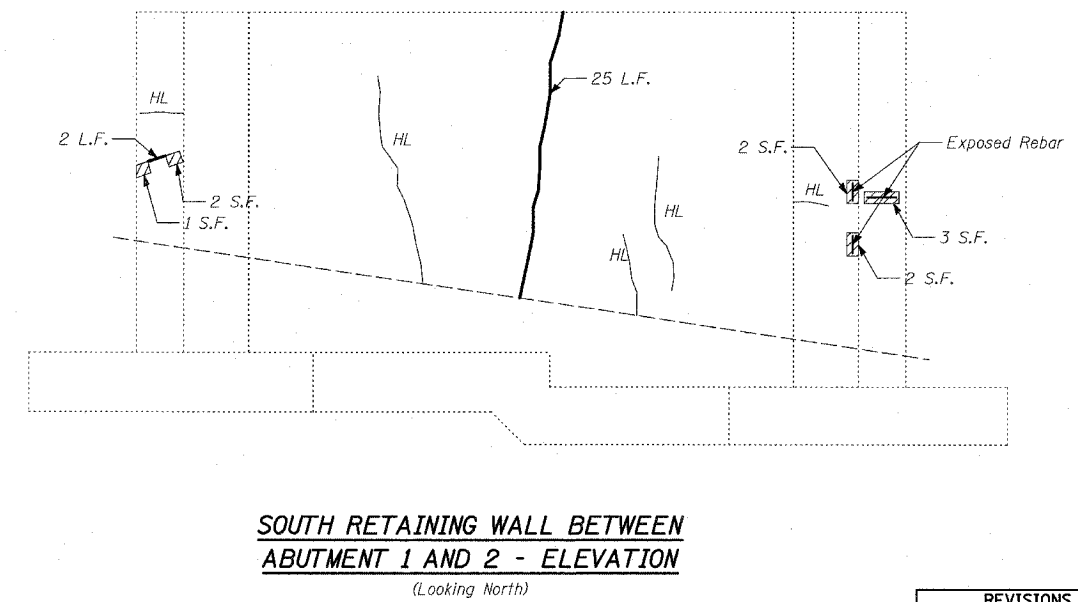


**PIER 3 - END VIEW**  
(Looking North)

**PIER 3 - ELEVATION**  
(Looking East)

**PIER 3 - ELEVATION**  
(Looking West)

**PIER 3 - END VIEW**  
(Looking South)

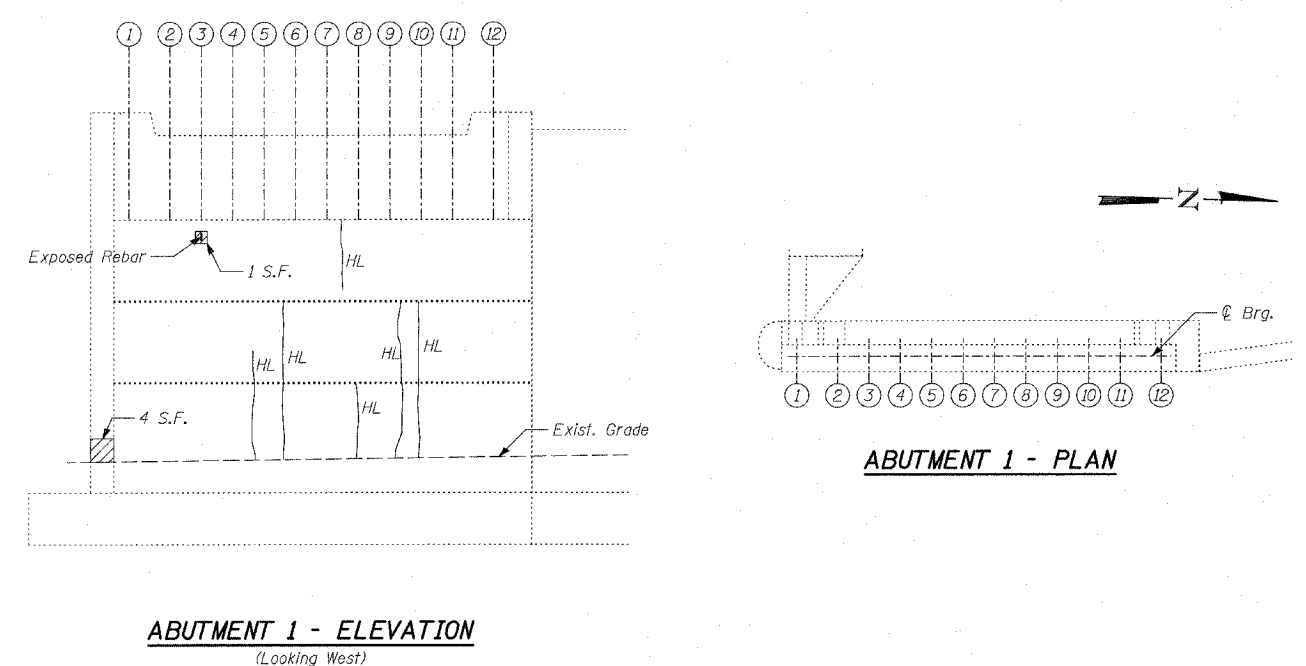

**ABUTMENT 1 - ELEVATION**  
(Looking West)

**SOUTH RETAINING WALL BETWEEN ABUTMENT 1 AND 2 - ELEVATION**  
(Looking North)

**LEGEND**

- Formed Concrete Repair (Depth < 5")
- Epoxy Crack Sealing
- Hair Line Crack

**BILL OF MATERIAL**

ITEM	UNIT	TOTAL
Epoxy Crack Sealing	FOOT	51
Formed Concrete Repair (Depth < 5")	SQ FT	42

REVISIONS	
NAME	DATE

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**F.A.I. 94 (DAN RYAN EXPRESSWAY)**  
**SUBSTRUCTURE REPAIR**  
**FOR CHICAGO RAIL LINK**  
**EXISTING PIER 3 & ABUTMENT 1**

S.N. 016-0145  
SCALE: N.T.S.  
DATE: MARCH 1, 2006

DESIGNED BY: MAF, DJR  
DRAWN BY: MAF, DJR  
CHECKED BY: MI

