




DECK PLAN-TOP

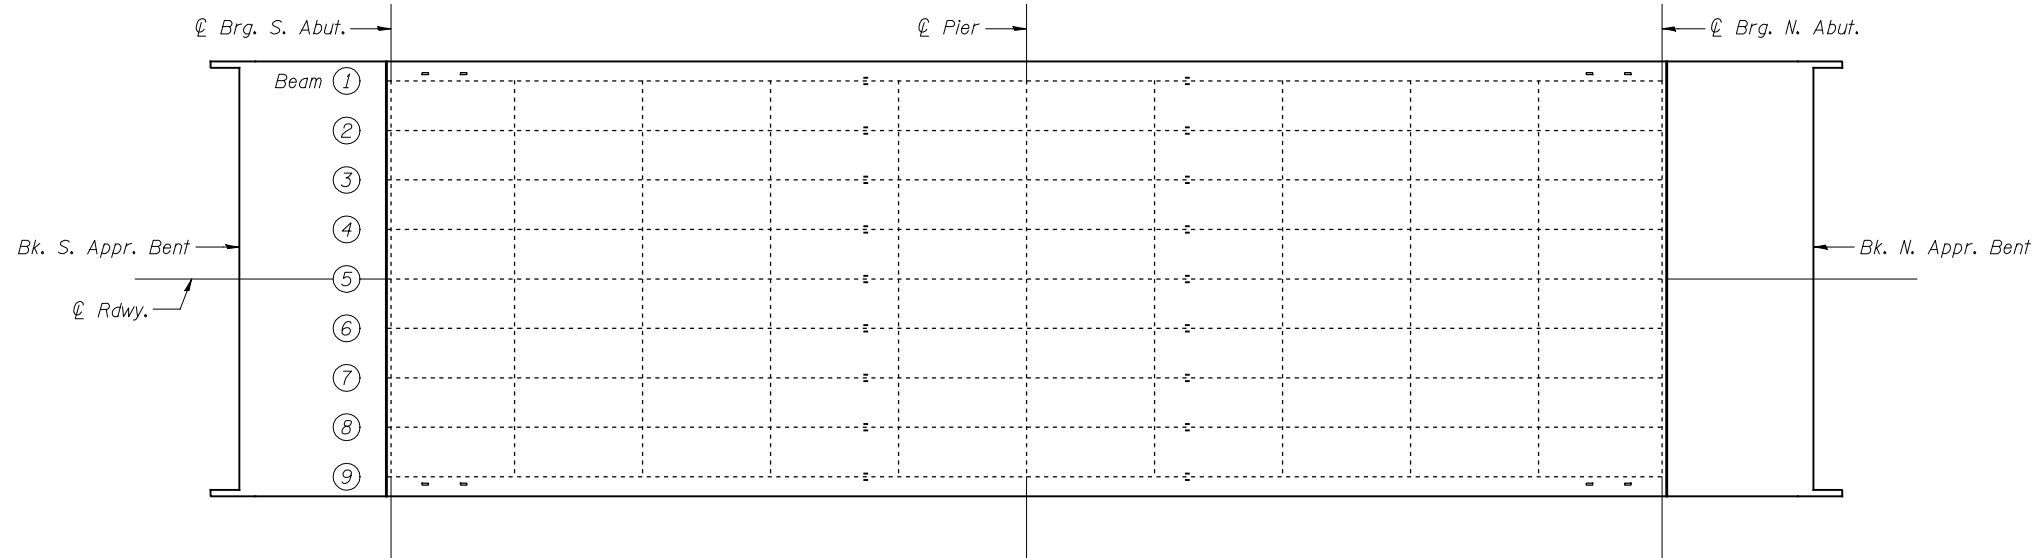

DECK PLAN-BOTTOM

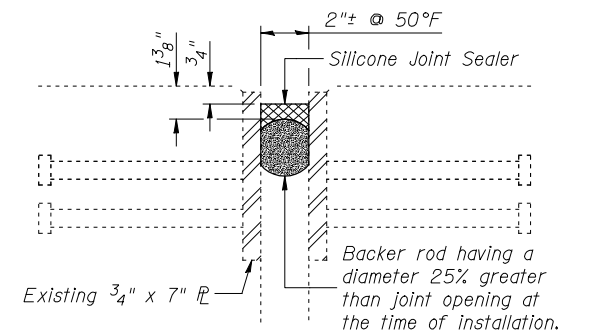

SILICONE JOINT SEALER DETAIL
(Typical for both Abutments)

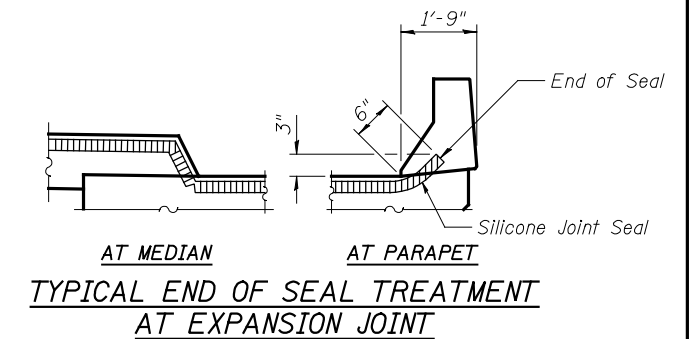


LEGEND

- Hollow or Unsound Concrete
- Spalled Concrete
- Spalled Concrete with Exposed Reinf.
- Hairline Crack
- Deck Slab Repair (Partial)

Notes:
Deck Condition Survey performed 2/07/2011 (by IDOT-D6).
Repair areas are estimated, the Engineer shall determine actual repair locations and record them on the As-Built plans.

BILL OF MATERIAL

Item	Unit	Total
Deck Slab Repair (Partial)	Sq Yd	2
Silicone Jt. Sealer, 2"	Foot	133

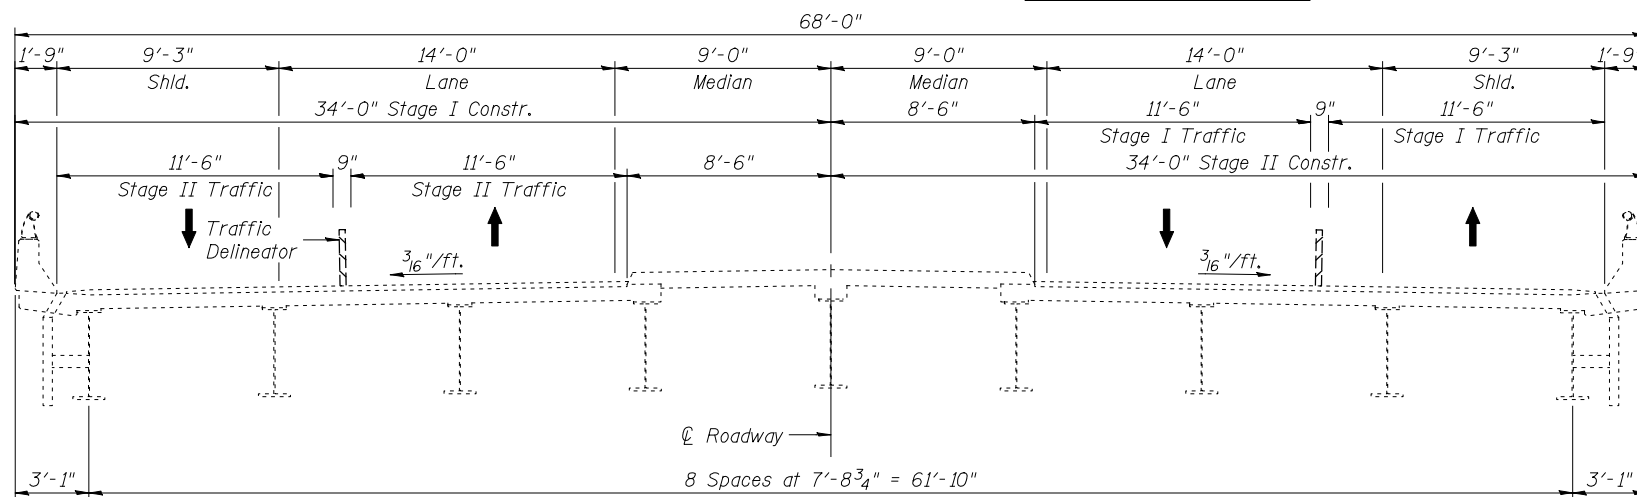

CROSS SECTION
(Looking North)

FILE: J:\IDOT\102004_IL-DBV\171-12_Illinois\2-South\Drawings\0840162-72C88-02-deck.dgn

FILE NAME =	USER NAME = DCD	DESIGNED - CMV	REVISED -
... \0840162-72C88-02-deck.dgn		CHECKED - DCD	REVISED -
PLOT SCALE =		DRAWN - P. Ray	REVISED -
PLOT DATE = 04/02/2013 15:17:38		CHECKED - CMV/DCD	REVISED -

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

DECK REPAIRS
STRUCTURE NO. 084-0162

SHEET NO. 2 OF 2 SHEETS

PART B - SHEET 49 of 67

F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
72	(84-10-3)RS-5	SANGAMON	95	77
STA. 721+28.56			CONTRACT NO. 72C88	

ILLINOIS FED. AID PROJECT