



**PARTIAL PLAN**

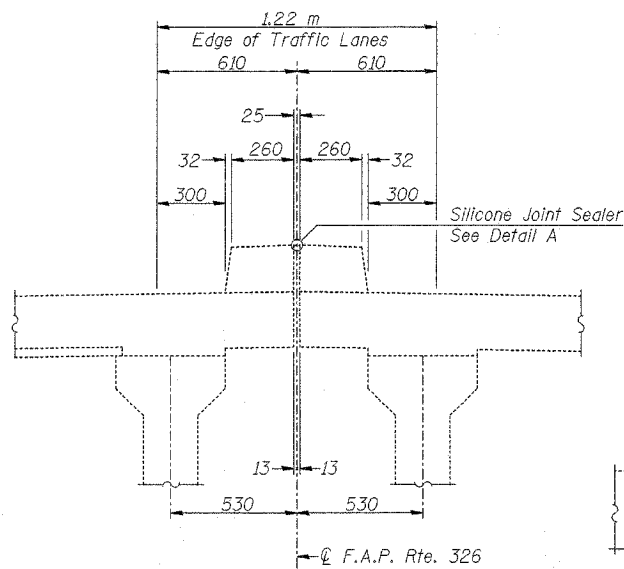

**SECTION A-A**  
(Looking North)

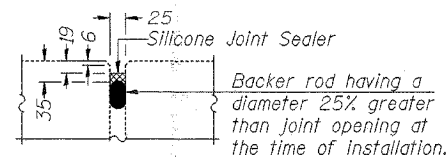

**DETAIL A**

Notes: For details of Deck Slab Repair see Special Provision for "Deck Slab Repair."  
See Sheet #6 of 8 for Cross Section.  
The quantities shown for estimating purposes only. Area to be repaired will be determined by the Engineer at the time of Construction. Actual repair locations shall be shown on the same as-built plans.

**LEGEND**

- Deck Slab Repair (Full Depth, Type I) (In areas without planks)
- \* ☒ Deck Slab Repair (Full Depth, Type I) (In areas with planks)
- ▨ Structural Repair of Concrete (Depth equal to or less than 125 mm)

\* Paid for as indicated on sheet 6 of 7.

**BILL OF MATERIAL**

Item	Unit	Total
Deck Slab Repair (Full Depth, Type I)	Sq. M	1.1
Structural Repair of Concrete (Depth equal to or less than 125mm)	Sq. M	2.5
Silicone Joint Sealer, 25 mm	Meter	54

Deck Survey Date: 11/22/04

**LIN ENGINEERING, LTD.**  
200 W. Chestnut  
Channah, Illinois 62629  
(618) 483-4668  
Fax: (618) 483-4706  
Designed By: STG  
Checked By: WTH  
Date: 01/05  
Drawn By: JMD  
File: 0470046.DWG

REVISIONS	
NAME	DATE

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**DECK REPAIR-2**  
**F.A.P. 326 (IL RTE. 47)**  
**OVER FOX RIVER**  
**SECTION (108,109)RS-4**  
**KENDALL COUNTY**  
**S.N. 047-0048**