S.B. Lanes

HMA Shoulder
(To be resurfaced)

±30'-0" barrier removal limits

* See Concrete Barrier, Double Face,
42 in. Height, Std. 637006

Existing concrete
median barrier

A ▲   A ▲

HMA Shoulder
(To be resurfaced)

N.B. Lanes

* Match existing dimensions. Protective Coat shall
be applied on top and side faces of new barrier.

PLAN

Repair concrete median barrier
to match existing dimensions
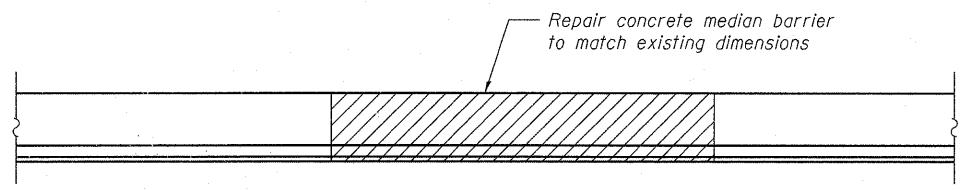
VIEW A-A

Notes:
    Plan dimensions and details relative to existing plans are subject to nominal
construction variations. The Contractor shall field verify existing dimensions and
details affecting new construction and make necessary approved adjustments prior
to construction or ordering of materials. Such variations shall not be cause for
additional compensation for a change in scope of the work, however, the
Contractor will be paid for the quantity actually furnished at the unit price bid
for the work.
    Repair dimensions shown are based on 01-05-11 field inspection and
should not be considered final. The actual dimensions to be repaired will be
determined by the Engineer at the time of construction.
    It shall be the Contractor's responsibility to verify the location of the existing
underground and/or median barrier utilities prior to starting construction.

N
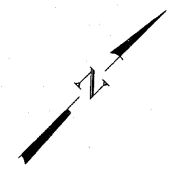
SCOPE OF WORK

1.   Saw cut and remove and replace Concrete Median Barrier to
    match existing conditions and in accordance with Article 637 of
    the Standard Specifications.

6"

9"

10"

10"

**1¼" φ x 18" dowel
bars, typ.

(ELEVATION)   (PLAN)
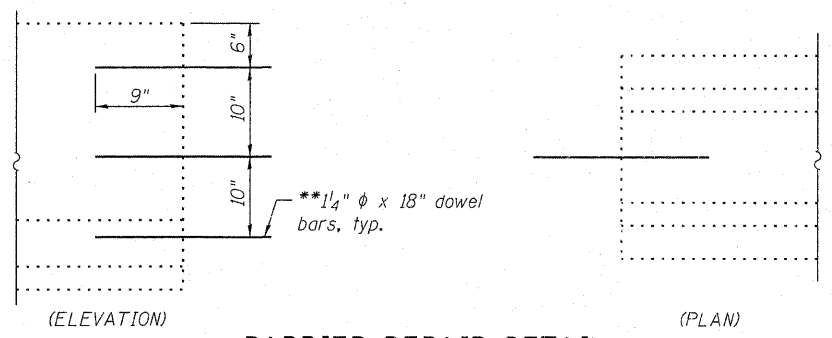
BARRIER REPAIR DETAIL

**Drill and epoxy grout according to Article 584 of the Standard Specifications, included in the
cost of Concrete Barrier Removal and Replacement Double Face.

TOTAL BILL OF MATERIAL

ITEM	UNIT	TOTAL
Concrete Barrier Removal and Replacement Double Face, 42 in.	Foot	30
Protective Coat	Sq. Yd.	30

1-13-11