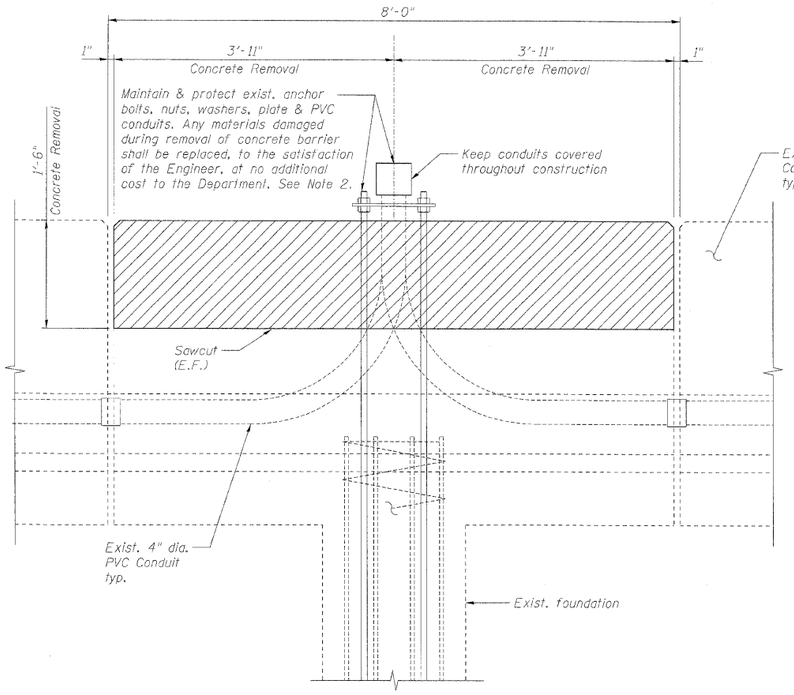

ELEVATION
REMOVAL DETAIL
I-355 STA. 153+60

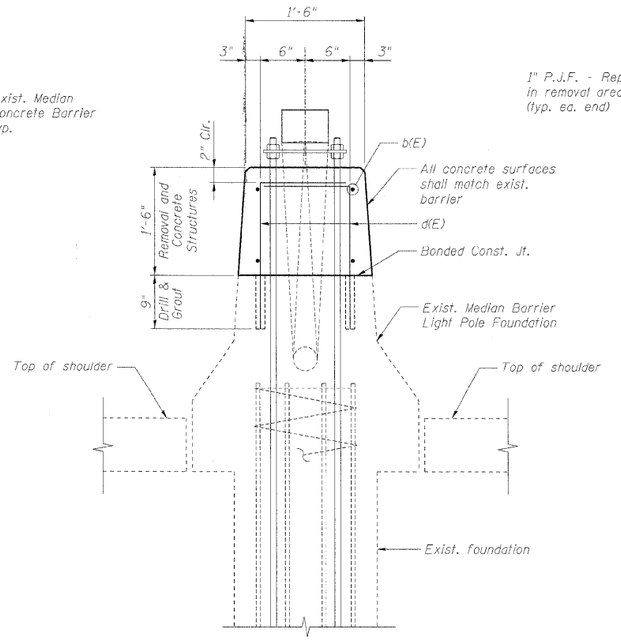

SECTION A-A

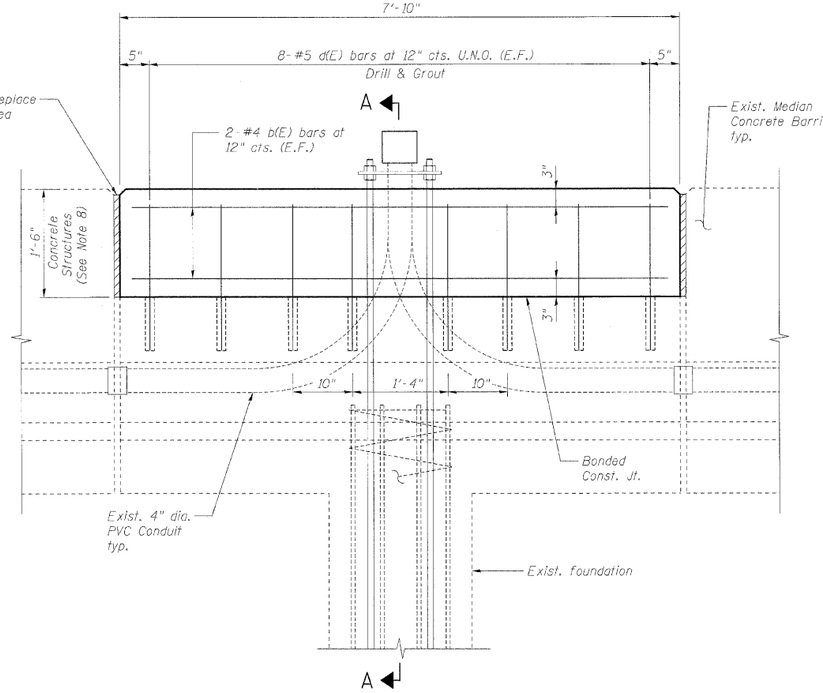

ELEVATION
REPAIR DETAIL
I-355 STA. 153+60

BILL OF MATERIAL

BAR	NO.	SIZE	LENGTH	SHAPE
b(E)	4	#4	7'-6"	———
d(E)	16	#5	3' 1"	⌐

ITEM	UNIT	TOTAL
Concrete Barrier Wall Removal and Replacement (Partial Depth Repair)	Foot	8.0

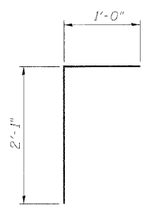

Bar d(E)

Notes:

1. For existing median barrier light pole foundation details, see sheet 2 of 2. See Roadway Plans for light pole foundation location.
2. The cable in the conduits is energized when the lighting cabinet is turned on. The Contractor shall call Meade Electric Company 24 Hour Dispatch Center at (773) 287-7600 to schedule the barrier wall repairs and ensure that the cables are de-energized during construction.
3. Reinforcement bars shall conform to the requirements of ASTM A706 Gr 60. See Special Provisions.
4. Reinforcement bars designated (E) shall be epoxy coated.
5. E.F. denotes each face.
6. U.N.O. denotes unless noted otherwise.
7. Light Pole Installation (By Others).
8. The cost of sawcuts, concrete removal, concrete structures, reinforcement bars, drilling and grouting, preformed joint filler (P.J.F.), protection of existing barrier lighting appurtenances to remain, and coordination with Meade Electric Company, is included with "Concrete Barrier Wall Removal and Replacement (Partial Depth Repair)".

FILE NAME =	DESIGNED - KJN	REVISED -
...\Roadway_LightPole_Fndn_Repair_1.dgn	DRAWN - RMG	REVISED -
USER NAME = tblank	CHECKED -	REVISED -
PLOT DATE = 11/13/2009	DATE - KJN	REVISED -

benesch

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

MEDIAN BARRIER LIGHT POLE FOUNDATION REPAIR PLAN

SCALE: N.T.S. | SHEET NO. 1 OF 2 SHEETS | STA. | TO STA.

F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
•	22(1, 1-1, 2&3)RS-7	DUPAGE	546	103
•290,355		CONTRACT NO. 60G51		
FED. ROAD DIST. NO.	ILLINOIS	FED. AID PROJECT		