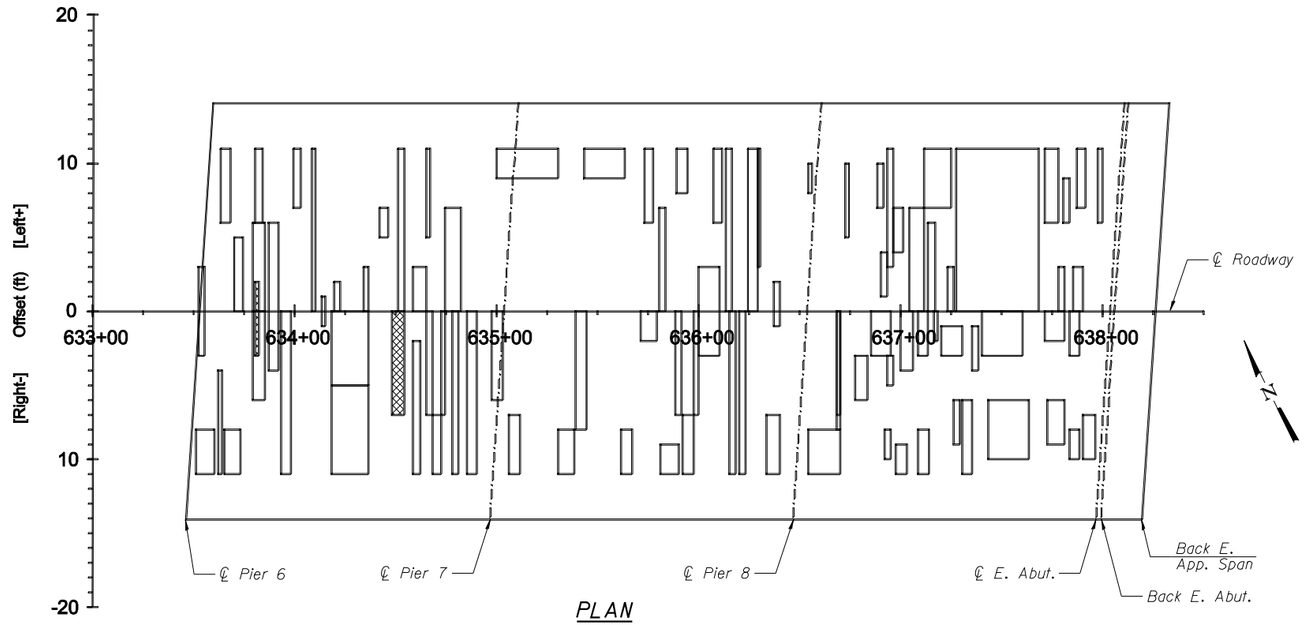

PLAN

UNIT 3

- Deck Slab Repair (Partial) 313 sq. yd.
- Deck Slab Repair (Full Depth, Type I) 0 sq. yd.
- Deck Slab Repair (Full Depth, Type II) 6 sq. yd.

Notes

The areas of deck repairs are estimated.
The deck survey and schedule shows 6 sq. yds. of full depth deck slab repairs.
Plan quantities have been increased by 25% (to 8 sq. yds.)

The Engineer shall show actual patch locations on as-built plans.

Deck Survey 3-16-2011

Patch #	Start Sta	End Sta	Offsets (ft) From		Offsets (ft) To		Length (ft.)	Width (ft.)	Area (sy)	Full or Partial Depth	Type 1 or II (Full Depth)
1	633+52	633+55	3	Lt	3	Rt	3	6	2.00	P	
2	633+51	633+60	8	Rt	11	Rt	9	3	3.00	P	
3	633+62	633+64	4	Rt	11	Rt	2	7	1.56	P	
4	633+65	633+73	8	Rt	11	Rt	8	3	2.67	P	
5	633+70	633+74	0	Lt	5	Lt	4	5	2.22	P	
6	633+63	633+68	6	Lt	11	Lt	5	5	2.78	P	
7	633+79	633+85	0	Lt	6	Lt	6	6	4.00	P	
8	633+79	633+85	0	Rt	6	Rt	6	6	4.00	P	
9	633+80	633+84	6	Lt	11	Lt	4	5	2.22	P	
10	633+87	633+92	6	Lt	4	Rt	5	10	5.56	P	
11	633+80	633+82	2	Lt	3	Rt	2	5	1.11	F	Type II
12	633+93	633+98	0	Rt	11	Rt	5	11	6.11	P	
13	633+99	634+03	7	Lt	11	Lt	4	4	1.78	P	
14	634+08	634+10	0	Lt	11	Lt	2	11	2.44	P	
15	634+13	634+15	1	Lt	1	Rt	2	2	0.44	P	
16	634+18	634+36	0	Rt	5	Rt	18	5	10.00	P	
17	634+18	634+36	5	Rt	11	Rt	18	6	12.00	P	
18	634+19	634+22	0	Lt	2	Lt	3	2	0.67	P	
19	634+34	634+36	0	Lt	3	Lt	2	3	0.67	P	
20	634+42	634+46	5	Lt	7	Lt	4	2	0.89	P	
21	634+48	634+54	0	Rt	7	Rt	6	7	4.67	F	Type II
22	634+51	634+54	0	Lt	11	Lt	3	11	3.67	P	
23	634+58	634+62	2	Rt	11	Rt	4	9	4.00	P	
24	634+65	634+68	0	Rt	7	Rt	3	7	2.33	P	

Patch #	Start Sta	End Sta	Offsets (ft) From		Offsets (ft) To		Length (ft.)	Width (ft.)	Area (sy)	Full or Partial Depth	Type 1 or II (Full Depth)
25	634+72	634+74	0	Rt	7	Rt	2	7	1.56	P	
26	634+68	634+72	7	Rt	11	Rt	4	4	1.78	P	
27	634+58	634+65	0	Lt	3	Lt	7	3	2.33	P	
28	634+65	634+67	5	Lt	11	Lt	2	6	1.33	P	
29	634+74	634+82	0	Lt	7	Lt	8	7	6.22	P	
30	634+78	634+81	0	Rt	11	Rt	3	11	3.67	P	
31	634+85	634+90	0	Rt	11	Rt	5	11	6.11	P	
32	634+97	635+03	0	Rt	6	Rt	6	6	4.00	P	
33	635+06	635+11	7	Rt	11	Rt	5	4	2.22	P	
34	635+00	635+30	9	Lt	11	Lt	30	2	6.67	P	
35	635+30	635+38	8	Rt	11	Rt	8	3	2.67	P	
36	635+39	635+44	0	Rt	8	Rt	5	8	4.44	P	
37	635+43	635+63	9	Lt	11	Lt	20	2	4.44	P	
38	635+61	635+67	8	Rt	11	Rt	6	3	2.00	P	
39	635+71	635+79	0	Rt	2	Rt	8	2	1.78	P	
40	635+81	635+90	9	Rt	11	Rt	9	2	2.00	P	
41	635+88	635+91	0	Rt	7	Rt	3	7	2.33	P	
42	635+92	635+97	7	Rt	11	Rt	5	4	2.22	P	
43	635+97	636+00	0	Rt	7	Rt	3	7	2.33	P	
44	635+73	635+77	6	Lt	11	Lt	4	5	2.22	P	
45	635+80	635+83	0	Lt	7	Lt	3	7	2.33	P	
46	635+89	635+94	8	Lt	11	Lt	5	3	1.67	P	
47	636+00	636+10	3	Lt	3	Rt	10	6	6.67	P	
48	636+07	636+11	6	Lt	11	Lt	4	5	2.22	P	

EFK•Moen, LLC
Civil Engineering Design
331 Salem Place, Suite 225
Fairview Heights, IL 62208
Phone 618-206-4250

USER NAME = jo	DESIGNED - CTW	REVISED -
	CHECKED - CDL	REVISED -
PLOT SCALE = 0:1.0000 ':' / IN.	DRAWN - DP	REVISED -
PLOT DATE = 9/27/2011	DATE - 9/27/2011	REVISED -

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

DECK PATCHING SURVEY UNIT 3
STRUCTURE NO. 079-0019

SHEET NO. 10 OF 13 SHEETS

F.A.S RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
858	12VB-1I	RANDOLPH	72	43

CONTRACT NO. 76409

ILLINOIS FED. AID PROJECT

PRINT DATE: 9/27/2011 1:38:01 PM z:\1815 bla idot roots road\dgn\bridge\final\plotsheets\0790019-010-011-Deck_Patching_Survey_Unit 3.dgn