
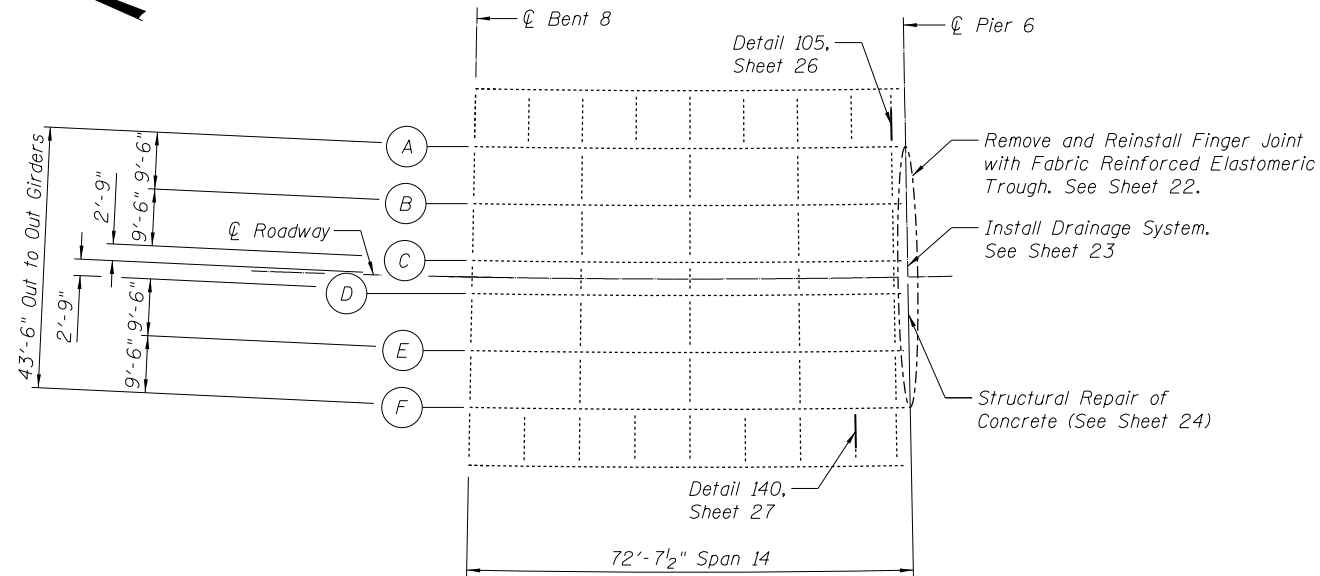


FRAMING PLAN SPANS 17, 16 AND 15

BILL OF MATERIAL

ITEM	UNIT	TOTAL
Structural Steel Repair	Pound	9,021
Bolt Replacement	Each	12
Structural Repair of Concrete (Depth Equal To or Less Than 5 in.)	Sq. Ft.	342
Steel Bridge Rail Posts	Each	5
Remove and Reinstall Finger Joint	Each	1
Concrete Removal	Cu. Yd.	5
Concrete Superstructure	Cu. Yd.	5
Fabric Reinforced Elastomeric Trough	Ft.	47
Furnishing and Erecting Structural Steel	Pound	445
Structural Steel Removal	Pound	445



FRAMING PLAN SPAN 14

Notes:
Handrail post and railing replacement locations not shown for clarity. See Details 111-115, Sheets 29-30.

Guardrail bolt replacement locations not shown for clarity. See Sheet 24.

FILE NAME = I:\Projects\4015550\4015550_0001\90_CAD_Models_and_Sheets\04_CJ_Bridge\08150905-64H28-003-Framing_Plan.dgn



USER NAME = patrisjm	DESIGNED - MJK	REVISED
PLOT SCALE = 32x0.0000 '1' / in.	CHECKED - JAN	REVISED
PLOT DATE = 1/21/2014	DRAWN - JMP	REVISED
	CHECKED - SB	REVISED

**STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION**

**FRAMING PLAN & REPAIR LOCATIONS SPANS 17-14
STRUCTURE NO. 081-9905**

SHEET NO. 6 OF 33 SHEETS

F.A.P. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
308	(3BRM)	ROCK ISLAND	47	19
C-92-090-12		CONTRACT NO. 64H28		
ILLINOIS FED. AID PROJECT				