
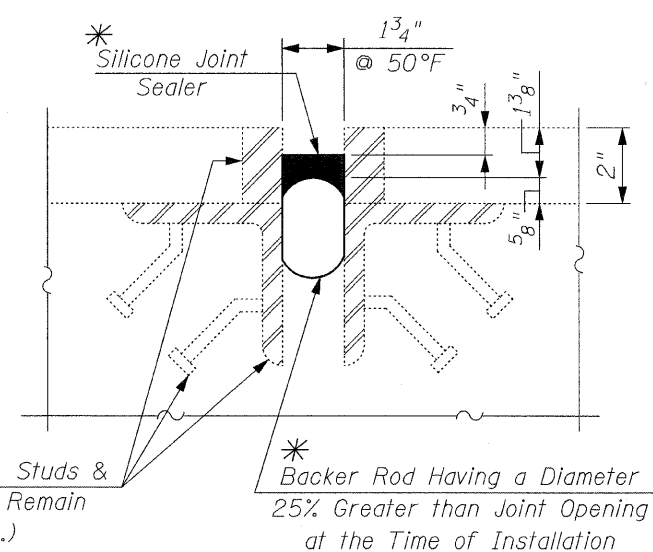


* Existing P.J.S. to be Removed and Replaced with Silicone Joint Sealer, 1 3/4". Cost for Removal of Existing P.J.S. and for Proposed Backer Rod is Included in the Cost of Silicone Joint Sealer, 1 3/4"

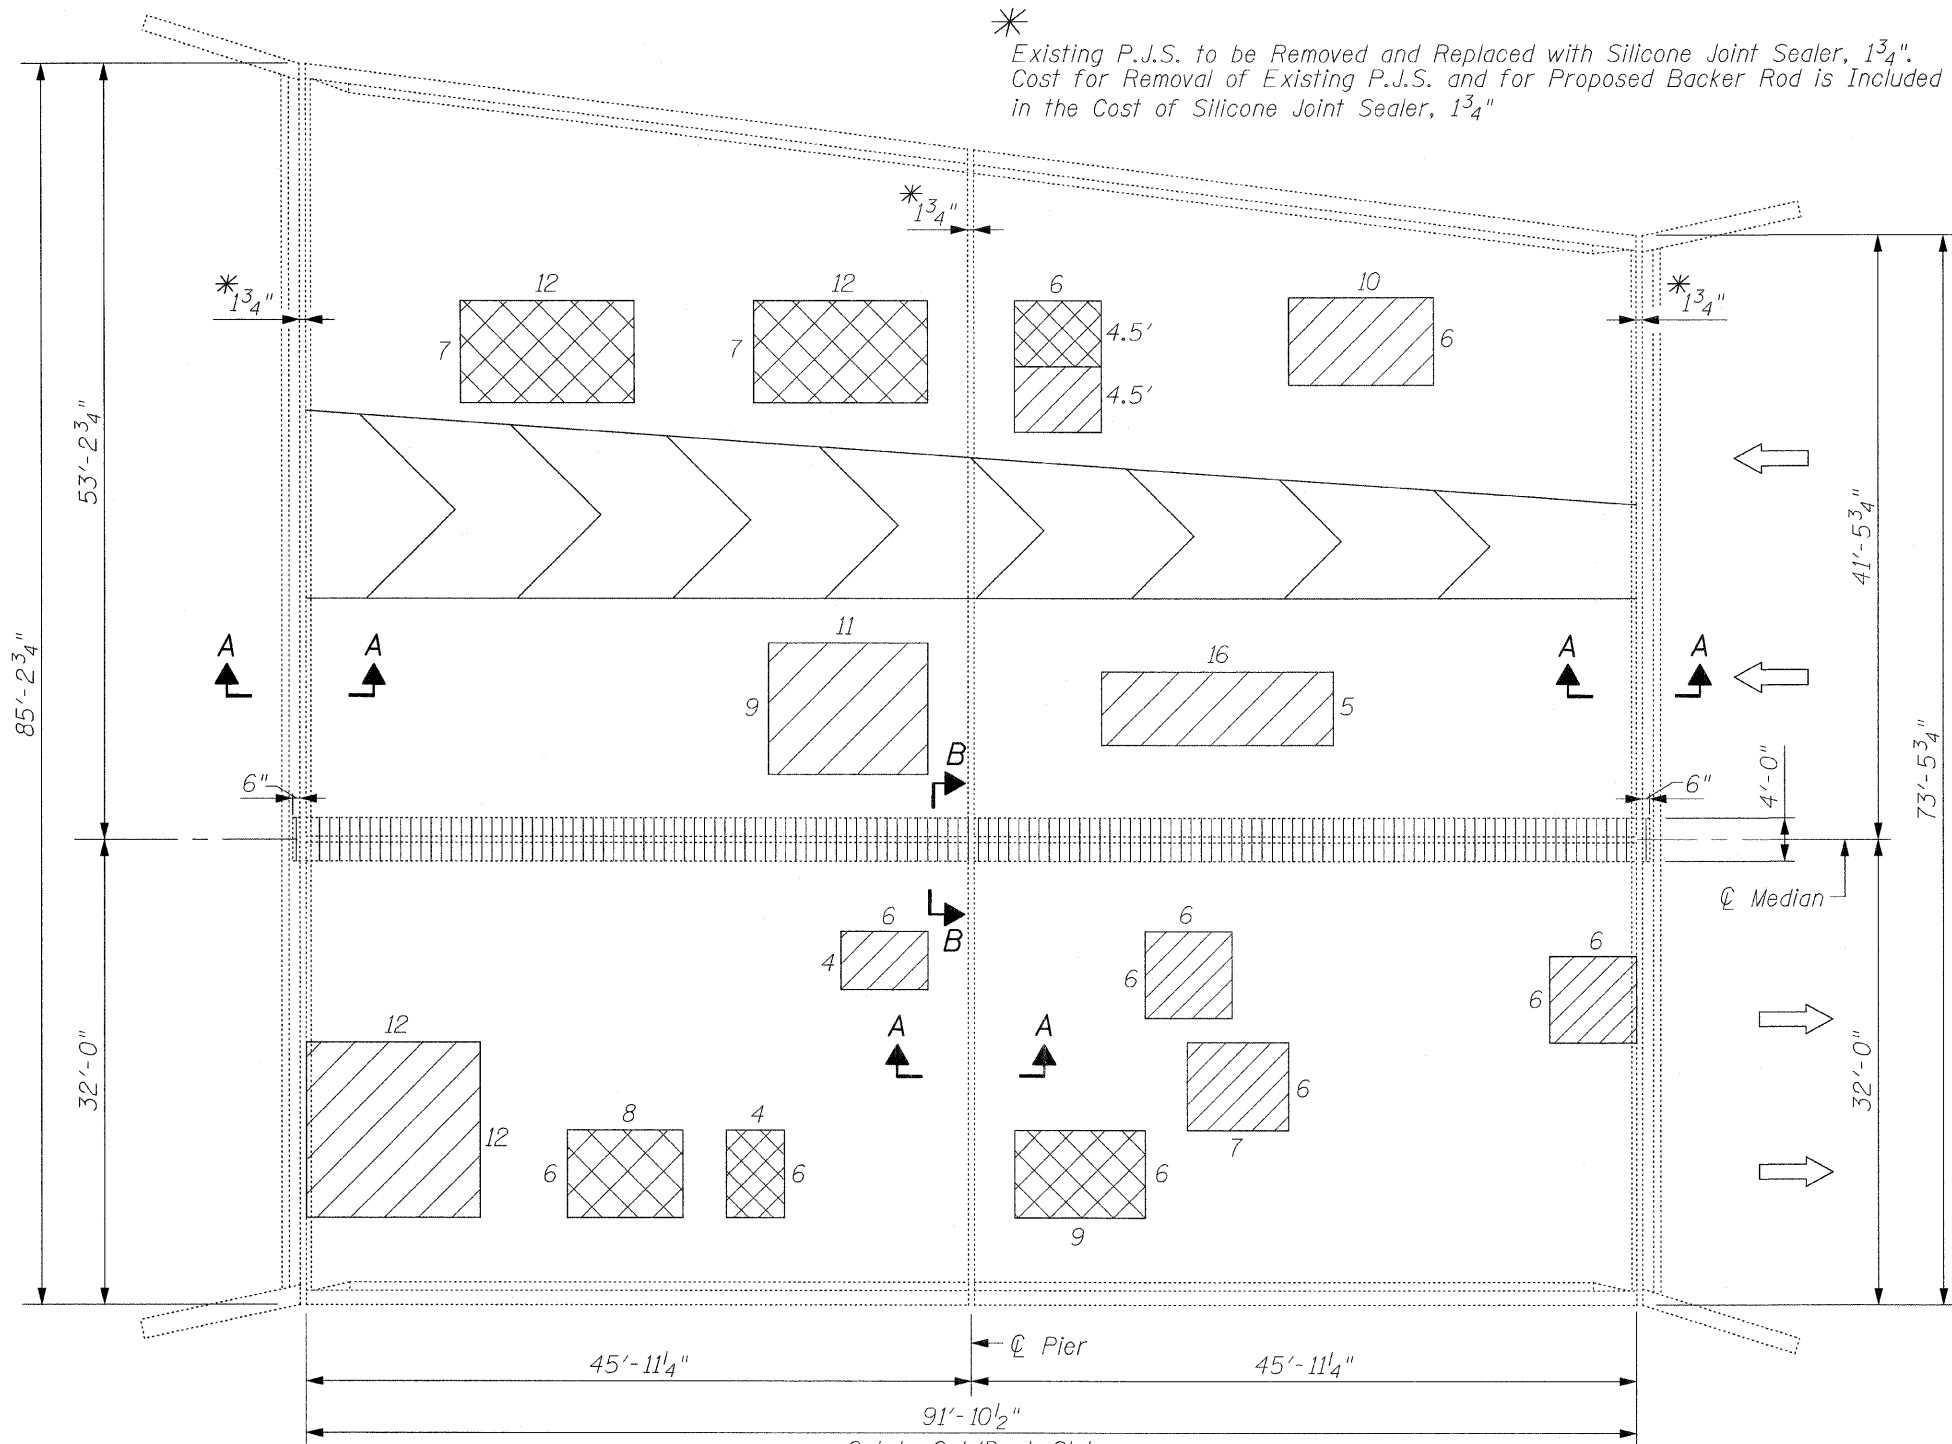

Exist. Bars, Studs & Angles to Remain (Typ.)

* Backer Rod Having a Diameter 25% Greater than Joint Opening at the Time of Installation

NOTES:
 For Median & Longitudinal Joint Removal & Reconstructing Median, See Sht. S4.
 Locations & Areas of Repairs are Based on Inspections Performed by I.D.O.T. Maintenance Engineers in September, 2008.
 All Patch Dimensions are in Feet.

BILL OF MATERIAL


ITEM	UNIT	QUANTITY
Deck Slab Repair (Full Depth, Type II)	Sq. Yd.	36
Deck Slab Repair (Partial)	Sq. Yd.	61
Silicone Joint Sealer, 1 3/4"	Foot	238

LEGEND:

- Deck Slab Repair (Full Depth, Type II)
- Deck Slab Repair (Partial)
- Median & Longitudinal Joint Removal & Reconstructing Median

NOTE:
 INSPECTION WAS CONDUCTED IN AUGUST, 2008 BY I.D.O.T. FIELD MAINTENANCE ENGINEERS.

NOTE:
 SURFACE TYPE: CONCRETE WITH CONCRETE OVERLAY

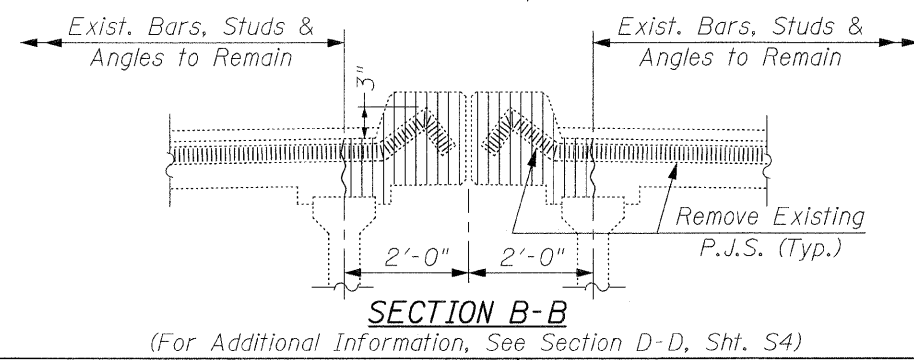

SECTION B-B
 (For Additional Information, See Section D-D, Sht. S4)

FILE NAME = deck_patching.dgn	USER NAME = IDOT	DESIGNED - B.N.S./J.C.N.	REVISED -
		DRAWN - F.M.	REVISED -
		CHECKED - B.N.S./J.C.N.	REVISED -
		DATE - DECEMBER, 2008	REVISED -

STATE OF ILLINOIS
 DEPARTMENT OF TRANSPORTATION

BRIDGE DECK PATCHING
 JOLIET ROAD OVER FLAGG CREEK
 S.N. 016-0393

F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
3562	430 Y-1 BR	COOK	15	9
FED. ROAD DIST. NO.			ILLINOIS FED. AID PROJECT	
			CONTRACT NO. 60E60	