

RTE.	SECTION		COUNTY	SHEETS	NO.			
_595	:I:3:K		OCKISLAND	_476	237			
STA.	A TO STA							
FED. ROA	D DIST. NO.	ILLINOIS	FED. AID	PROJECT				

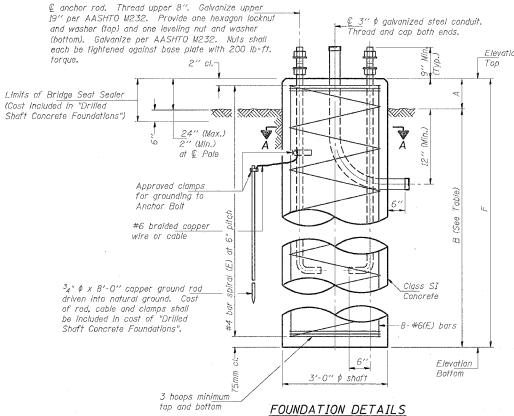

Typical, except conduit may only be required at one foundation. Provide conduit openings both poles. .

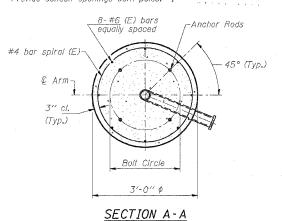

65 < Span < 85 35 < Span & 100

FOUNDATIONS:

The foundation dimensions shown are based on the presence of mostly cohesive soils with an average Unconfined Compressive Strength (Qu) of at least 1.25 tsf, which must be determined by previous soil investigations at the jobsite. When other conditions are indicated, the boring data will be included in the plans and the foundation dimensions shown will be the result of site specific designs.


If the conditions encountered are different than those indicated, the Contractor shall notify the Engineer to determine if the foundation dimensions need to be modified. If dimensions "B" or "F" are revised by more than 12" by the Contractor, "as-built" plans shall be prepared and submitted to the District Bureau of Operations for future reference.

No sonotubes or decomposable forms shall be used below the lower conduit entrance. Permanent metal forms or other shielding may not be left in place below that elevation without the Engineer's written permission.


Concrete shall be placed monolithically, without construction joints.

Backfill shall be placed per Article 502 of Standard Specification and prior to erection of support column.


A normal surface finish followed by a Bridge Seat Sedler application will be required on concrete surfaces above the lowest elevation 6" below finished ground line. Cost included in "Drilled Shaft Concrete Foundation".

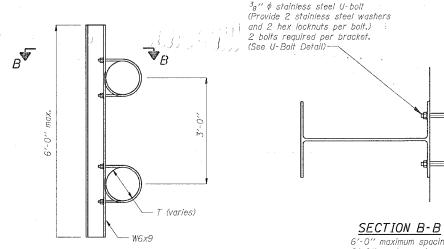

SIGN MOUNTING BRACKET

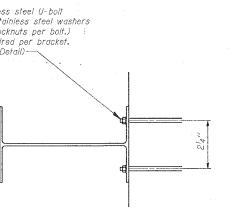

6'-0'' maximum spacing. 2'-0'' maximum sign overhang beyond end bracket.

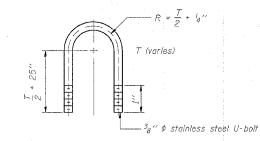

U-BOLT DETAIL

DUAL MONOTUBE SIGN STRUCTURE

REVISIO		ZEONELLE	DEPARTMENT	OF	TRANSPORTATIO
NAME	DATE	10015	OLI MICHINEITI	٠,	THANSI ON TATE

			1		
		SCALE: VERT. HORIZ.			DRAWN BY
		HORIZ.			DIVAMIN DI
		DATE			CHECKED BY

DUAL TOWAL FURE - 2 11/1/2001/1/2002