


PLAN C WB

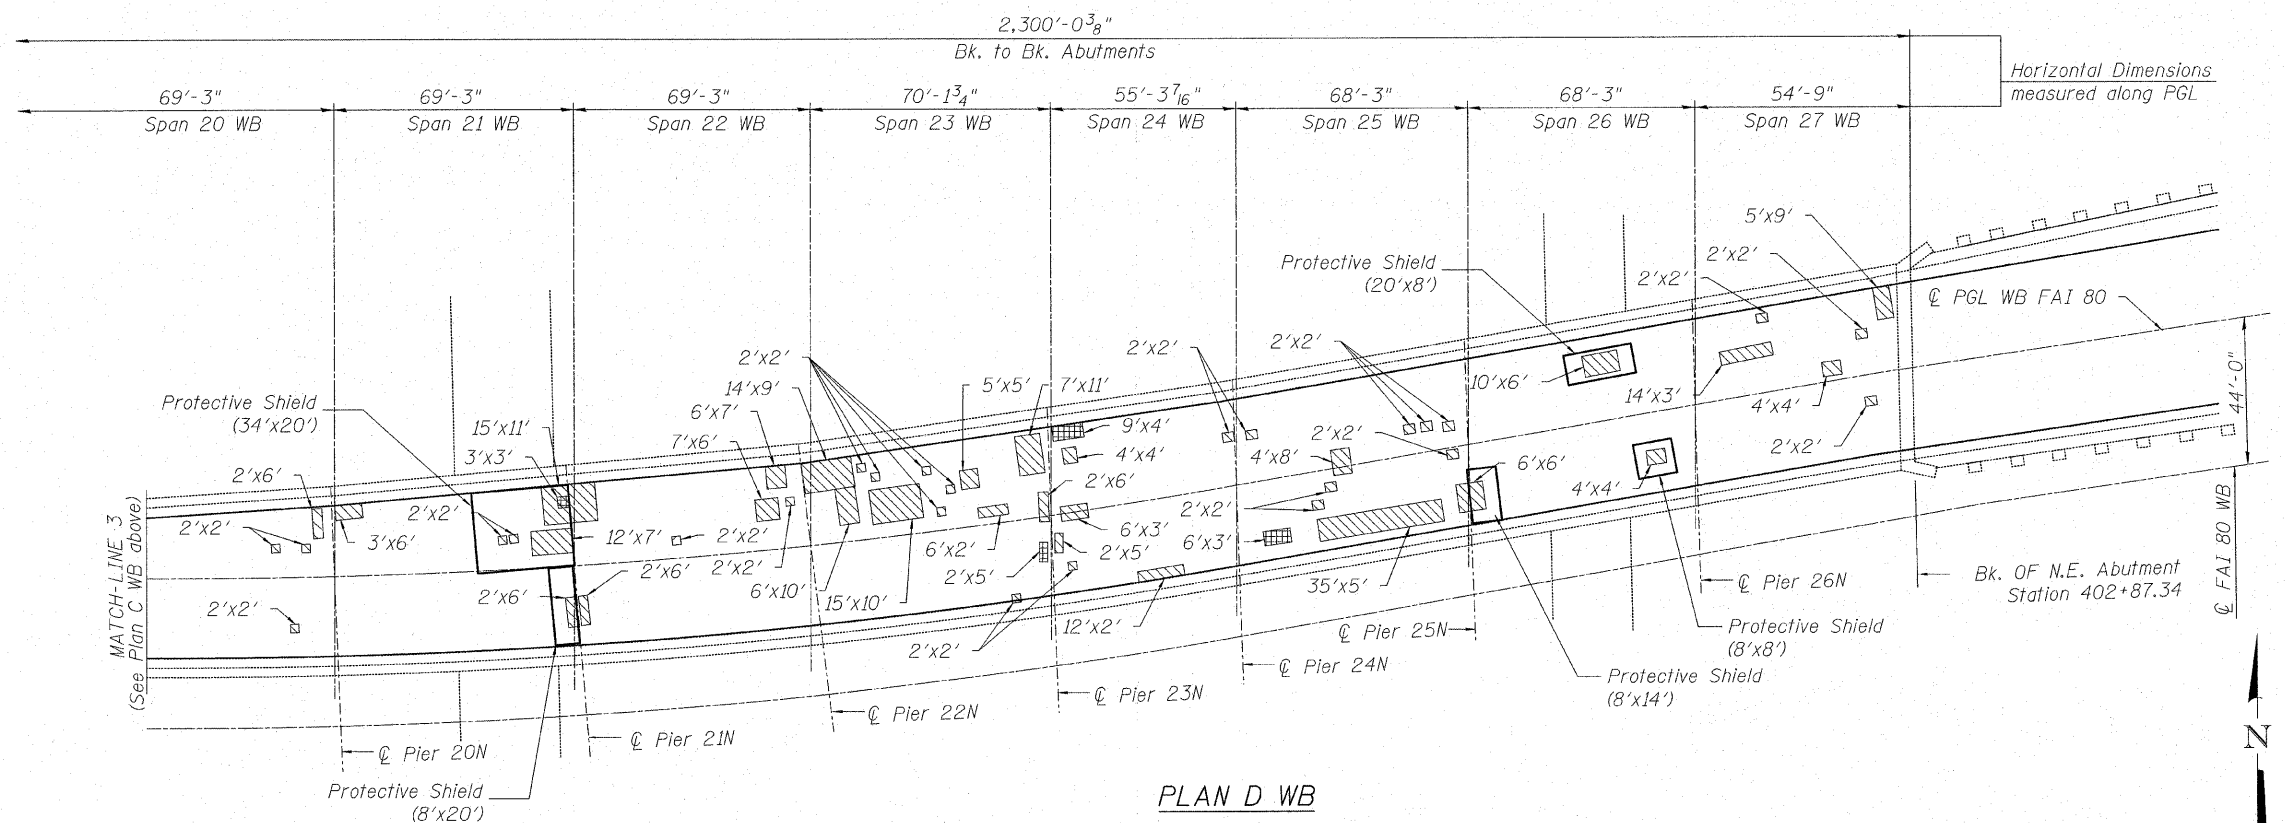

PLAN D WB

LEGEND:

- Deck Slab Repair (Partial)
- Deck Slab Repair (Partial) w/ Welded Wire Fabric *
- Deck Slab Repair (Full Depth, Type II)
- Protective Shield

* Existing wearing surface contains welded wire fabric (WWF 3x3-D8xD8 (E)) in east approach spans (Span 10WB through Span 27WB). Remove and replace welded wire fabric when performing deck slab repair. Cost of removing and replacing WWF is incidental to Deck Slab Repair (Partial).


BILL OF MATERIAL

ITEM	UNIT	TOTAL
Deck Slab Repair (Partial)	Sq.Yd.	194
Deck Slab Repair (Full Depth, Type II)	Sq.Yd.	16
Protective Shield	Sq.Yd.	137

NOTES:

1. Areas of proposed deck repairs are estimated. Actual type, location and dimensions of deck repairs are to be determined by the Engineer during construction.
2. Reuse existing drain if drain falls within a full depth repair.

USER NAME = CMF	DESIGNED - GMK	REVISED -
PLOT SCALE = 2:1	DRAWN - GFP	REVISED -
PLOT DATE = 08-FEB-2011	CHECKED - WPK/MWS/GMK	REVISED -
FILE NAME = 0990057-60M66-002-DECK-WB.DGN	DATE - 02/08/2011	REVISED -

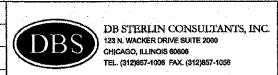

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

DECK SLAB REPAIR PLAN
WB I-80 OVER DES PLAINES RIVER
STRUCTURE NO. 099-0057

F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
80	99 (4 & 4-1)RS-3	WILL	203	115
CONTRACT NO. 60M66				
FED. ROAD DIST. NO. 1 ILLINOIS FED. AID PROJECT				

SHEET NO. S-6 OF S-35 SHEETS