


PIER 18 BILL OF MATERIAL	UNIT	QUANTITY
STRUCTURAL REPAIR OF CONCRETE $\leq 5"$	SQ. FT.	173
BRIDGE DRAINAGE SYSTEM REPAIRS	FOOT	35

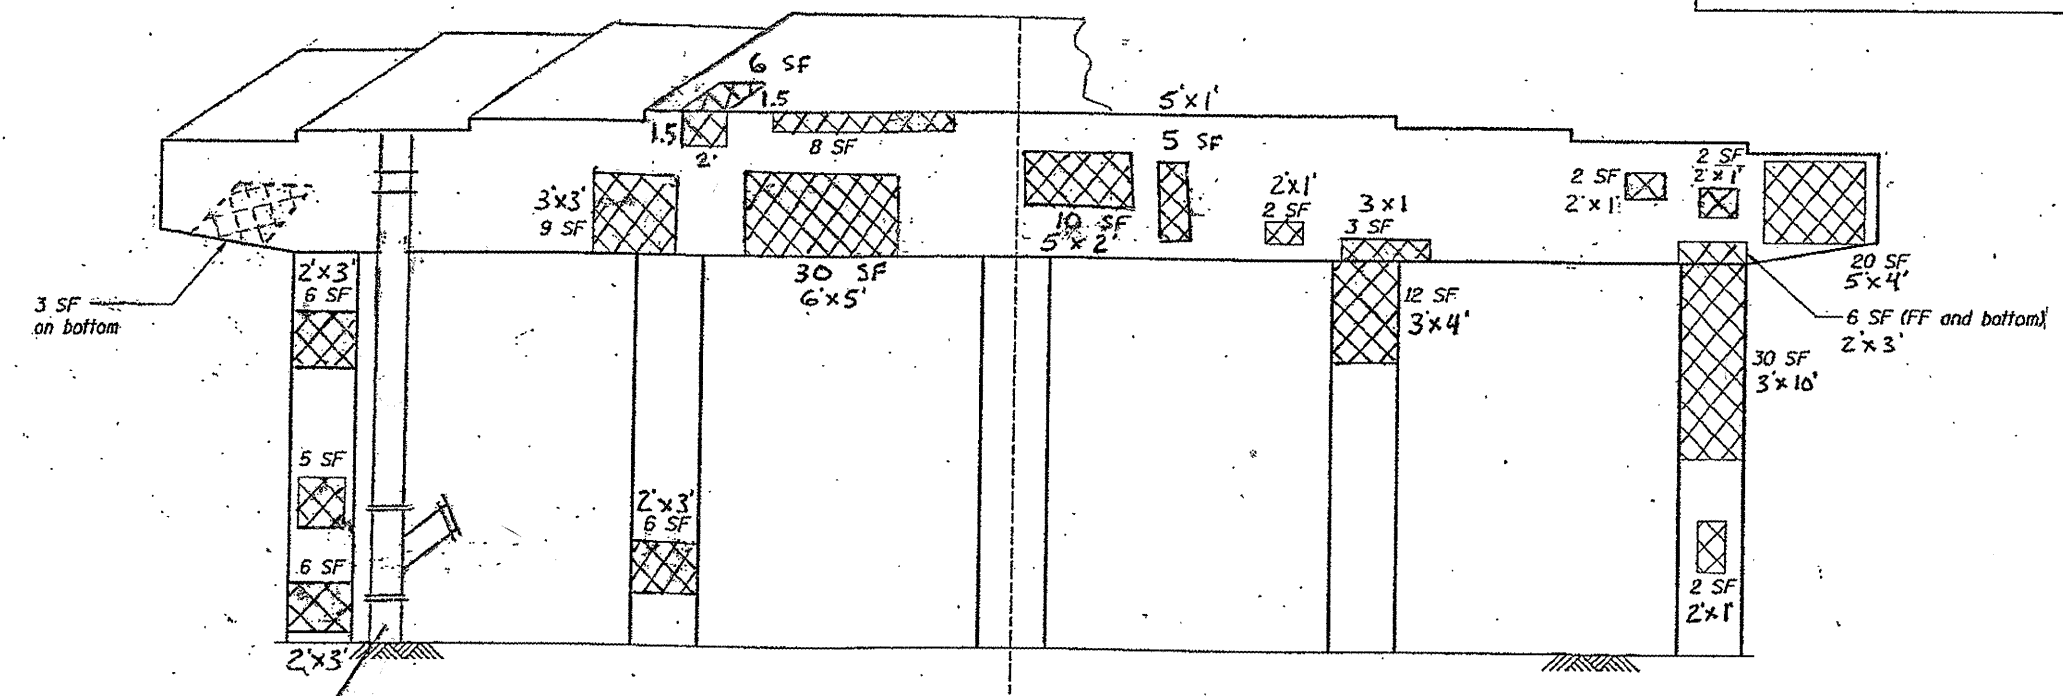

MISSING DRAIN PIPE (30 FT) AND BROKEN CLEANOUT (5 FT) TO BE REPLACED. INCLUDED IN QUANTITY OF BRIDGE DRAINAGE SYSTEM REPAIRS.

PIER 18 - SOUTH FACE ELEVATION

REPLACE METAL BAND AND STEEL BRACKET SUPPORTING PIPE. REPAIR SPALLED AREA AROUND CONCRETE ANCHORS. INCLUDED IN QUANTITY OF BRIDGE DRAINAGE SYSTEM REPAIRS.

 STRUCTURAL REPAIR OF CONCRETE $\leq 5"$

FILE NAME =	USER NAME = econnellta	DESIGNED -	REVISED - 3/25/11 JEK	STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION	LOCATION 1	SN 016-0806	F.A. R.T.E.	SECTION	COUNTY	TOTAL SHEET NO.
en:\pwwork\pwwork\ecconnellta\02228365\	750510-shrplan.dgn	DRAWN -	REVISED -		PIER STRUCTURAL REPAIR	PIER 18	VAR	2010-068 BR	COOK	69
		CHECKED -	REVISED -							41
		DATE -	REVISED -							CONTRACT NO. 60LS1
					SCALE:	SHEET NO. 26 OF 45 SHEETS	STA.	TO STA.	ILLINOIS FED. AID PROJECT	