
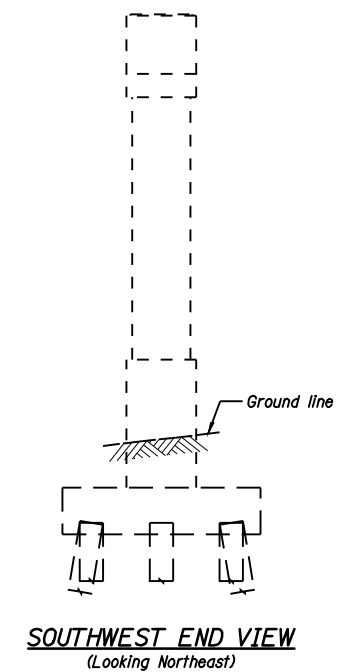
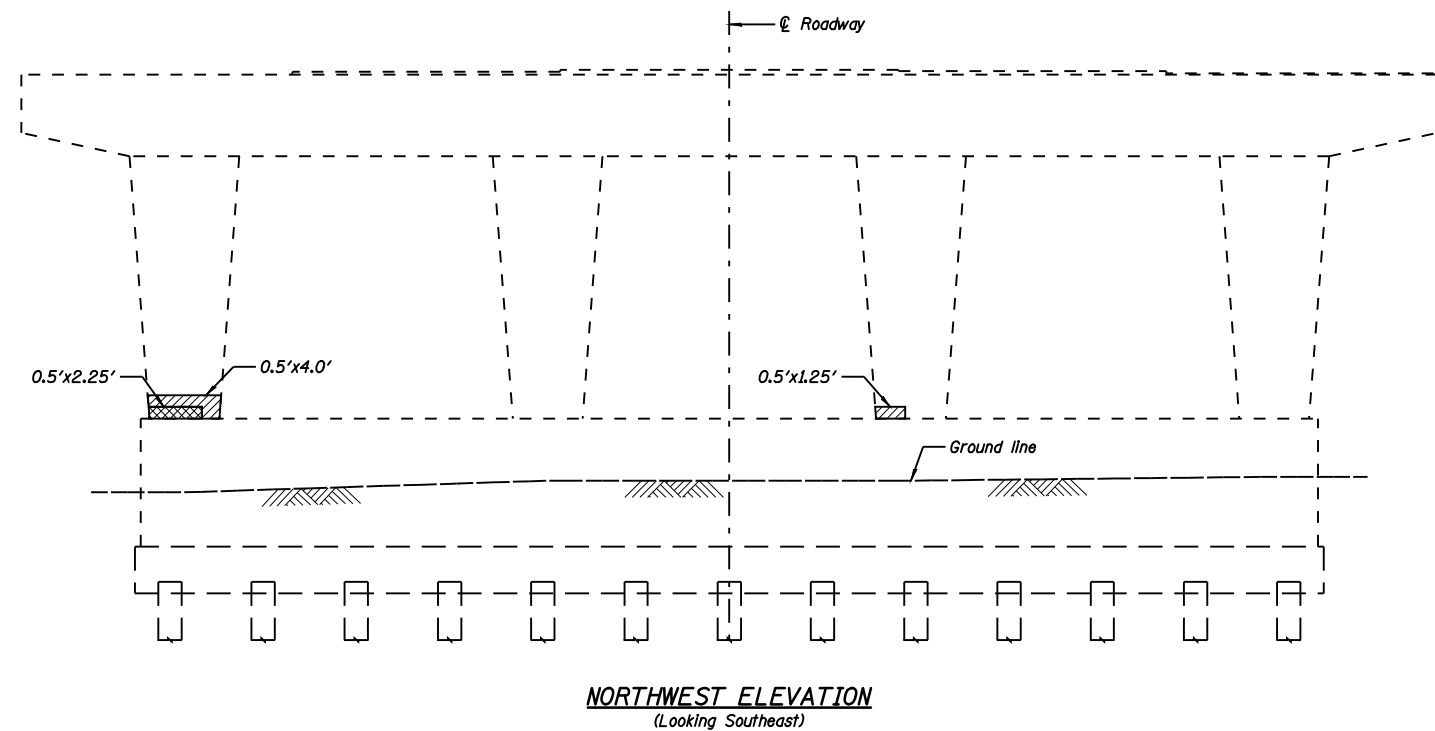
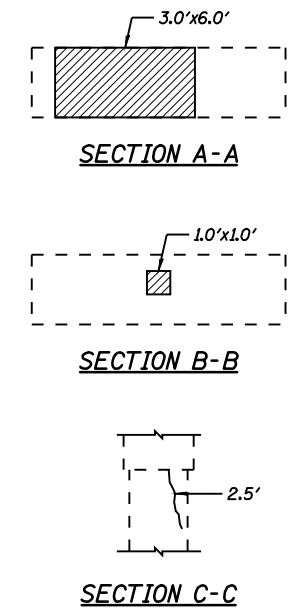
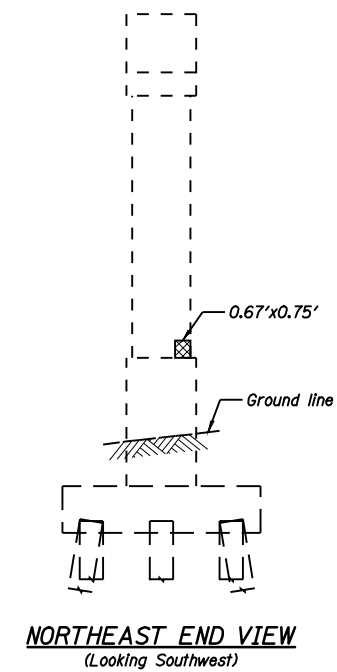


STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

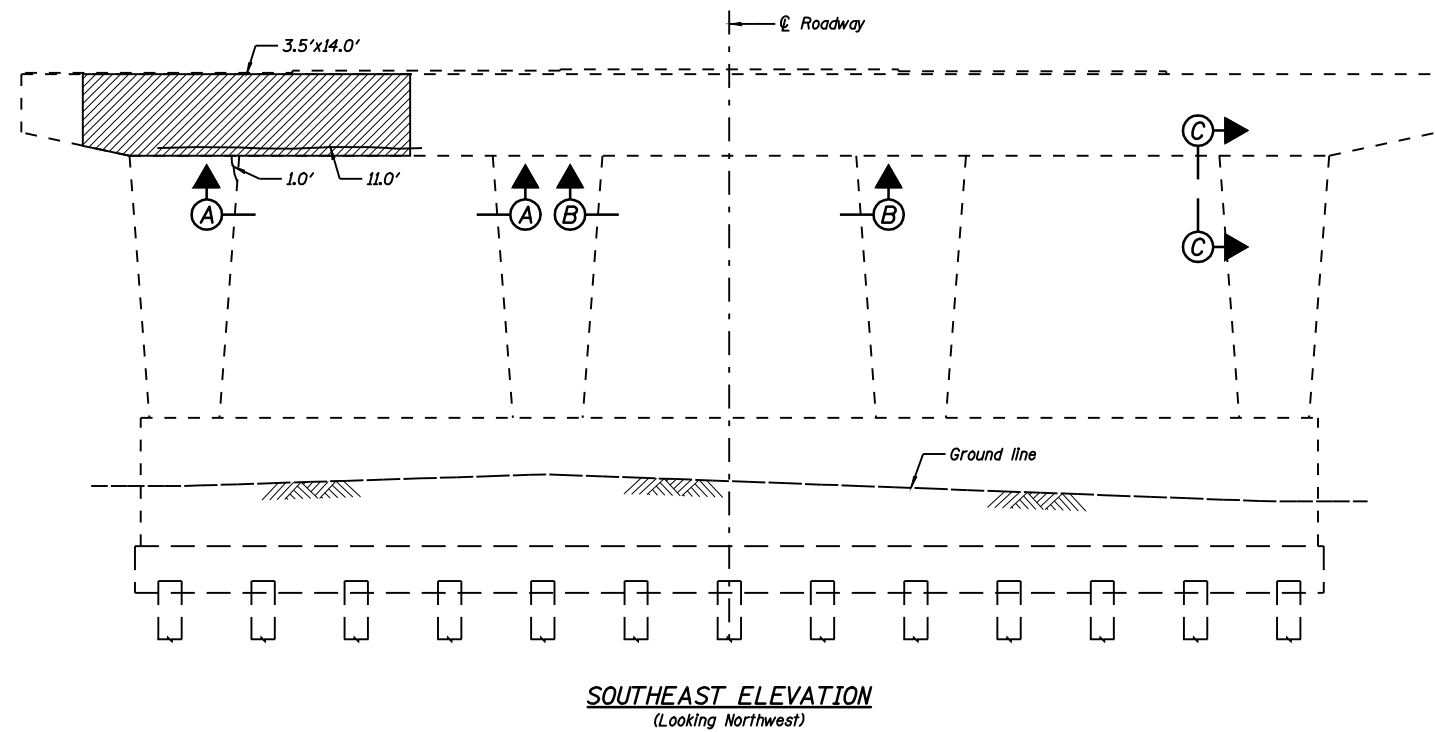

BILL OF MATERIAL

Item	Unit	Total
Epoxy Crack Injection	Foot	15
Structural Repair of Concrete (Depth Greater Than 5 Inches)	Sq. Ft.	2
Structural Repair of Concrete (Depth Equal to or Less Than 5 Inches)	Sq. Ft.	71

LEGEND

- Structural Repair of Concrete
(Depth Greater Than 5 Inches)
- Structural Repair of Concrete
(Depth Equal to or Less Than 5 Inches)
- 1.0' Epoxy Crack Injection

DESIGNED <i>JML</i>
CHECKED <i>MSW</i>
DRAWN <i>DJM</i>
CHECKED <i>MGO/MSW</i>

DATE 03/05/09

NOTE:

Crack widths are $\frac{1}{8}$ " ($\pm \frac{1}{16}$ ") unless otherwise noted.

**PIER NO. 1 REPAIR
STRUCTURE NO. 084-0028**

SHEET NO. B40	F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
	55	(84-3HB-6)BR	SANGAMON	90	74
44 SHEETS	SN 084-0028		CONTRACT NO. 72A64		
FED. ROAD DIST. NO. 6 ILLINOIS FED. AID PROJECT					