


STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

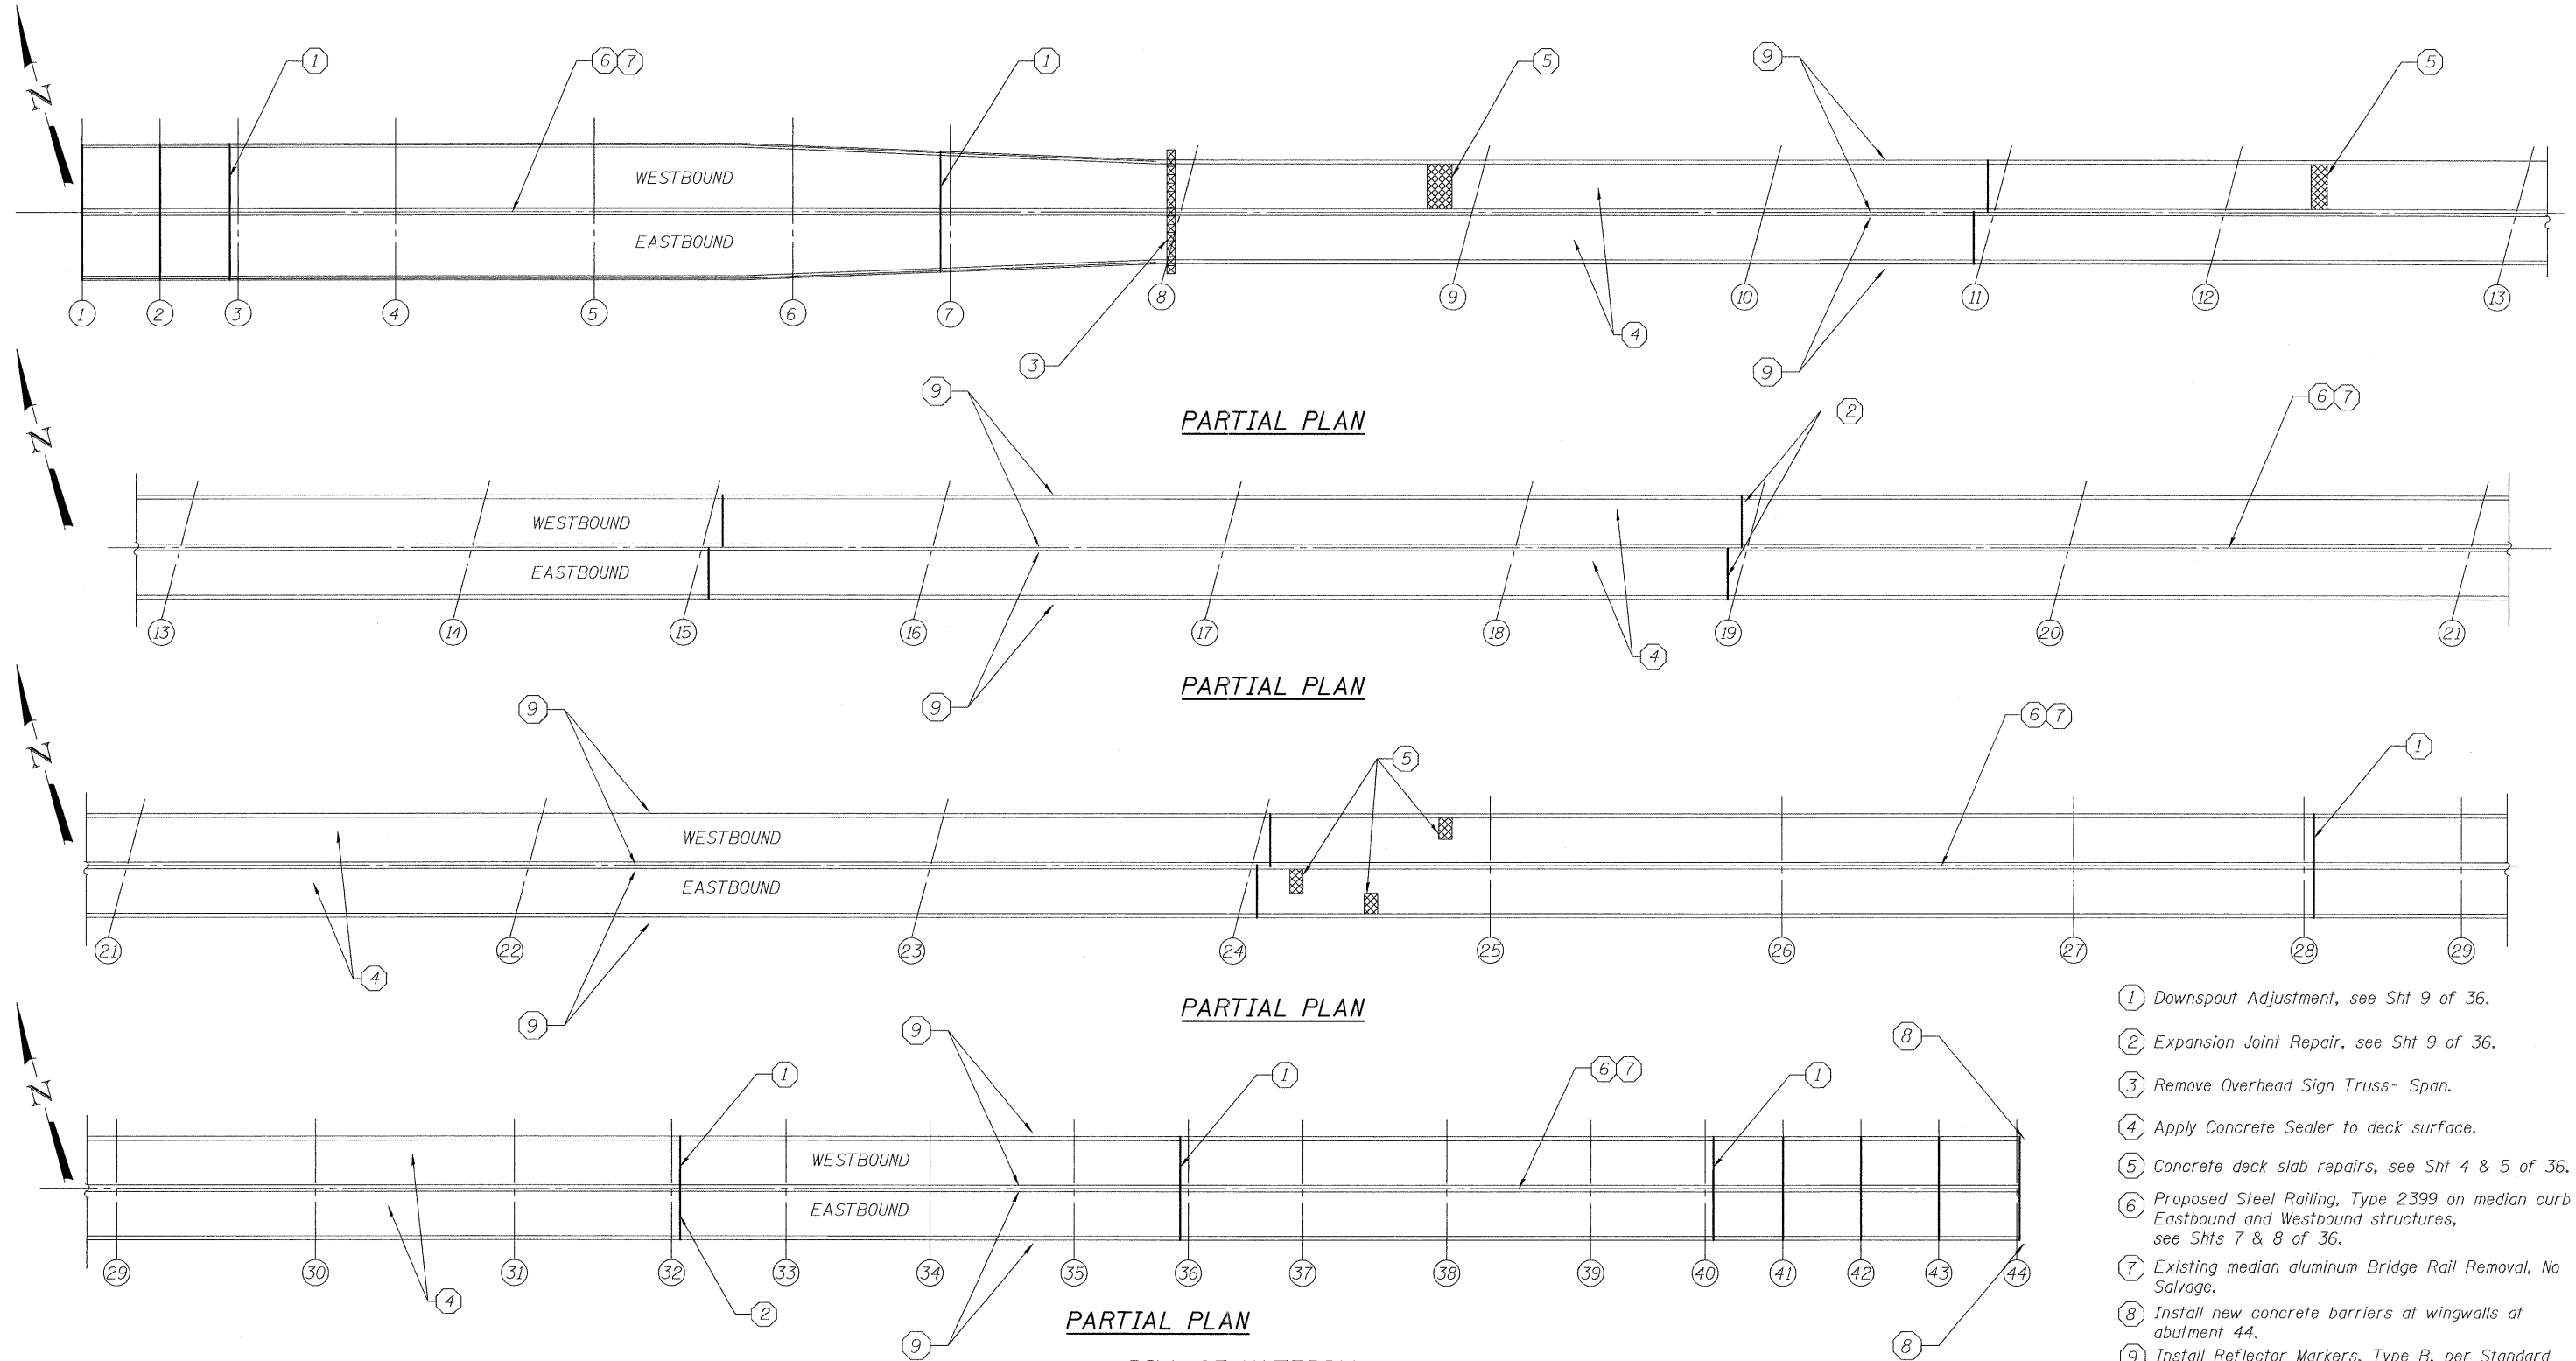

- ① Downspout Adjustment, see Sht 9 of 36.
- ② Expansion Joint Repair, see Sht 9 of 36.
- ③ Remove Overhead Sign Truss- Span.
- ④ Apply Concrete Sealer to deck surface.
- ⑤ Concrete deck slab repairs, see Sht 4 & 5 of 36.
- ⑥ Proposed Steel Railing, Type 2399 on median curb Eastbound and Westbound structures, see Shts 7 & 8 of 36.
- ⑦ Existing median aluminum Bridge Rail Removal, No Salvage.
- ⑧ Install new concrete barriers at wingwalls at abutment 44.
- ⑨ Install Reflector Markers, Type B, per Standard Drawings 635006 & 635011.

BILL OF MATERIAL

Item	Unit	Total
Concrete Sealer	Sq. Yd.	33,634
Remove Overhead Sign Structure - Span	Each	1
Cleaning Drainage System	L Sum	1
Monodirectional Prismatic Barrier Reflector	Each	276
Bridge Rail Removal	Foot	5,409

**SUPERSTRUCTURE PLAN
STRUCTURE NO. 060-0035**

DESIGNED	TMB
CHECKED	TSB
DRAWN	JGC / TMB
CHECKED	TSB



SHEET NO. 3 36 SHEETS	F.A.I. RTE. 270	SECTION 60B-I-8	COUNTY MADISON	TOTAL SHEETS 49	SHEET NO. 16
	CONTRACT NO. 76A92			FED. ROAD DIST. NO. 8 ILLINOIS FED. AID PROJECT	

L:\164718-Chan of Rocks\04 Design\CADD\Sheet Files\0600035-76A92-003-SuperPlan.dgn