


UNIT 3

- Deck Slab Repair (Partial) 313 sq. yd.
- Deck Slab Repair (Full Depth, Type I) 0 sq. yd.
- Deck Slab Repair (Full Depth, Type II) 6 sq. yd.

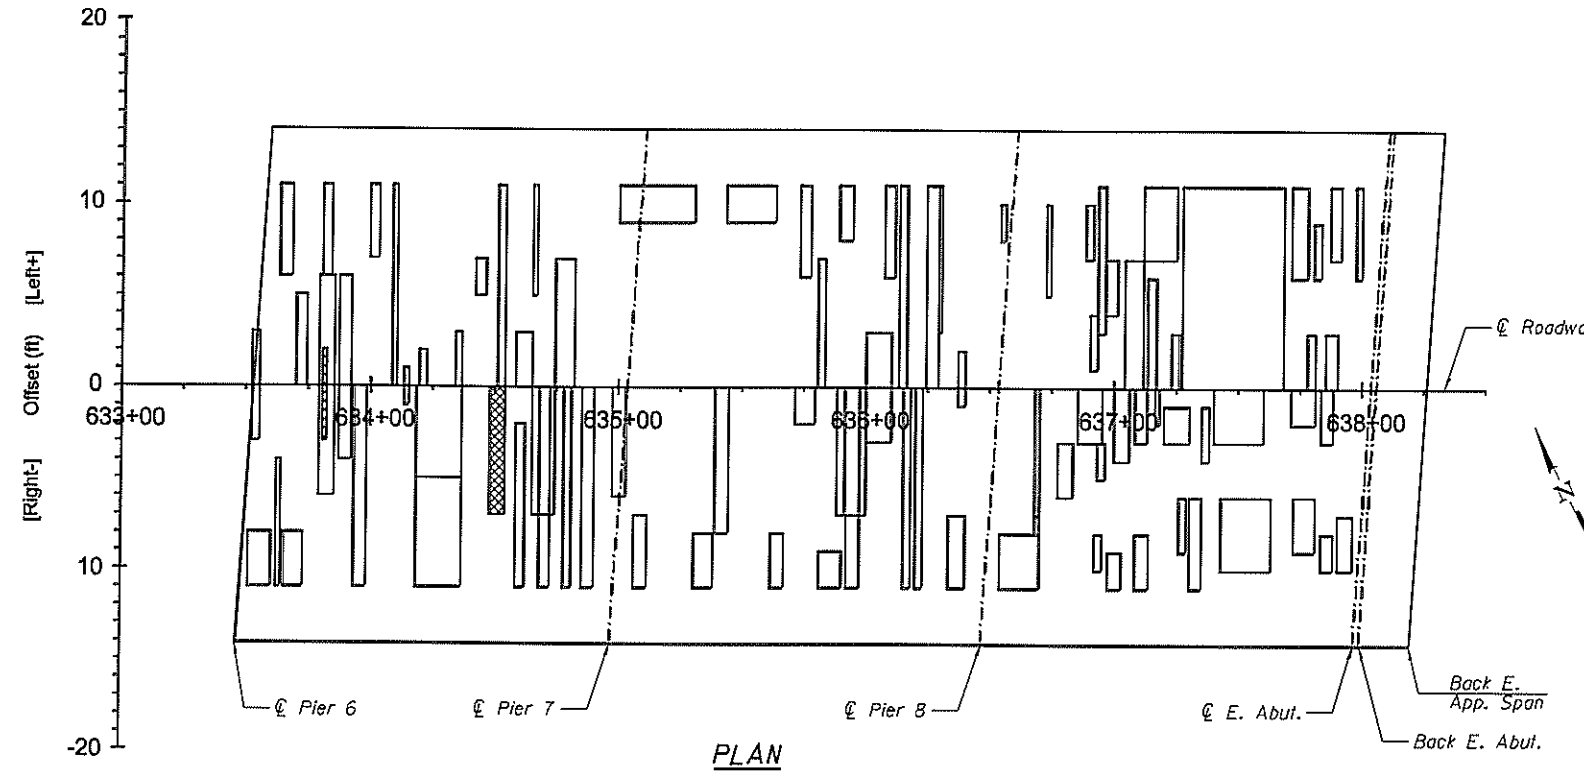

Notes

- The areas of deck repairs are estimated.
- The deck survey and schedule shows 313 sq. yds. of partial depth deck slab repairs. Plan quantities have been increased by 20% (to 376 sq. yds.)
- The deck survey and schedule shows 6 sq. yds. of full depth deck slab repairs. Plan quantities have been increased by 50% (to 9 sq. yds.)
- The Engineer shall show actual patch locations on as-built plans.
- Deck Survey 3-16-2011

Patch #	Start Sta	End Sta	Offsets (ft)		Length (ft.)	Width (ft.)	Area (sy)	Full or Partial Depth	Type I or II (Full Depth)
			From	To					
1	633+52	633+55	3 Lt	3 Rt	3	6	2.00	P	
2	633+51	633+60	8 Rt	11 Rt	9	3	3.00	P	
3	633+62	633+64	4 Rt	11 Rt	2	7	1.56	P	
4	633+65	633+73	8 Rt	11 Rt	8	3	2.67	P	
5	633+70	633+74	0 Lt	5 Lt	4	5	2.22	P	
6	633+63	633+68	6 Lt	11 Lt	5	5	2.78	P	
7	633+79	633+85	0 Lt	6 Lt	6	6	4.00	P	
8	633+79	633+85	0 Rt	6 Rt	6	6	4.00	P	
9	633+80	633+84	6 Lt	11 Lt	4	5	2.22	P	
10	633+87	633+92	6 Lt	4 Rt	5	10	5.56	P	
11	633+80	633+82	2 Lt	3 Rt	2	5	1.11	F	Type II
12	633+93	633+98	0 Rt	11 Rt	5	11	6.11	P	
13	633+99	634+03	7 Lt	11 Lt	4	4	1.78	P	
14	634+08	634+10	0 Lt	11 Lt	2	11	2.44	P	
15	634+13	634+15	1 Lt	1 Rt	2	2	0.44	P	
16	634+18	634+36	0 Rt	5 Rt	18	5	10.00	P	
17	634+18	634+36	5 Rt	11 Rt	18	6	12.00	P	
18	634+19	634+22	0 Lt	2 Lt	3	2	0.67	P	
19	634+34	634+36	0 Lt	3 Lt	2	3	0.67	P	
20	634+42	634+46	5 Lt	7 Lt	4	2	0.89	P	
21	634+48	634+54	0 Rt	7 Rt	6	7	4.67	F	Type II
22	634+51	634+54	0 Lt	11 Lt	3	11	3.67	P	
23	634+58	634+62	2 Rt	11 Rt	4	9	4.00	P	
24	634+65	634+68	0 Rt	7 Rt	3	7	2.33	P	

Patch #	Start Sta	End Sta	Offsets (ft)		Length (ft.)	Width (ft.)	Area (sy)	Full or Partial Depth	Type I or II (Full Depth)
			From	To					
25	634+72	634+74	0 Rt	7 Rt	2	7	1.56	P	
26	634+68	634+72	7 Rt	11 Rt	4	4	1.78	P	
27	634+58	634+65	0 Lt	3 Lt	7	3	2.33	P	
28	634+65	634+67	5 Lt	11 Lt	2	6	1.33	P	
29	634+74	634+82	0 Lt	7 Lt	8	7	6.22	P	
30	634+78	634+81	0 Rt	11 Rt	3	11	3.67	P	
31	634+85	634+90	0 Rt	11 Rt	5	11	6.11	P	
32	634+97	635+03	0 Rt	6 Rt	6	6	4.00	P	
33	635+06	635+11	7 Rt	11 Rt	5	4	2.22	P	
34	635+00	635+30	9 Lt	11 Lt	30	2	6.67	P	
35	635+30	635+38	8 Rt	11 Rt	8	3	2.67	P	
36	635+39	635+44	0 Rt	8 Rt	5	8	4.44	P	
37	635+43	635+63	9 Lt	11 Lt	20	2	4.44	P	
38	635+61	635+67	8 Rt	11 Rt	6	3	2.00	P	
39	635+71	635+79	0 Rt	2 Rt	8	2	1.78	P	
40	635+81	635+90	9 Rt	11 Rt	9	2	2.00	P	
41	635+88	635+91	0 Rt	7 Rt	3	7	2.33	P	
42	635+92	635+97	7 Rt	11 Rt	5	4	2.22	P	
43	635+97	636+00	0 Rt	7 Rt	3	7	2.33	P	
44	635+73	635+77	6 Lt	11 Lt	4	5	2.22	P	
45	635+80	635+83	0 Lt	7 Lt	3	7	2.33	P	
46	635+89	635+94	8 Lt	11 Lt	5	3	1.67	P	
47	636+00	636+10	3 Lt	3 Rt	10	6	6.67	P	
48	636+07	636+11	6 Lt	11 Lt	4	5	2.22	P	

PRINT DATE: 5/9/2014 7:02:28 AM z:\11815 bld idc east road\p\bridge\unit\3\sheet3\018-018-011-Deck_Patching_Survey_Unit_3.dgn

EFK Moen, LLC
 Civil Engineering Design
 303 Fountain Parkway, Suite 240
 Fairview Heights, IL 62168
 Phone 618-306-4256

USER NAME = cdl	DESIGNED - CTW	REVISIONS -
PLLOT SCALE = 0:2.0000" = 1' / IN.	CHECKED - CDL	REVISIONS -
PLLOT DATE = 5/9/2014	DRAWN - DP	REVISIONS -
	DATE - 5/9/2014	REVISIONS -

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

DECK PATCHING SURVEY UNIT 3
STRUCTURE NO. 079-0019
 SHEET NO. 10 OF 13 SHEETS

F.A.S. RTE. 858	SECTION 12VB-11	COUNTY RANDOLPH	TOTAL SHEETS 12	SHEET NO. 43
CONTRACT NO. 76409				
ILLINOIS FED. AID PROJECT				