



| | | | | |
|---------------------|-----------|------------------|--------------|-----------|
| F.A.I. | SECTION | COUNTY | TOTAL SHEETS | SHEET NO. |
| 94/90 | 2003-028F | COOK | 419 | 22 |
| STA. | TO STA. | | | |
| FED. ROAD DIST. NO. | ILLINOIS | FED. AID PROJECT | 62580 | |

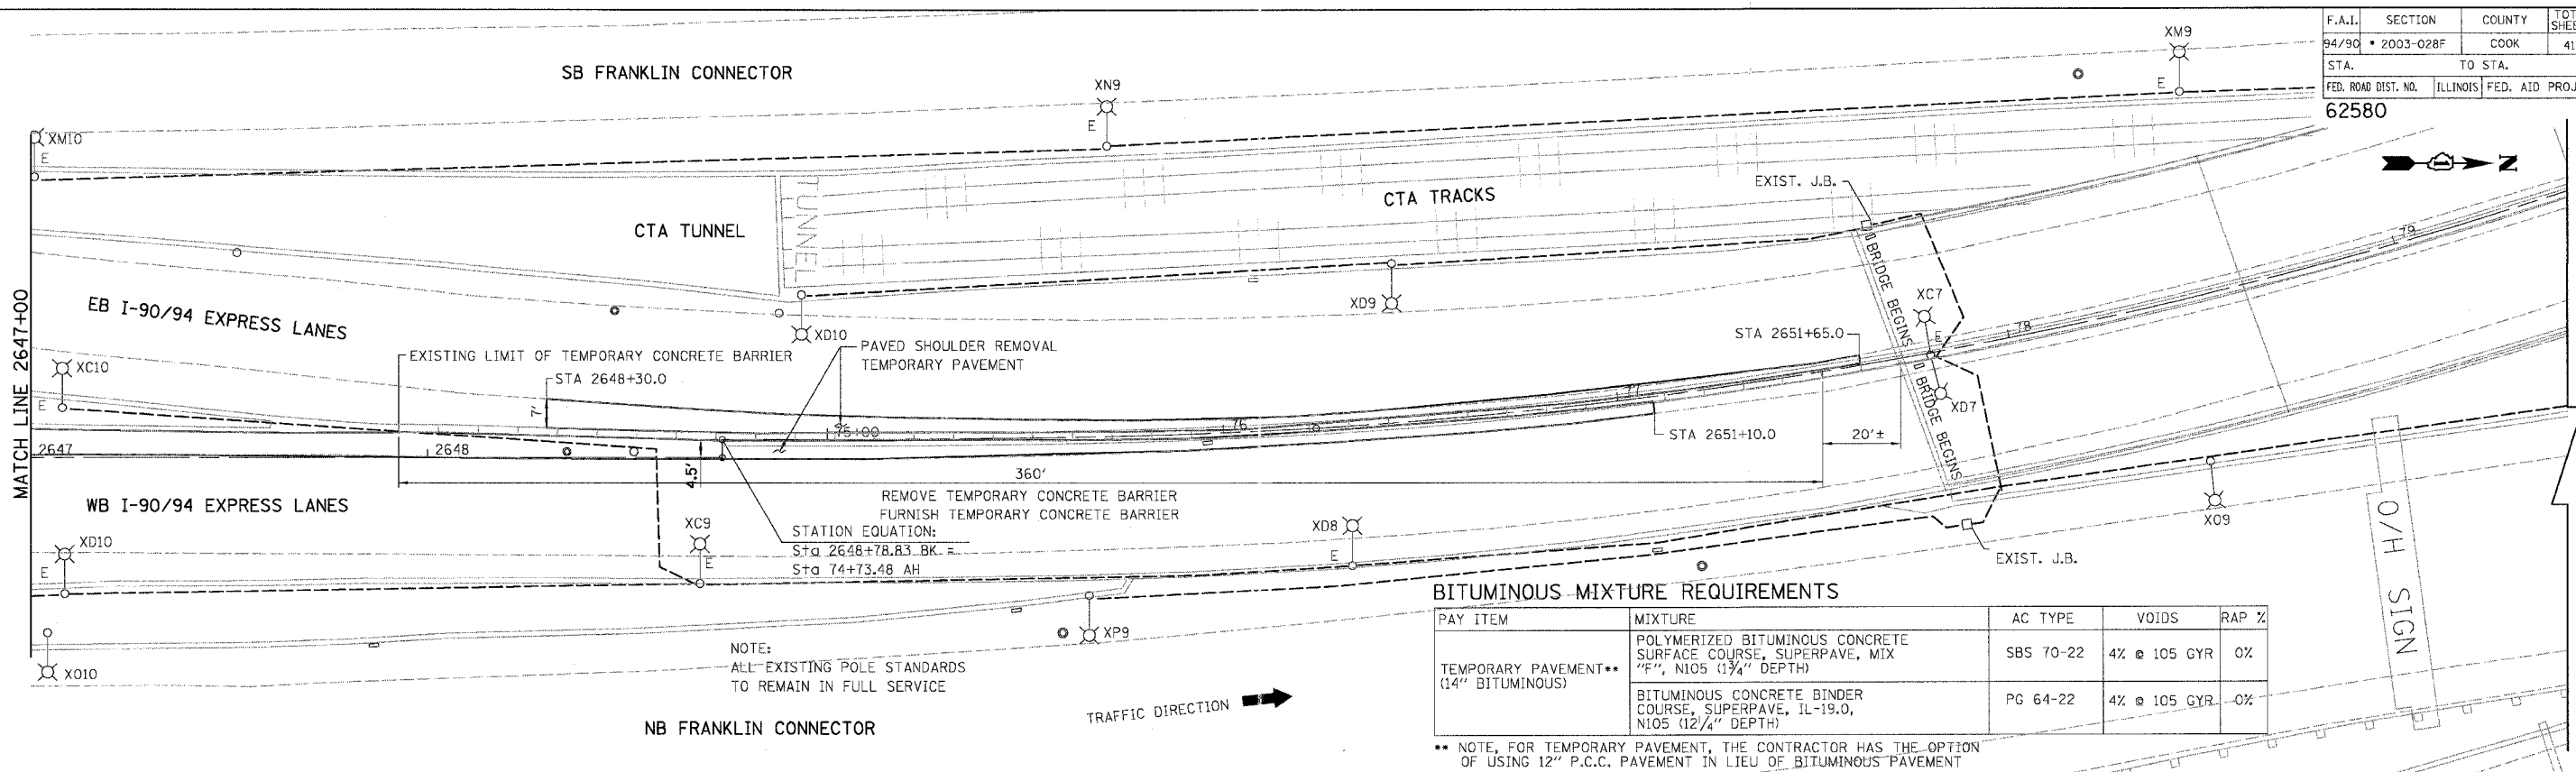

BITUMINOUS MIXTURE REQUIREMENTS

| PAY ITEM | MIXTURE | AC TYPE | VOIDS | RAP % |
|---------------------------------------|---|-----------|--------------|-------|
| TEMPORARY PAVEMENT** (14" BITUMINOUS) | POLYMERIZED BITUMINOUS CONCRETE SURFACE COURSE, SUPERPAVE, MIX "F", N105 (1 3/4" DEPTH) | SBS 70-22 | 4% @ 105 GYR | 0% |
| | BITUMINOUS CONCRETE BINDER COURSE, SUPERPAVE, IL-19.0, N105 (12 3/4" DEPTH) | PG 64-22 | 4% @ 105 GYR | -0% |

** NOTE: FOR TEMPORARY PAVEMENT, THE CONTRACTOR HAS THE OPTION OF USING 12" P.C.C. PAVEMENT IN LIEU OF BITUMINOUS PAVEMENT

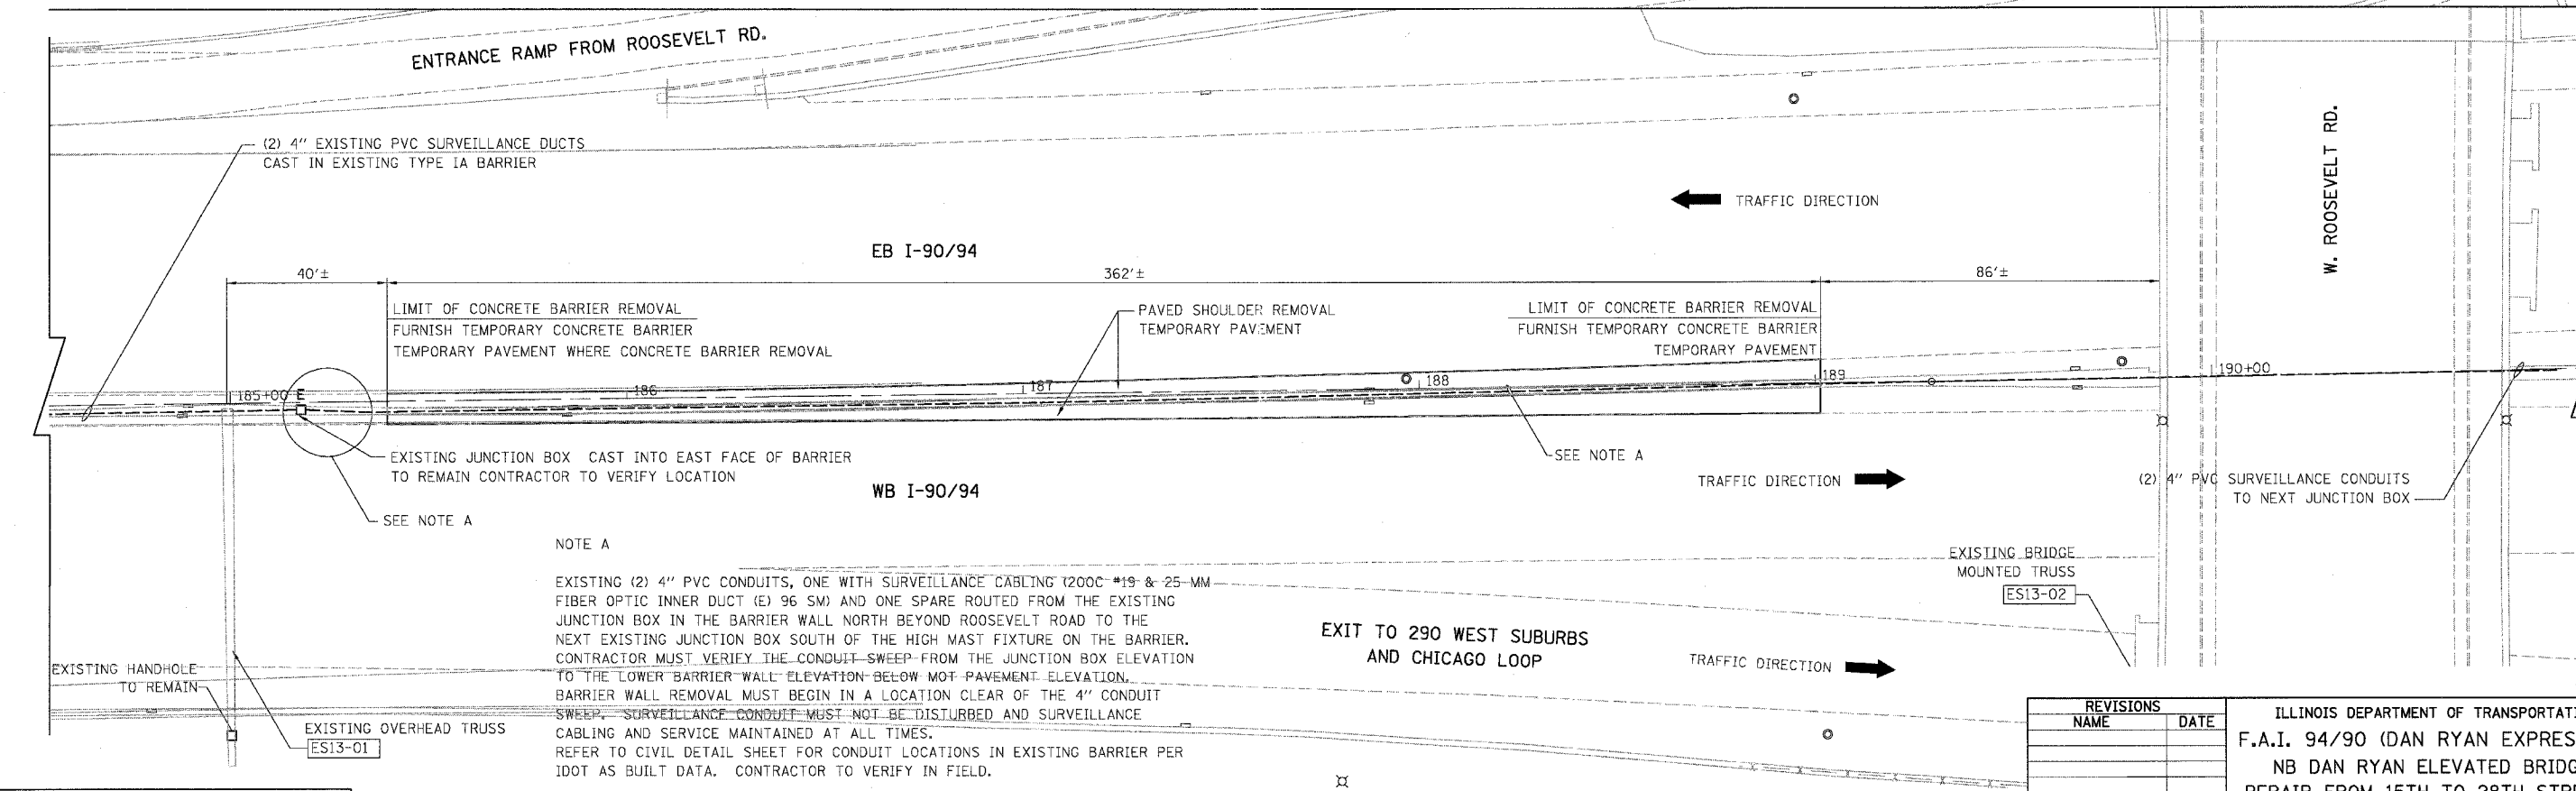


NOTE A

EXISTING (2) 4" PVC CONDUITS, ONE WITH SURVEILLANCE CABLING (200C #19 & 25-MM FIBER OPTIC INNER DUCT (E) 96 SM) AND ONE SPARE ROUTED FROM THE EXISTING JUNCTION BOX IN THE BARRIER WALL NORTH BEYOND ROOSEVELT ROAD TO THE NEXT EXISTING JUNCTION BOX SOUTH OF THE HIGH MAST FIXTURE ON THE BARRIER. CONTRACTOR MUST VERIFY THE CONDUIT SWEEP FROM THE JUNCTION BOX ELEVATION TO THE LOWER BARRIER WALL ELEVATION BELOW MOT-PAVEMENT ELEVATION. BARRIER WALL REMOVAL MUST BEGIN IN A LOCATION CLEAR OF THE 4" CONDUIT SWEEP. SURVEILLANCE CONDUIT MUST NOT BE DISTURBED AND SURVEILLANCE CABLING AND SERVICE MAINTAINED AT ALL TIMES. REFER TO CIVIL DETAIL SHEET FOR CONDUIT LOCATIONS IN EXISTING BARRIER PER IDOT AS BUILT DATA. CONTRACTOR TO VERIFY IN FIELD.

| REVISIONS | NAME | DATE |
|-----------|------|------|
| | | |
| | | |
| | | |
| | | |

ILLINOIS DEPARTMENT OF TRANSPORTATION
 F.A.I. 94/90 (DAN RYAN EXPRESSWAY)
 NB DAN RYAN ELEVATED BRIDGE
 REPAIR FROM 15TH TO 28TH STREETS
 EXISTING AND PROPOSED PLAN

SCALE: 1"=20'
 DATE: 8/12/2005
 DRAWN BY: RA
 CHECKED BY: RS

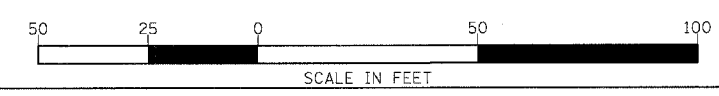

BOWMAN, BARRETT & ASSOCIATES INC
 CONSULTING ENGINEERS
 Chicago, Illinois
 312.228.0100
 www.bbendainc.com

CPL-02
 8/17/2005 1:42:33 PM