


Notes:  
 The structural steel shall be galvanized after shop fabrication according to AASHTO M 232.  
 Anchor bolts and plate washers shall be galvanized according to AASHTO M 232.

**BILL OF MATERIAL**

ITEM	UNIT	QUANTITY
Furnishing and Erecting Structural Steel	Pound	2660
Deck Slab Repair (Full)	Sq. Yd.	3.4
Deck Slab Repair (Partial)	Sq. Yd.	3.4
Protective Shield	Sq. Yd.	7
Anchor Bolts, 1"	Each	76

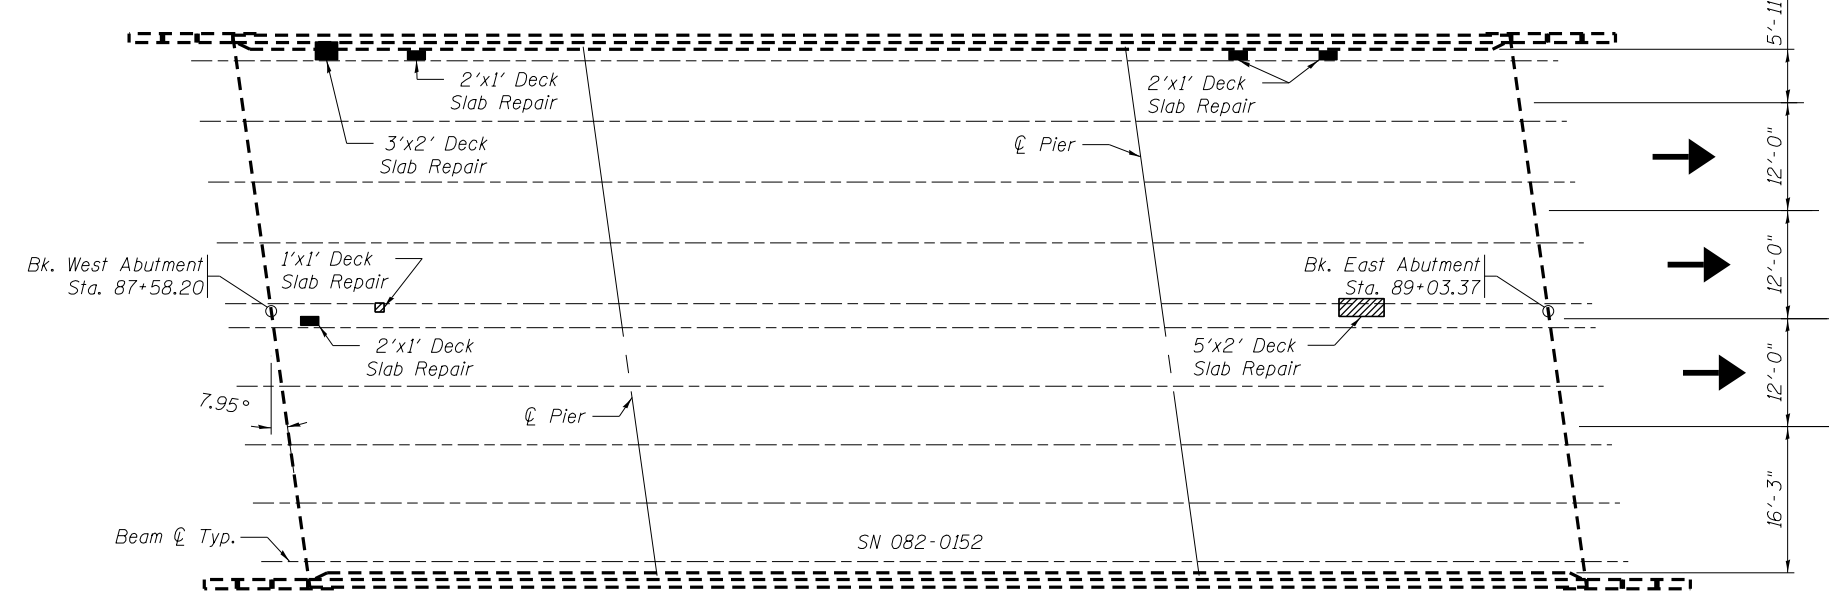

**DECK REPAIR PLAN**

**LEGEND**

- Area of Partial Depth Deck Repair
- Area of Full Depth Deck Repair

**BENTON & ASSOCIATES, INC.**

FILE NAME = P:\10e2166-2\ Design\ Plans\ 082-0152 & 082-0153	USER NAME =	DESIGNED - MBH	REVISED - 10/3/13
0820152-76022-004-Deck.dgn	PLOT SCALE =	CHECKED - SJH	REVISED -
	PLOT DATE =	DRAWN - MBH	REVISED -
		CHECKED - SJH	REVISED -

**STATE OF ILLINOIS  
 DEPARTMENT OF TRANSPORTATION**

**DECK REPAIRS  
 STRUCTURE NO. 082-0152 & 082-0153**

SHEET NO. 5 OF 9 SHEETS

F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
64	82-1HB1-2	ST. CLAIR	208	133
CONTRACT NO. 76022				
FED. ROAD DIST. NO. 8   ILLINOIS FED. AID PROJECT				