



STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

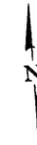


BILL OF MATERIAL

SYMBOL	ITEM	UNIT	QUANTITY
	Deck Slab Repair (Partial)	Sq. Yd.	88.4 [▲]
	Deck Slab Repair (Full Depth - Type I)	Sq. Yd.	23.3
	Deck Slab Repair (Full Depth - Type II)	Sq. Yd.	16.0
	Cleaning & Painting Exposed Rebar (Special)	Sq. Ft.	21
	Approach Slab Repair (Partial Depth)	Sq. Yd.	19.0
	Protective Shield	Sq. Yd.	1,093
	Bridge Deck Hydro-Scarification, 2 1/4"	Sq. Yd.	1,433
	Bridge Deck Latex Concrete Overlay, 2 1/4"	Sq. Yd.	1,433
	Protective Coat	Sq. Yd.	1,499
	Bridge Deck Grooving	Sq. Yd.	1,394

[▲] For information only to assist the Contractor in bidding. See Special Provisions for "Bridge Deck Latex Concrete Overlay".

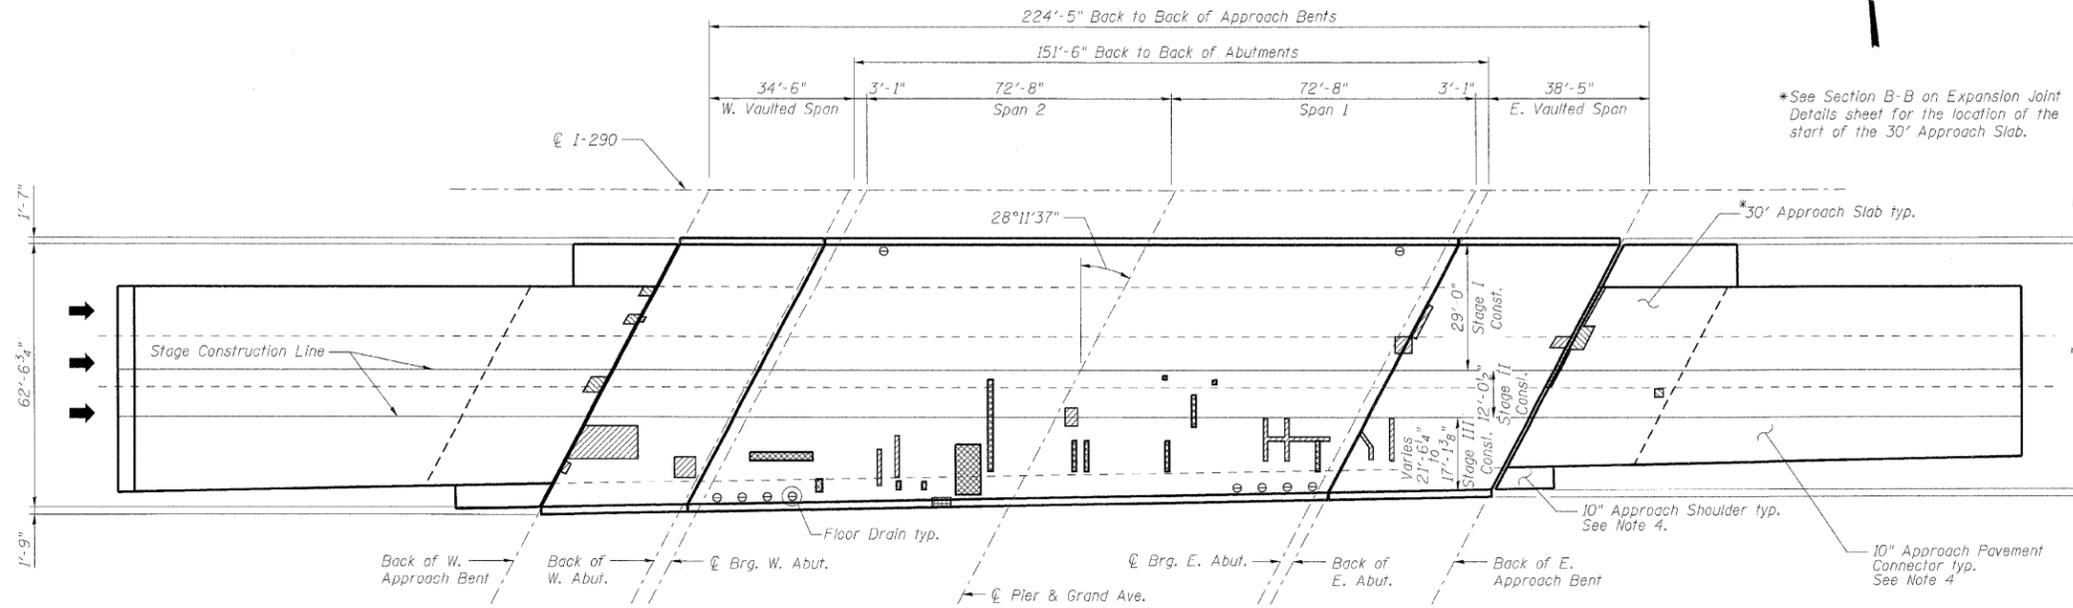


PLAN

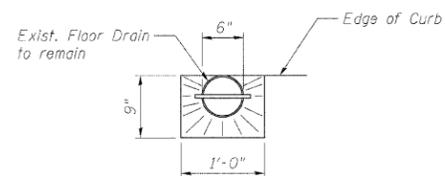

PLAN


[▲] For information only to assist the Contractor in bidding. See Special Provision for "Bridge Deck Latex Concrete Overlay".

** Contractor shall increase scarification thickness or reduce overlay thickness as directed by the Engineer to ensure this dimension is never less than 0".

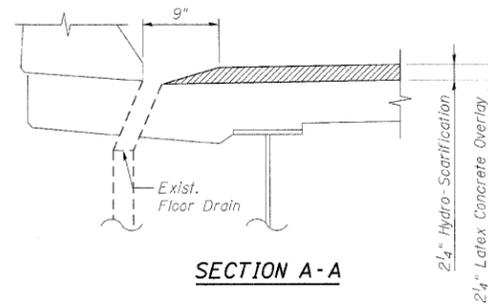

SECTION A-A

CONCRETE OVERLAY AT FLOOR DRAIN

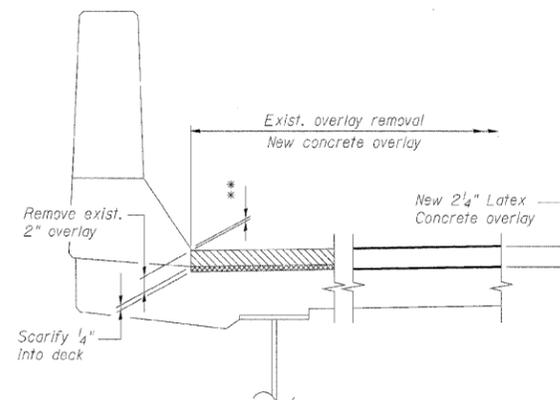

**SCARIFICATION & OVERLAY
DETAIL AT PARAPET**

Notes:

- Deck and approach slab repair areas are estimated based on visual inspection completed in June 2009. Actual repair areas and locations shall be determined by the Engineer and shown on As-Built plans.
- Protective Shield, required for deck slab and/or parapet repairs, shall be installed according to Article 501.03 of the Standard Specifications. For limits of Protective Shield, see General Plan and Elevation sheet.
- Deck drains (downspouts, floor drains, and scuppers) shall be cleaned prior to placement of the Latex Concrete Overlay. Cost of cleaning the deck drains is included in Bridge Deck Hydro-Scarification, 2 1/4".
- The Engineer shall determine the type and quantity of Class A patching and the quantity of Mixture For Cracks, Joints and Flangeways. Estimated quantities are included in the overall Summary of Quantities in Roadway Plans.
- Gaps caused by distress around floor drains shall be filled with epoxy as specified in the Special Provision "Epoxy Injection". Cost included with Bridge Deck Latex Concrete Overlay, 2 1/4".

**BRIDGE DECK, VAULTED SPAN
AND APPROACH SLAB REPAIRS
STRUCTURE NO. 022-0102**

DESIGNED	-	MFB
CHECKED	-	KWS
DRAWN	-	RMG
CHECKED	-	KWS

benesch

alfred benesch & company
Engineers • Surveyors • Planners
205 North Michigan Avenue, Suite 2400
Chicago, Illinois 60601
312-566-0450 Job No. 10050

SHEET NO. 4 10 SHEETS	F.A.I. RTE. 290 355	SECTION 22(1, 1-1, 2&3)RS-7	COUNTY DUPAGE	TOTAL SHEETS 546	SHEET NO. 293
	CONTRACT NO. 60G51			FED. ROAD DIST. NO. ILLINOIS FED. AID PROJECT	