



#### REPAIRS LIST - SPANS 15, 16 and 17

	I.D.	Description	Pay Item	Units	Quantity	
	062	Concrete Spall	Deck Slab Repair (Partial)	SQ. YD.	0.11	
	063	Concrete Spall	Deck Slab Repair (Partial)	SQ. YD.	0.33	
	064	Concrete Spall	Deck Slab Repair (Partial)	SQ. YD.	0.11	
	065	Concrete Spall	Deck Slab Repair (Partial)	SQ. YD.	1.14	
	066	Concrete Spall	Deck Slab Repair (Partial)	SQ. YD.	0.48	
	067	Concrete Spall	Deck Slab Repair (Partial)	SQ. YD.	0.78	
	068	Concrete Spall	Deck Slab Repair (Partial)	SQ. YD.	0.44	
	069	Concrete Spall	Deck Slab Repair (Partial)	SQ. YD.	2.33	
	070	Concrete Spall	Deck Slab Repair (Partial)	SQ. YD.	0.25	
*	006	Missing Fasteners Bridge Rail Splice	-	-	-	
*	007	Missing Fasteners Bridge Rail Splice	-	-	-	
	-	-	-	-	-	
	-	-	-	-	-	
	-	-	-	-	-	
	-	-	-	-	-	
	-	-	-	-	-	
	-	-	-	-	-	
	-	-	-	-	-	
	-	-	-	-	-	
	-	-	-	-	-	
	-	-	-	-	-	
	-	-	-	-	-	

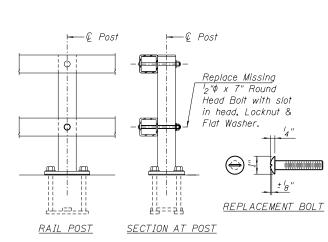

### BRIDGE RAIL POST FASTENER REPAIR

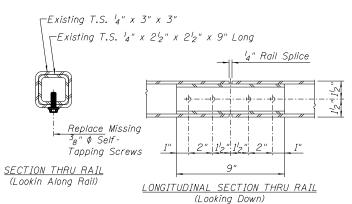

#### BRIDGE RAIL SPLICE FASTENER REPAIR

When neccessary reposition interior splice sleeve by realigning the sleeve and rail holes for either side prior to installing new fasteners. Install 2 fasteners on one side only. Fasteners shall be self tapping galvanized screws of sufficient diameter to retap any damaged screw holes and provide a tight

\* Cost for repairing existing bridge rail splice shall be included in the Cost of Deck Slab Repair (Partial).

# OTHER ITEMS

-Deck Slab Repair (Partial) \_Repair\_I.D.

000 5.5×5.5 -Repair Size LxW (Feet) L=Measured Along Route W=Measured Transverse to Route

## DECK SLAB REPAIR (PARTIAL)

i											
	DESIGNED -	EXAMINED		DATE -			REPAIRS TO - DECK SLAB and PARAPETS - SPANS 15, 16 and 17	F.A.P.	SECTION	COUNTY	TOTAL SHEET
3	CHECKED -	] –	ENGINEER OF STRUCTURAL SERVICES			STATE OF ILLINOIS		304	100B-1DS-1	MADISON	58 21
2	DRAWN Rod	PASSED			DEPARTMENT OF TRANSPORTATION	STRUCTURE NO. 060-0255				CONTRACT NO. 76E73	
	CHECKED MNM	_	ENGINEER OF BRIDGES AND STRUCTURES				SHEET NO. 11 OF 48 SHEETS		ILLINOIS FED. A	AID PROJECT	