




SOUTH ABUTMENT ELEVATION
(Looking South)

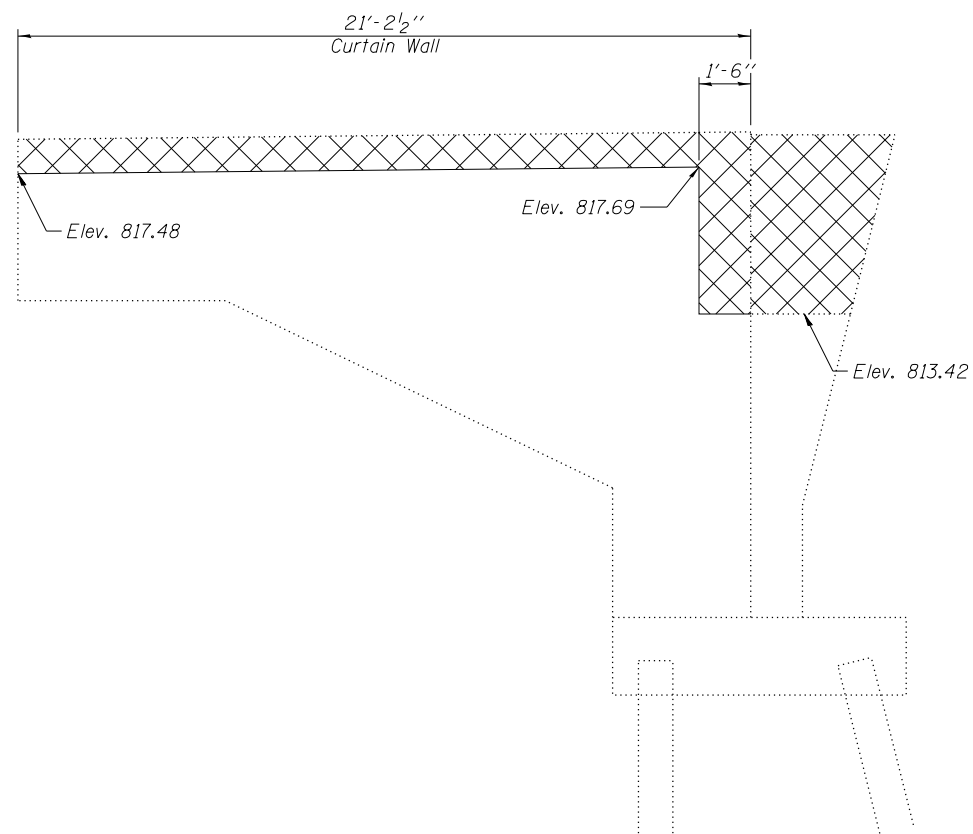

SOUTHEAST CURTAIN WALL ELEVATION
(Looking West)

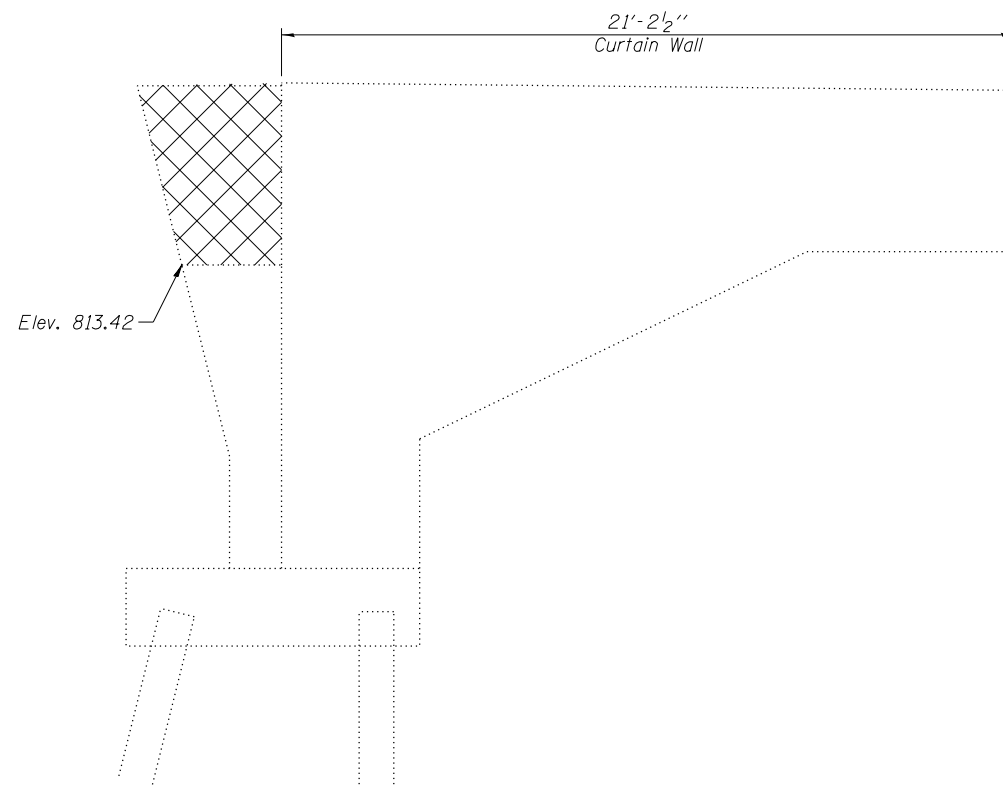

SOUTHWEST CURTAIN WALL ELEVATION
(Looking East)

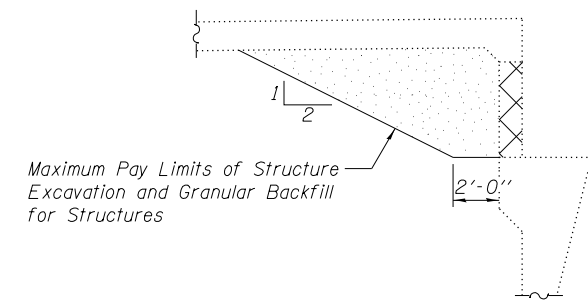

SECTION A-A

BILL OF MATERIAL

Item	Unit	Total
Concrete Removal	Cu. Yd.	11.6
Structural Repair of Concrete (Depth equal to or less than 5 inches)	Sq. Ft.	24

Notes:

Existing reinforcement bars to be reused shall be cleaned and incorporated in the new construction. These include the bars in the back face of the backwall, the bars from the west curtain wall into the approach slab, and the bars extending from the top of the approach bent. Cost included with Concrete Removal.

Removal of sand backfill necessary for removal of the existing backwall shall be paid for as Structure Excavation. Replace with Granular Backfill for Structures after completion of new backwall. These quantities are included with the abutment on Sheet 30 of 36.

FILE NAME = 0720146-68683-026-South Abut Repair.dgn	USER NAME = baswanson	DESIGNED - BAS	REVISED
		CHECKED - JAE	REVISED
		DRAWN - BAS	REVISED
		CHECKED - RAL	REVISED
	PLOT SCALE =		
	PLOT DATE = 1/24/2014		



STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

SOUTH ABUTMENT REPAIR
STRUCTURE NO. 072-0146

SHEET NO. 26 OF 36 SHEETS

F.A.P. RTE. 318	SECTION (72-7HB)BY	COUNTY PEORIA	TOTAL SHEETS 487	SHEET NO. 313
CONTRACT NO. 68683				
ILLINOIS FED. AID PROJECT				