


WEST ABUTMENT ELEVATION

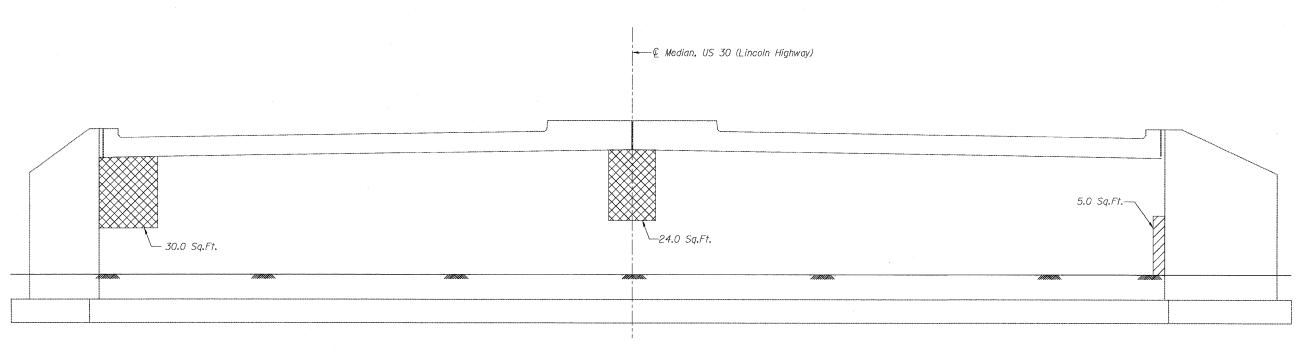

EAST ABUTMENT ELEVATION

Note: Repair of the existing abutment shall include but may not be limited to the areas shown. The actual areas to be repaired will be determined by the Engineer at the time of construction.

DESIGNED JPM CHECKED TG DRAWN MPS

CHECKED JPM, TG





Structural Repair of Concrete (Depth equal to or less than 5 inches)



Structural Repair of Concrete (Depth greater than 5 inches)

BILL OF MATERIAL

ITEM	UNIT	QUANTITY	
Structural Repair of Concrete (Depth equal to or less than 5 inches)	Sq. Ft.	14	
Structural Repair of Concrete (Depth greater than 5 inches)	Sq. Ft.	83	

ABUTMENT REPAIRS STRUCTURE NO. 016-0286

SHEET NO.56	F.A,P. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEE NO.
	353	23 R-B-I	соок	20	14
S7 SHEETS			CONTRACT	NO. 60	J43
	ILLINOIS FED. AID PROJECT				