




STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

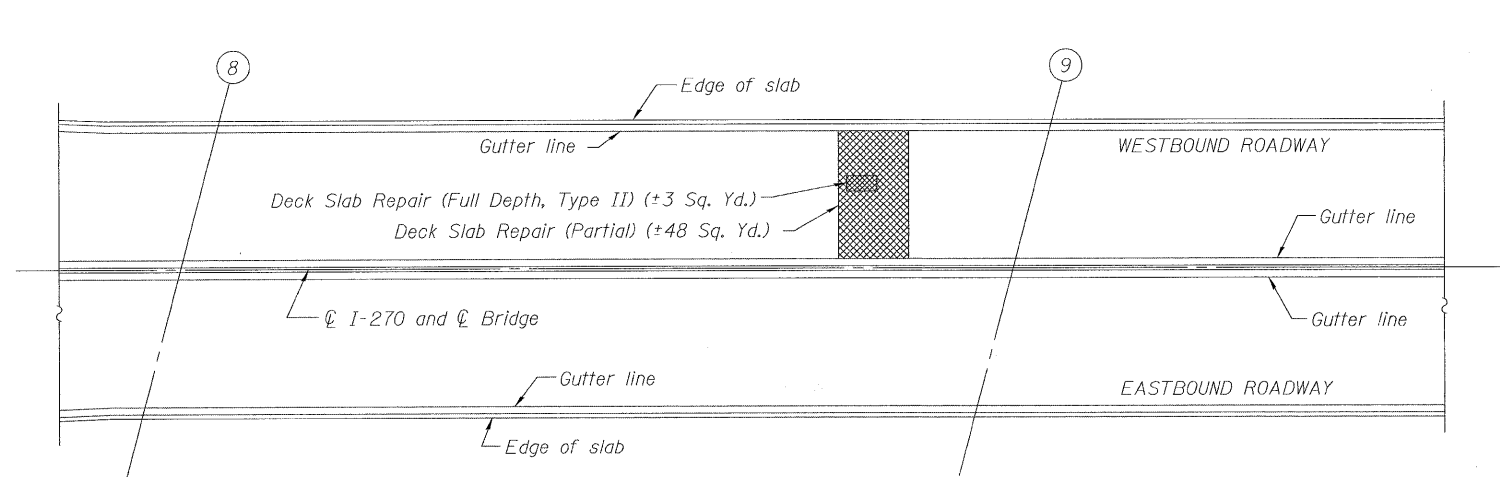


PLAN SPAN 8

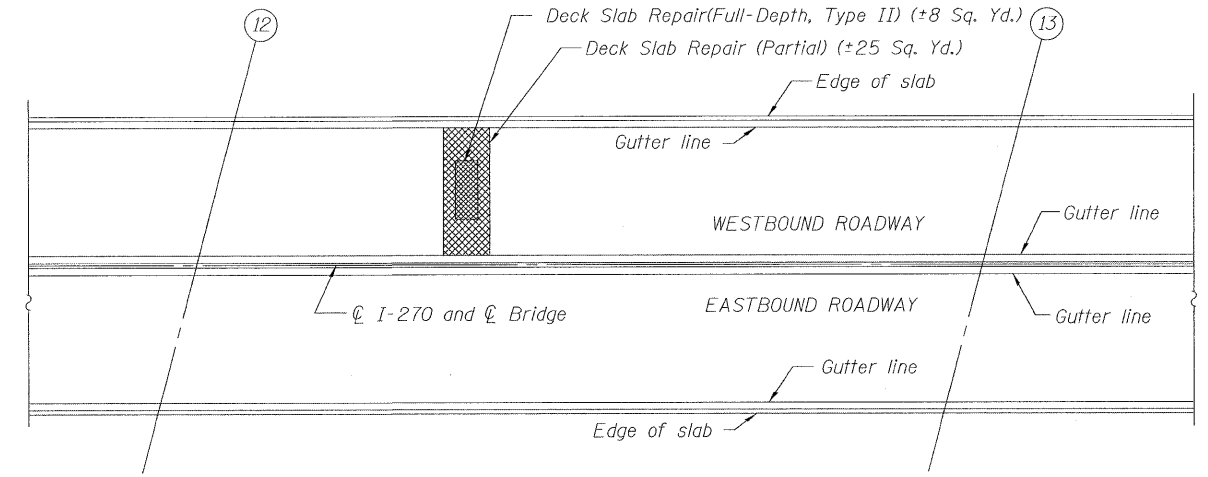


PLAN SPAN 12

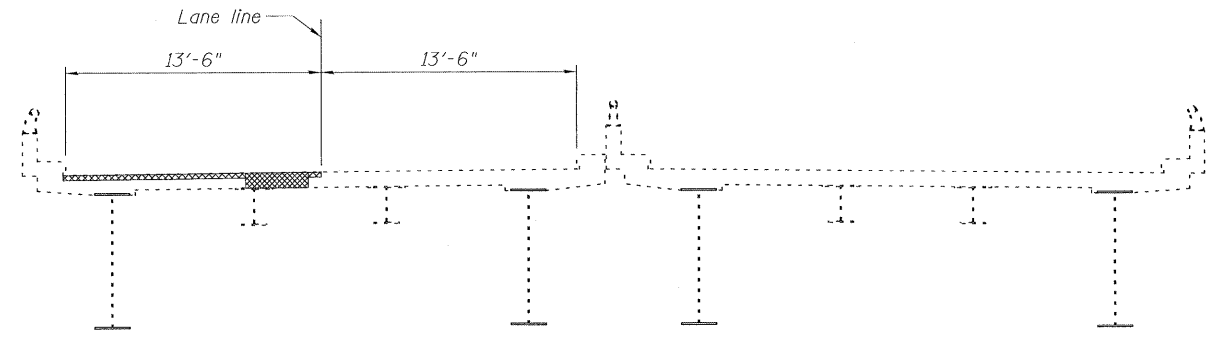


STAGE I REPAIR - SPAN 8

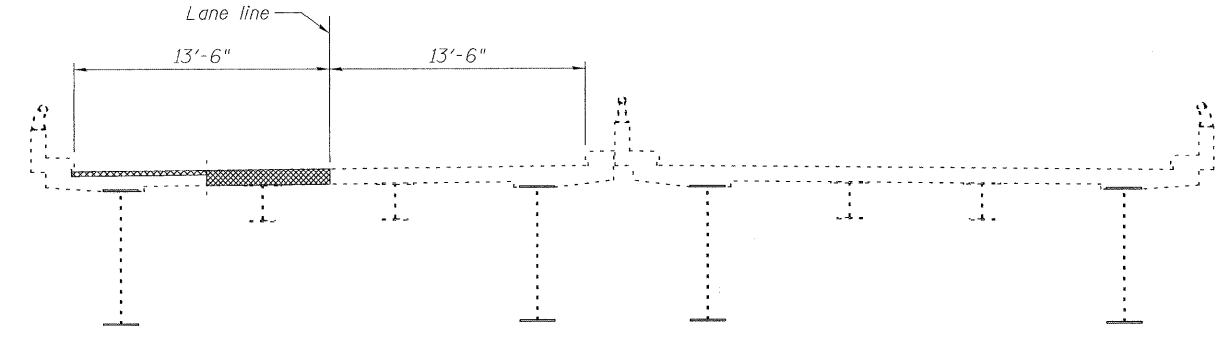

STAGE I REPAIR - SPAN 12

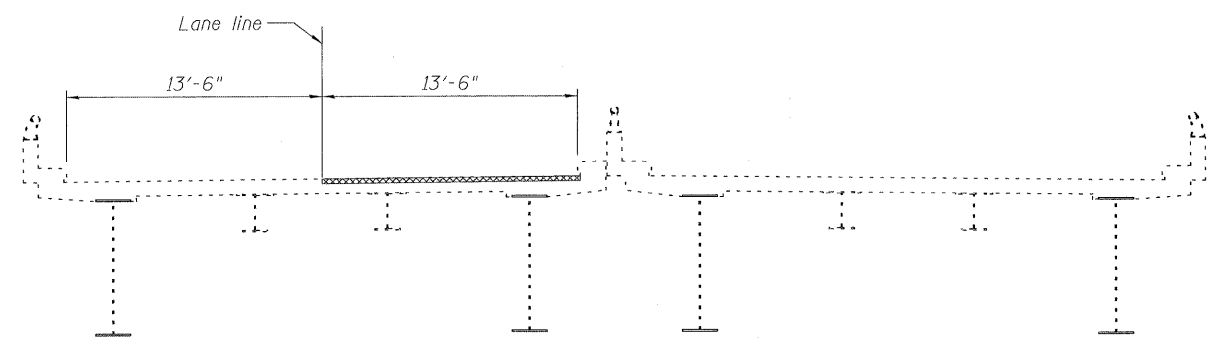

STAGE II REPAIR - SPAN 8

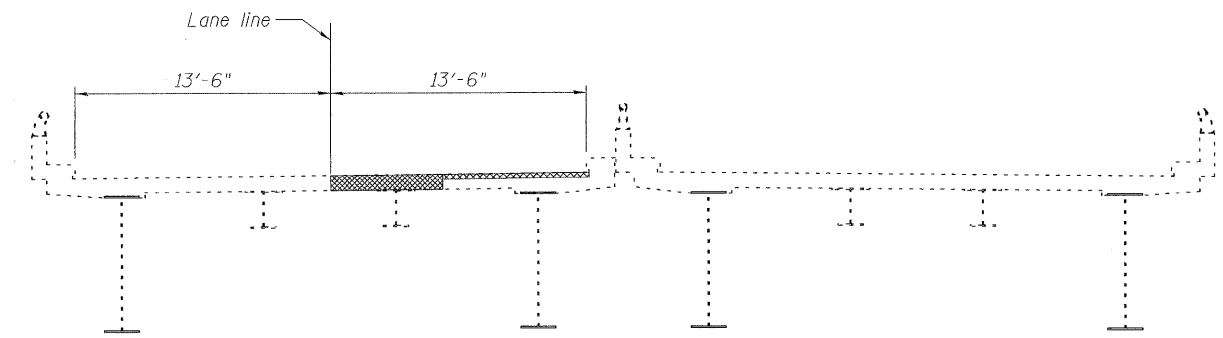

STAGE II REPAIR - SPAN 12

Notes:

The limits of the partial deck slab repair are shown for information only.

An estimated quantity is given for DECK SLAB REPAIR(FULL DEPTH, TYPE II) and DECK SLAB REPAIR (PARTIAL), the exact quantity will be measured in the field as directed by the Engineer.

BILL OF MATERIAL

Item	Unit	Total
Deck Slab Repair (Full Depth, Type II)	Sq. Yd.	11
Deck Slab Repair (Partial)	Sq. Yd.	73

CONCRETE DECK SLAB REPAIR-1
STRUCTURE NO. 060-0035

DESIGNED	TMB
CHECKED	TSB
DRAWN	JGC / TMB
CHECKED	TSB

PARSONS
400 WOODS MILL RD. SOUTH, SUITE 330
CHESTERFIELD, MO. 63017
PHONE: 314.434.2900

SHEET NO. 4 36 SHEETS	F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
	270	60B-I-8	MADISON	49	17
	CONTRACT NO. 76A92				
FED. ROAD DIST. NO. 8 ILLINOIS FED. AID PROJECT					

L:\847178-Chan of Rocks\04_Design\CADD\Sheet Files\0600035-76A92-001-DeckRepair.dgn