




STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

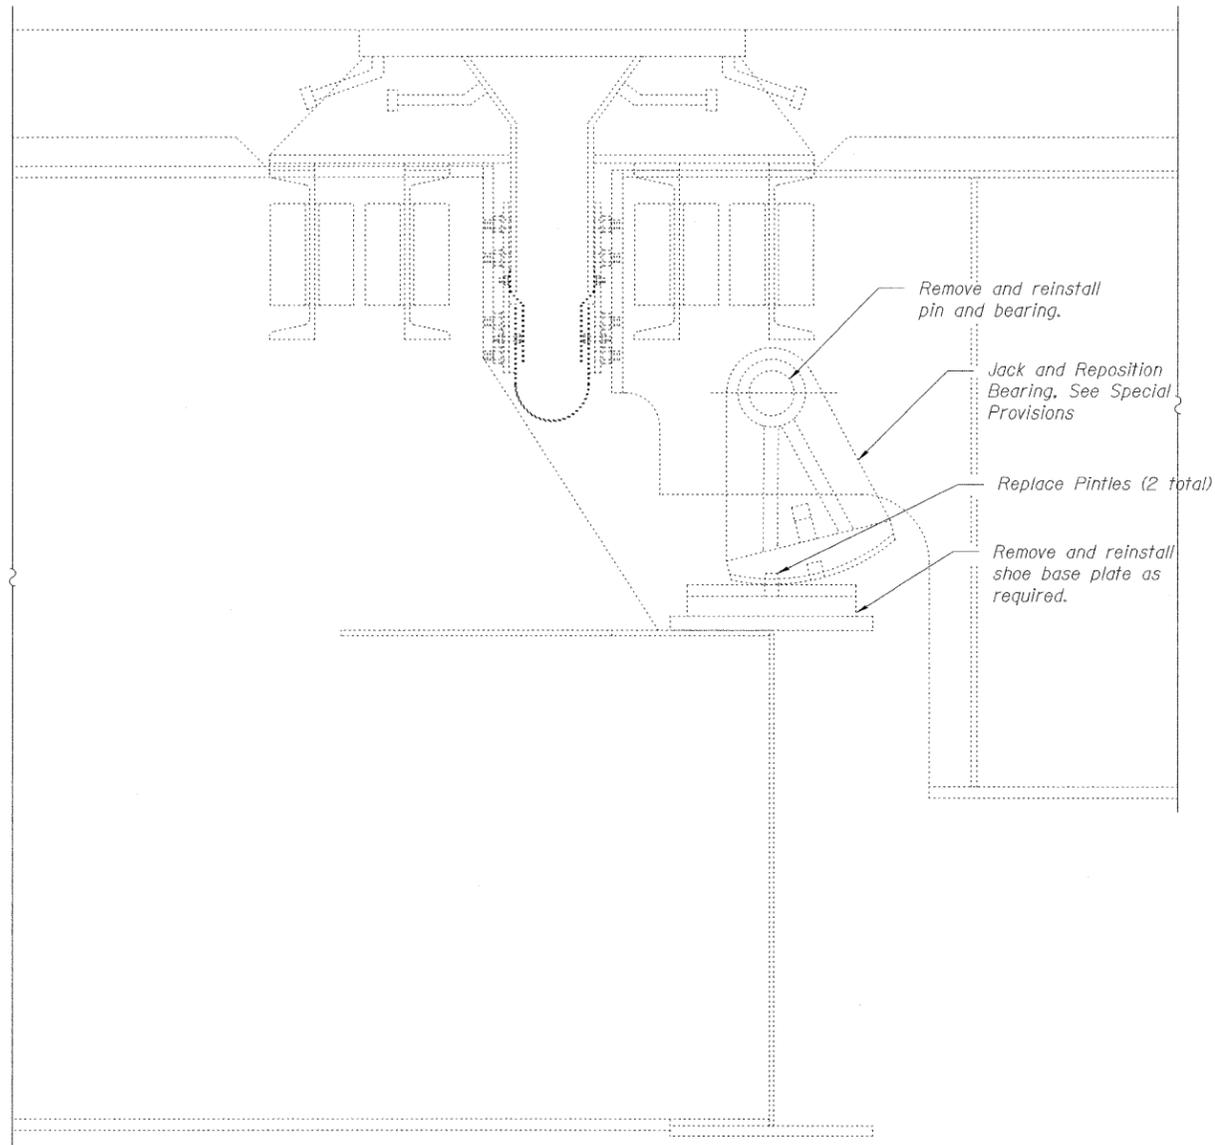


EXISTING BEARING POSITION  
GIRDER 7, NEAR PIER 28

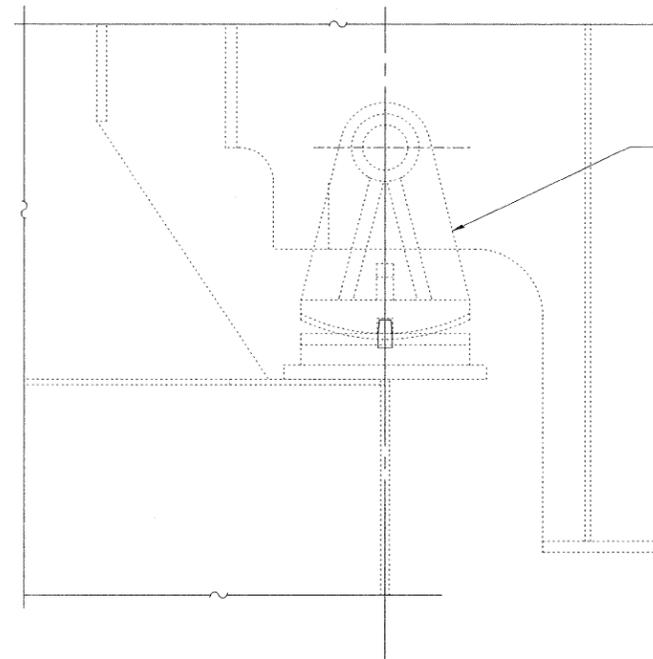


REPAIRED BEARING POSITION  
GIRDER 7, NEAR PIER 28

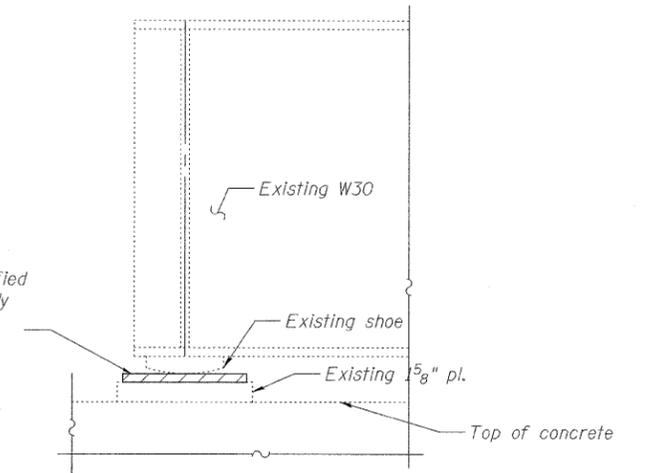

REPAIRED BEARING PLATE  
BEAM 9, PIER 43 E. BRG LINE

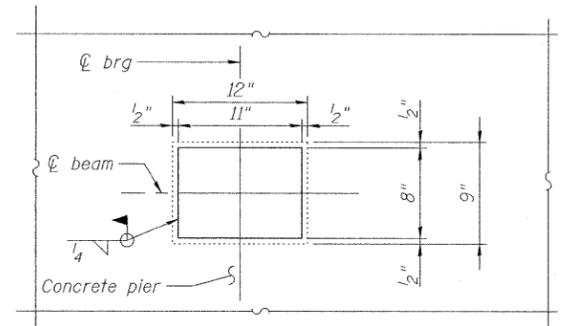

PLAN VIEW  
REPAIRED BEARING PLATE  
BEAM 9, PIER 43 E. BRG LINE

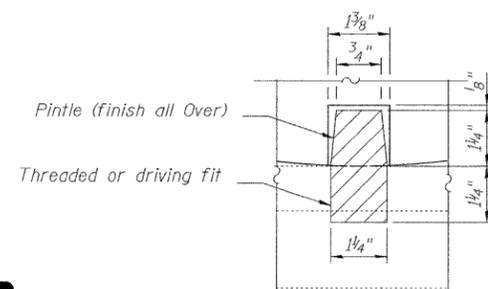

DETAIL OF PINTLE

PIER 28 BEAM REACTIONS	
Beam No.	Reaction (Kips) (DL+(LL+I))
6	110
7	110
8	110
9	110
10	110

BILL OF MATERIAL

Item	Unit	Total
Jack and Reposition Bearings	Each	1
Furnishing and Erecting Structural Steel	Pound	10

BEARING MODIFICATION  
STRUCTURE NO. 060-0035

SHEET NO.	F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
20	270	60B-I-8	MADISON	49	33
36 SHEETS			CONTRACT NO. 76A92		
FED. ROAD DIST. NO. 8   ILLINOIS   FED. AID PROJECT					

DESIGNED	TMB
CHECKED	TSB
DRAWN	JGC / TMB
CHECKED	TSB

**PARSONS**  
400 WOODS MILL RD. SOUTH, SUITE 330  
CHESTERFIELD, MO. 63017  
PHONE: 314.434.2900