

BILL OF MATERIALS
(CURTAIN WALLS)
(SEE SHT 8 OF 9)

ITEM	UNIT	QUANTITY
CONCRETE STRUCTURES	CU YD	1.4
CONCRETE REMOVAL	CU YD	1.4


NOTES:

COST OF CORING 12 VENT HOLES (3 EACH SIDE AT EACH ABUTMENT) AND SHIELDS INCLUDED WITH "STRUCTURAL REPAIR OF CONCRETE = 5".




* CLEAN EXISTING WEEP HOLE IN THE EXIST. WINGWALL TO ACCOMODATE THE 4" Ø PERFORATED PIPE DRAIN. AFTER INSTALLATION SEAL AROUND THE PIPE DRAIN. COST INCLUDED IN THE COST OF PIPE UNDERDRAINS FOR STRUCTURES 4".

EXCAVATED SOIL FOR PIPE UNDERDRAIN INSTALLATION SHALL BE PLACED ON TOP OF SLOPED GROUND INSIDE VAULT. COST INCLUDED IN " PIPE UNDERDRAIN FOR STRUCTURES 4".

** COST OF ACCESS DOOR REMOVAL AND REPLACEMENT (2 DOORS TOTAL) INCLUDED IN COST OF "CONCRETE STRUCTURES".

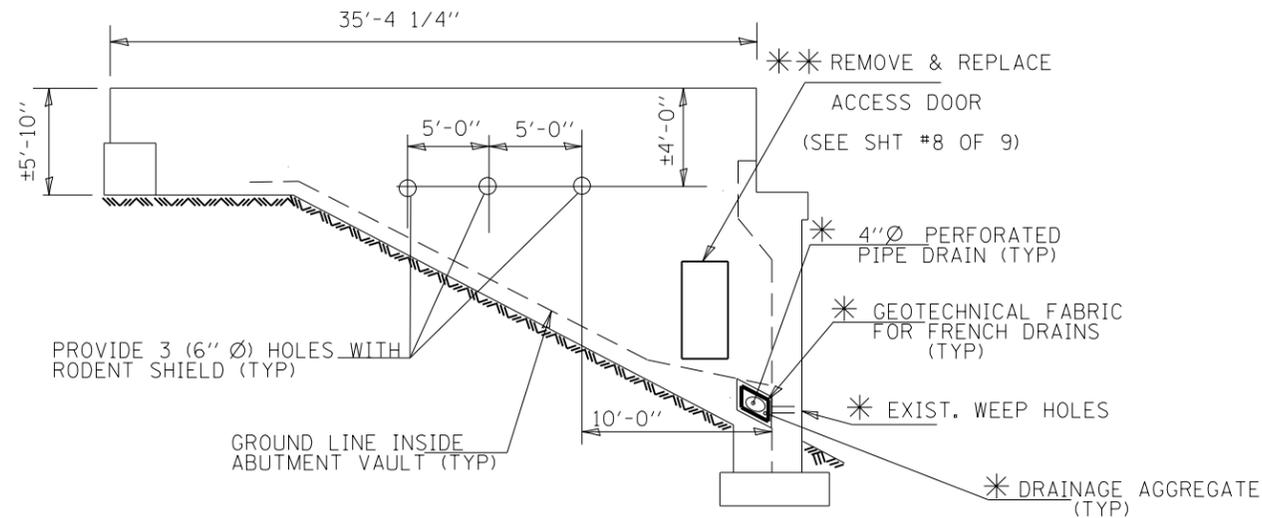

SOUTHWEST CURTAIN WALL
NORTHWEST CURTAIN WALL

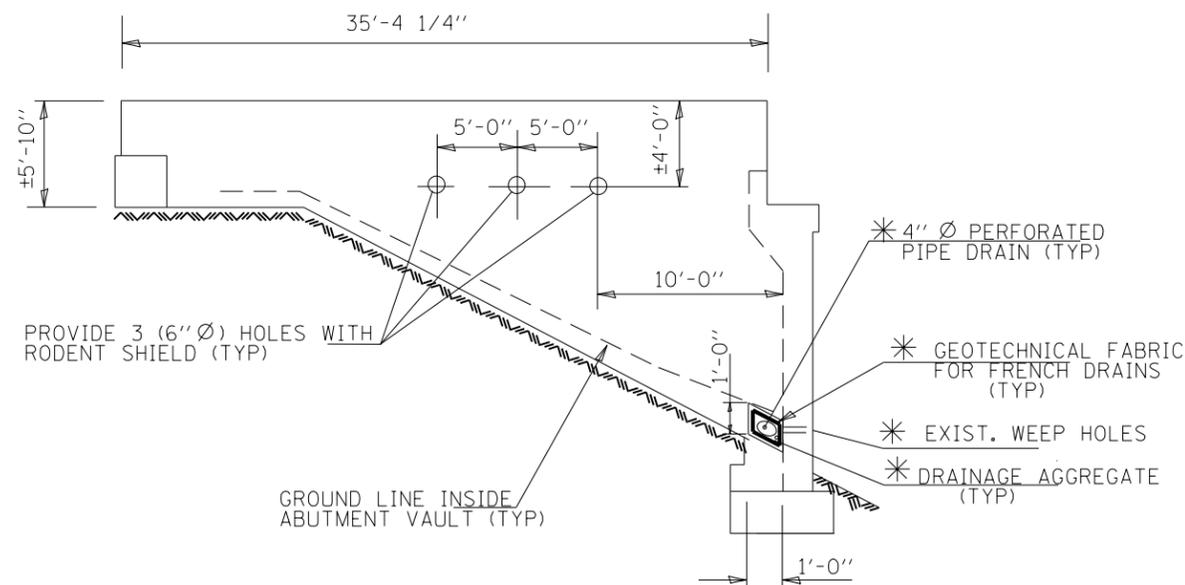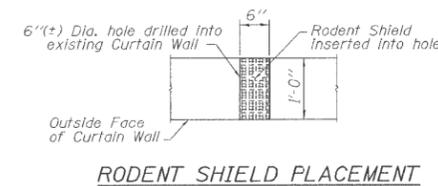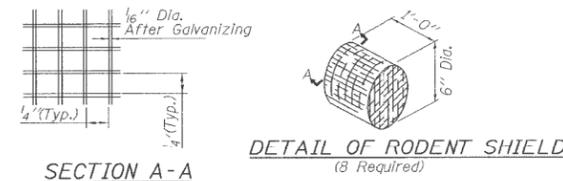

NORTHEAST CURTAIN WALL
SOUTHEAST CURTAIN WALL

* FAI 290 & FAP 342

FILE NAME =	USER NAME = gorengautab	DESIGNED -	REVISD -	STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION	LOCATION NO 2. I-290 AT BIESTERFIELD RD (SN 016-0960) CURTAIN WALL REPAIRS	F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.	
ct:\pw_work\pwidot\gorengautab\d0101671\022-0091.dgn	PLOT SCALE = 100.0000' / in.	DRAWN -	REVISD -			*	2012-026 BR		29	15	
Default	PLOT DATE = 9/13/2012	CHECKED -	REVISD -			CONTRACT NO. 60T70		ILLINOIS FED. AID PROJECT			
		DATE -	REVISD -			SCALE: _____	SHEET 4 OF 9 SHEETS	STA. _____	TO STA. _____		