
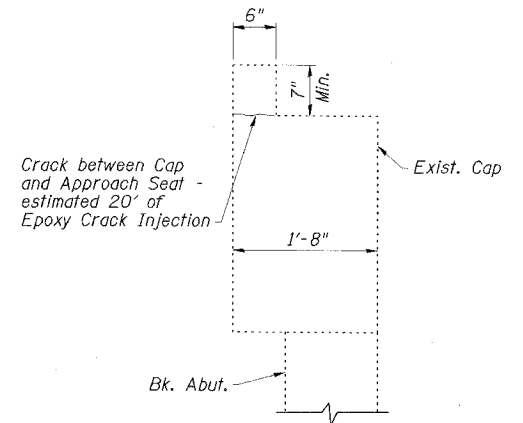


STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

ROUTE NO.	SECTION	COUNTY	SHEET	DATE	SHEET NO. 12
FAP 132	1BR-2	SALINE	114	77	16 SHEETS
FED. ROAD DIST. NO.		ILLINOIS	FED. AID PROJECT		

78010

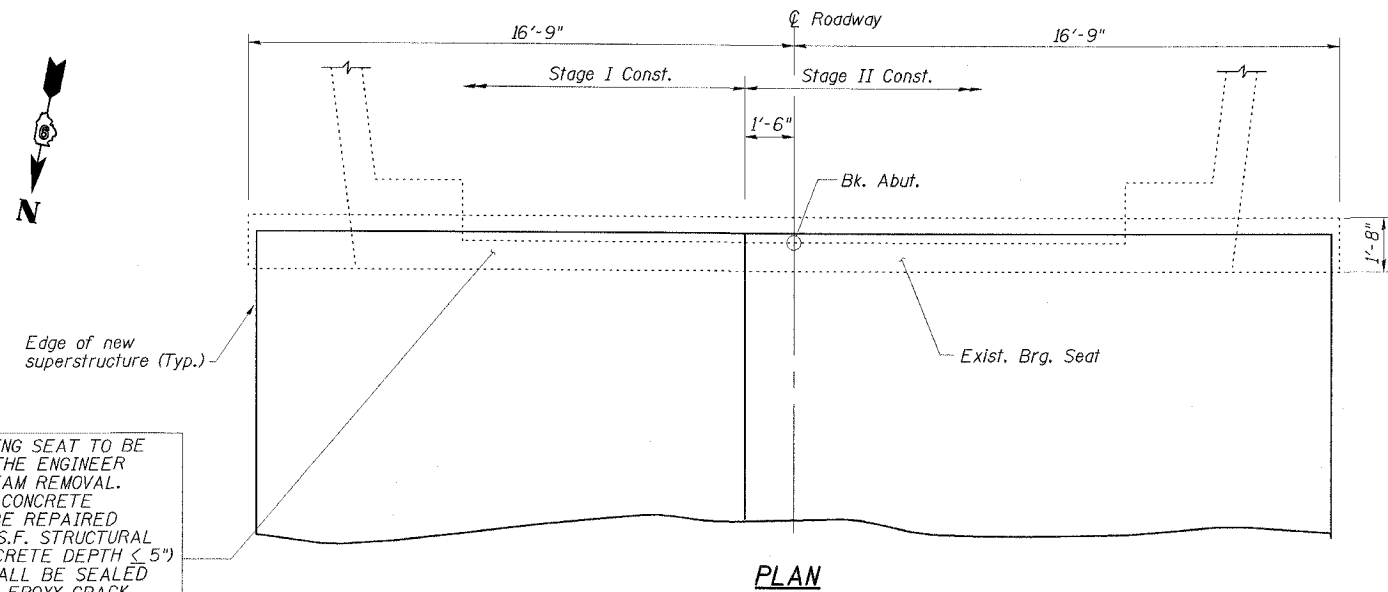


**SOUTH ABUTMENT
BILL OF MATERIAL**

Item	Unit	Quantity
Concrete Sealer	Sq. Ft.	15
Epoxy Crack Injection	Foot	51
Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	19

REPAIR LEGEND
Inspection Date: 02/01/07

- C-.6' Crack to be epoxy injected
- Delaminated or Spalled Area - Use Structural Repair of Concrete

EXISTING BEARING SEAT TO BE INSPECTED BY THE ENGINEER AFTER DECK BEAM REMOVAL. DETERIORATED CONCRETE AREAS SHALL BE REPAIRED (ESTIMATED 15 S.F. STRUCTURAL REPAIR OF CONCRETE DEPTH < 5") AND CRACKS SHALL BE SEALED (ESTIMATED 20' EPOXY CRACK INJECTION) IF FOUND. CONCRETE SEALER SHALL BE APPLIED TO STRUCTURAL REPAIR OF CONCRETE AREAS.

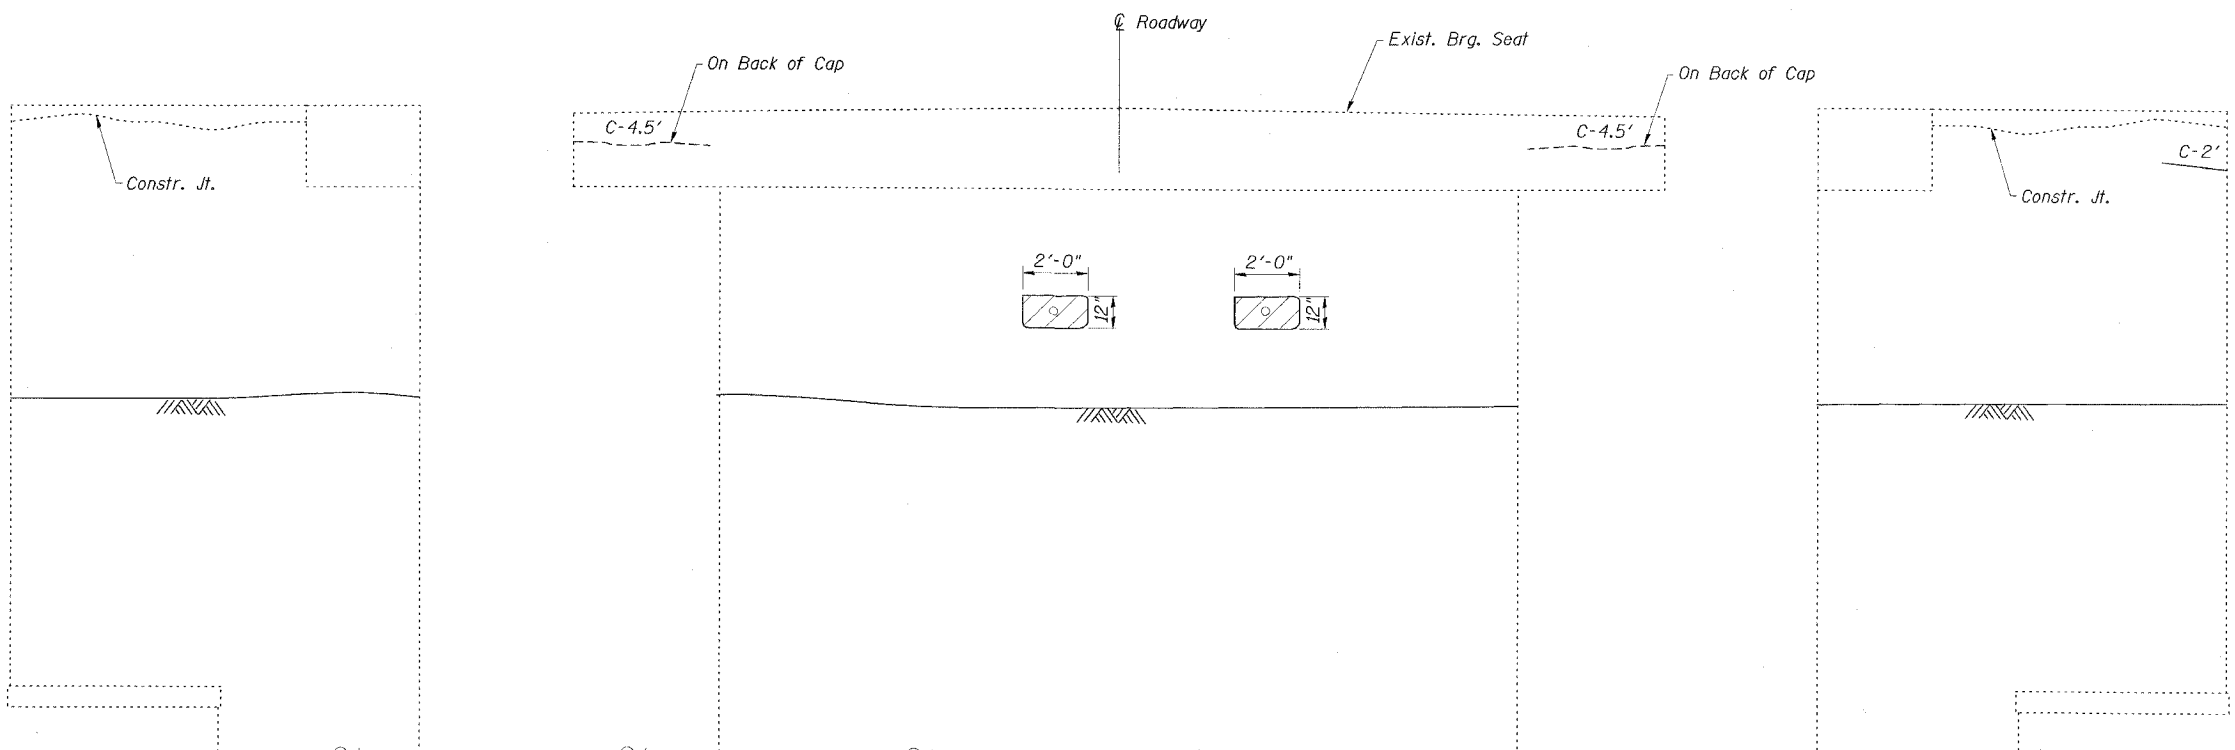

NOTE: ABUTMENT CRACK REPAIR LENGTHS AND STRUCTURAL REPAIR OF CONCRETE AREAS ARE ESTIMATED FROM 02-01-07 SURVEY WORK. ACTUAL LOCATIONS AND QUANTITIES OF REPAIRS SHALL BE SHOWN BY THE ENGINEER ON THE AS-BUILT PLANS FOR THIS SECTION.

**SOUTH ABUTMENT
IL 34/145 OVER SOUTH FORK
SALINE RIVER OVERFLOW
FAP ROUTE 132 - SECTION 1BR-3
SALINE COUNTY
STATION 244+40.00
STRUCTURE NO. 083-0020**

ESCA
CONSULTANTS, INC.

DESIGNED BY:	JMS	05/07
DRAWN BY:	HAS	05/07
CHECKED BY:	MTD	06/07
APPROVED BY:	RDP	06/07