




ELEVATION - SW ABUTMENT
Looking West

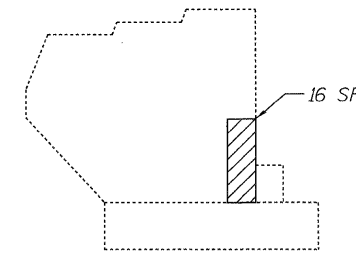

ELEVATION - SOUTH WINGWALL
Outside Face

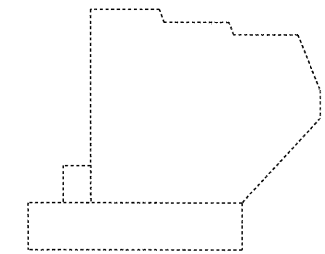


ELEVATION - NORTH WINGWALL
Outside Face

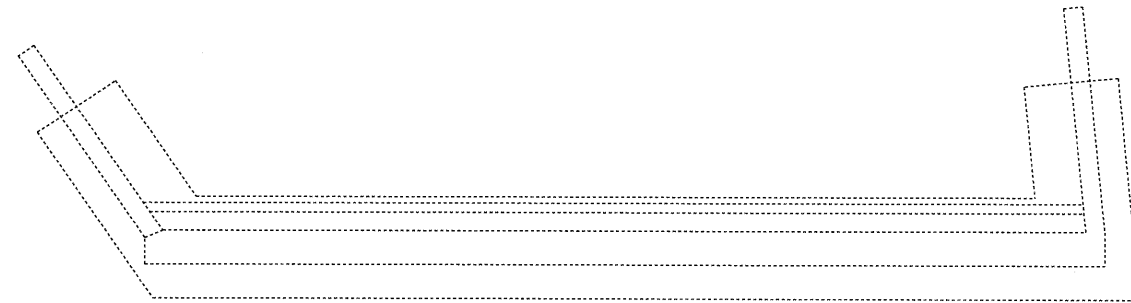


PLAN - SW ABUTMENT




SW ABUTMENT

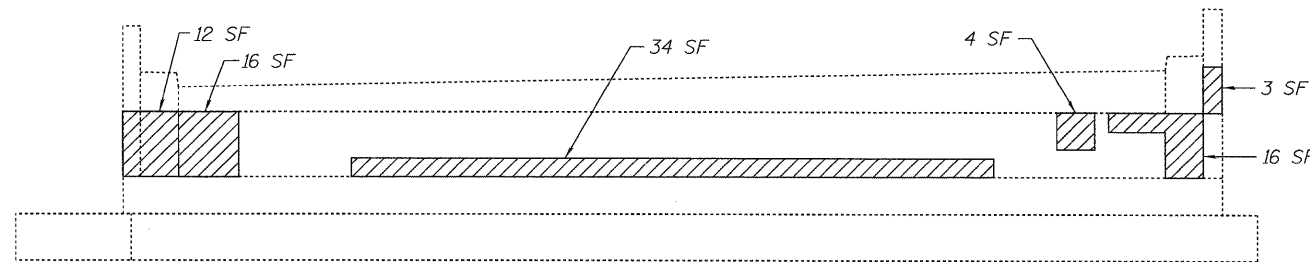


ELEVATION - SE ABUTMENT
Looking East

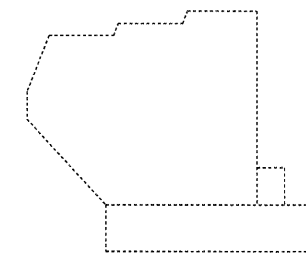

ELEVATION - NORTH WINGWALL
Outside Face

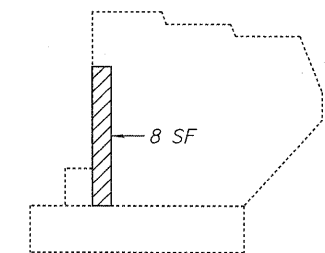

ELEVATION - SOUTH WINGWALL
Outside Face

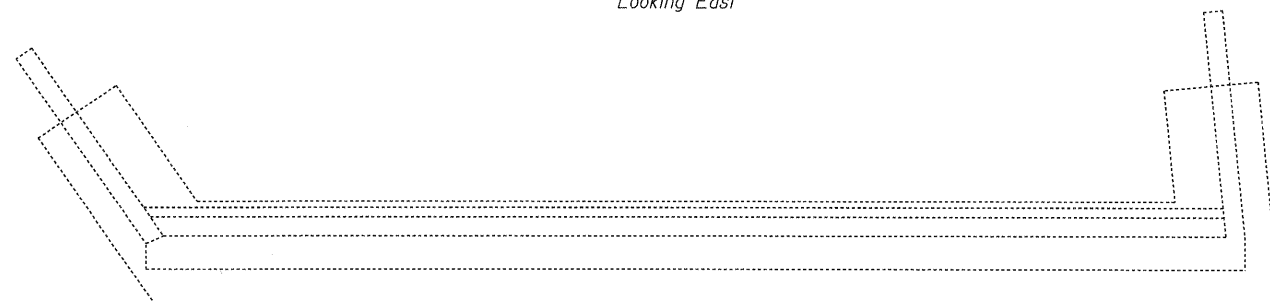

PLAN - SE ABUTMENT



SE ABUTMENT

BILL OF MATERIAL

ITEM	UNIT	TOTAL
Structural Repair Of Concrete (Depth Greater Than 5 Inches)	Sq.Ft.	22
Structural Repair Of Concrete (Depth Equal To Or Less Than 5 Inches)	Sq.Ft.	111

LEGEND:

Spalled or unsound concrete - SF indicates Square Feet.

NOTES:

1. Areas of proposed abutment repairs are estimated. Actual type, location and dimensions of abutment repairs are to be determined by the Engineer during construction.

DESIGNED - PCA	REVISED -
DRAWN - LK	REVISED -
CHECKED - MEA	REVISED -
DATE - 01/21/2011	REVISED -



STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

ABUTMENT REPAIRS
EASTBOUND FAI-80 OVER HICKORY CREEK
STRUCTURE NO. 099-0062

SHEET NO. S-4 OF 7 SHEETS

F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
80	99 (2&3) RS-3	WILL	200	167
CONTRACT NO. 60M64				
FED. ROAD DIST. NO. 1 ILLINOIS FED. AID PROJECT				