


ROUTE NO.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
VARIOUS	*	MACON	26	22

\* DISTRICT 5 BRIDGE DECK REPAIR 1984-2

**RECONSTRUCTION OF SOUTH PARAPET JOINT STA. 653+63.56**

**STRUCTURE NUMBER 058-0049**

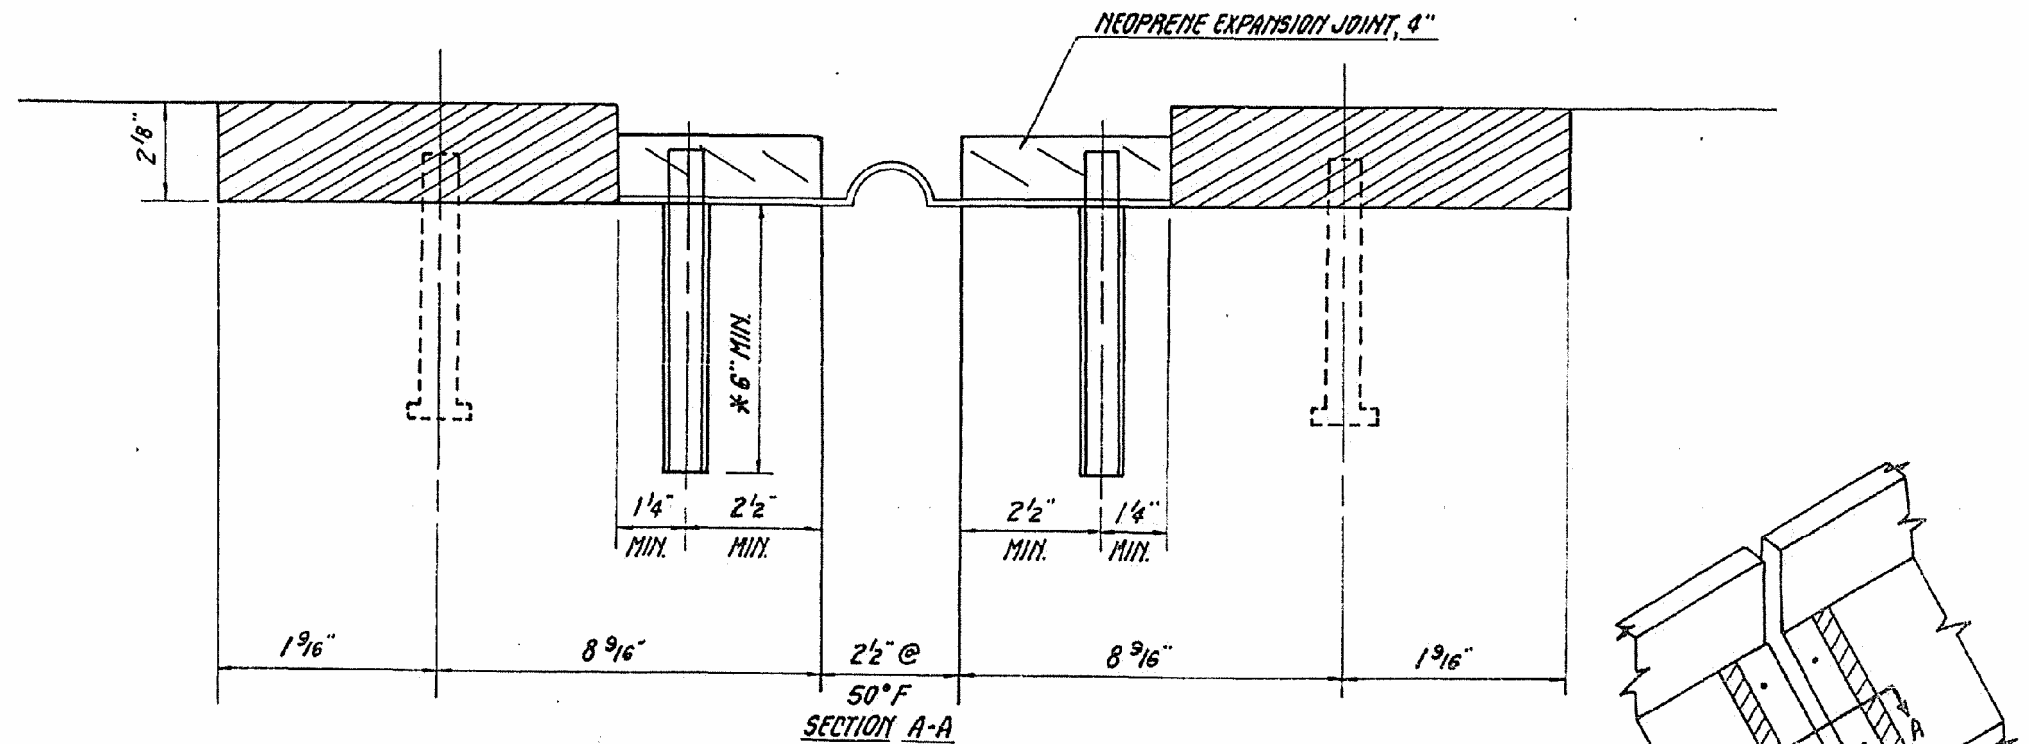

\* ANCHOR BOLTS (1/2"Ø) SHALL BE EMBEDDED A MIN. OF 6" INTO SOUND CONCRETE. DRILL HOLES FOR THREADED RODS & EPOXY GROUT RODS.

EPHOX MORTAR REPAIR IN ACCORDANCE WITH BSP-15

DRAWN BY J.G.D. 5-5-84  
CHECKED BY K.R.W. 5-84

BLANK, WESSELINK, COOK & ASSOCIATES DECATUR, ILLINOIS ENGINEERS - CONSULTANTS DESIGN FIRM NO. 184000894

FILE NAME	USER NAME	DESIGNED	REVISIONS
		PBB	
		CHECKED	
		ML0	
		CHECKED	

STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

EXISTING BRIDGE PLANS

SHEET NO. 38 OF 39 SHEETS

F.A.P. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
710	(48X-B-2)BR & (48BR)BR	MACON	144	76
CONTRACT NO. 74438				

ILLINOIS FED. AID PROJECT