


STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

ROUTE NO.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
FAI 80	06-8HBR	BUREAU	105	110
FED. ROAD DIST. NO. 7		ILLINOIS	FED. AID PROJECT	

Contract # 66641


STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

PROJECT NO.	DATE	COUNTY	SCALE	SHEET NO.
100-1-100	11/11/85	BUREAU	3/8"	10
FED. ROAD DIST. NO. 7		ILLINOIS	FED. AID PROJECT	

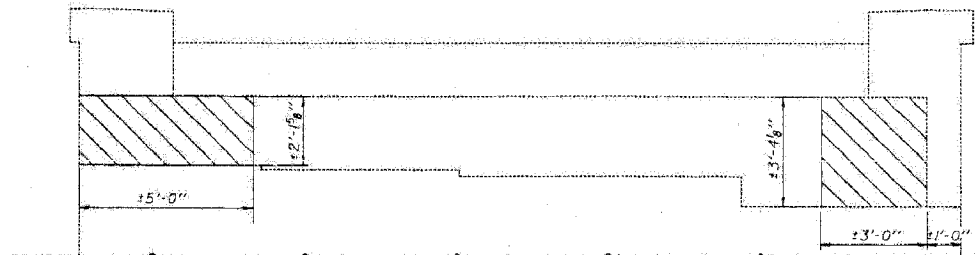


**ELEVATION**

North Abutment Looking North East Structure

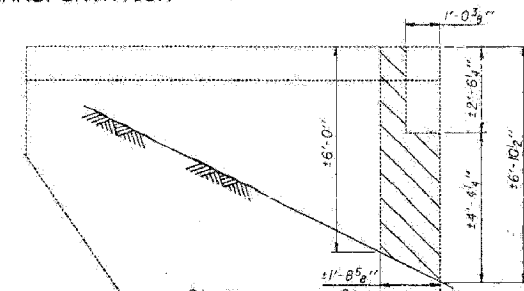


**N. Abut. W. Wing - East Structure**

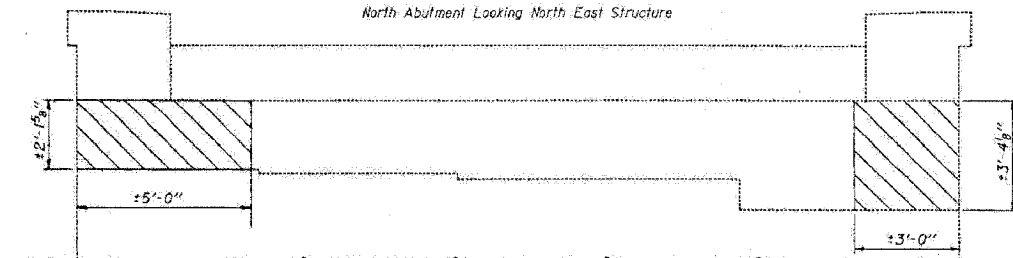


**ELEVATION**


South Abutment Looking South West Structure

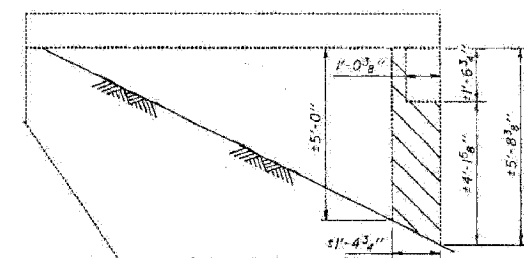

**S. Abut. E. Wing - East Structure**

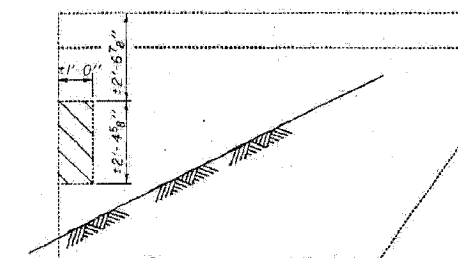


**S. Abut. W. Wing - East Structure**

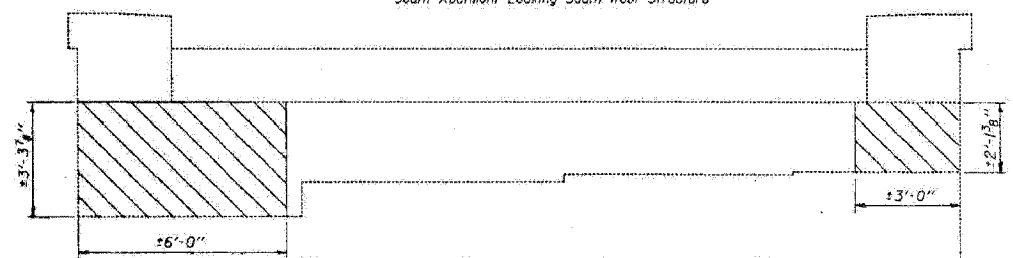


**ELEVATION**

South Abutment Looking South East Structure

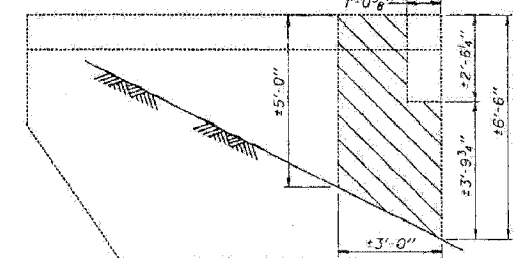

**S. Abut. E. Wing - West Structure**

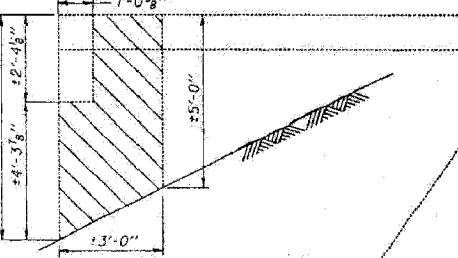


**S. Abut. W. Wing - West Structure**

DESIGNED <i>Mary Blaxdorf</i>	EXAMINED <i>[Signature]</i>
CHECKED <i>[Signature]</i>	PASSED <i>[Signature]</i>
DRAWN <i>[Signature]</i>	APPROVED <i>[Signature]</i>
CHECKED <i>[Signature]</i>	

**ELEVATION**  
North Abutment Looking North West Structure

Note: Existing reinforcement having 10% or more of Cross Sectional Area lost due to corrosion or damaged during concrete removal shall be lapped with new reinforcement bar as shown. Cost is incidental to "Repair Concrete Structures".

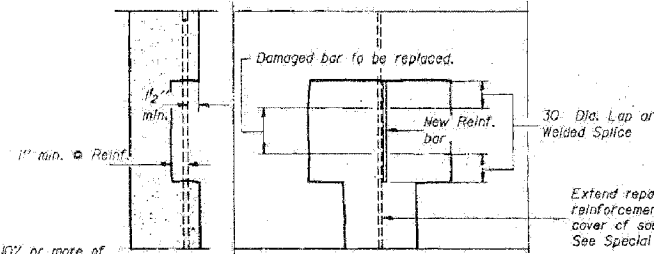

**CONCRETE REPAIR DETAIL**

**BILL OF MATERIAL**

Item	Unit	Quantity
Repair Concrete Structures	Sq. Ft.	130

Note: Hatched areas indicate "Repair Concrete Structures".

**ABUTMENT REPAIRS**  
F.A.I. RTE. 80 SEC. (06-8HBR)  
BUREAU COUNTY  
STA. 312+11.90

EXISTING PLANS - 1985  
IL ROUTE 89 OVER  
FAI ROUTE 80 (I-80)  
SECTION 06-8HBR  
BUREAU COUNTY  
STATION 3702+69.82  
STRUCTURE NO. 006-0178

FOR INFORMATION ONLY

PLOT DATE = 6/12/2007  
FILE NAME = G:\PROJECT\2864881\_002\CADD\LB\115185\_06.dgn  
PLOT SCALE = N/A  
USER NAME = zhangb

