

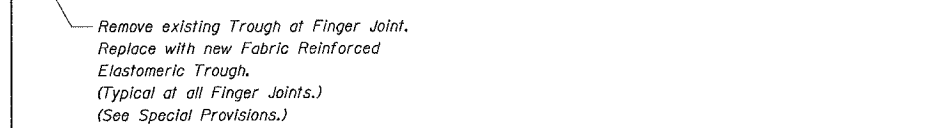


F.A.I. SECTION COUNTY TOTAL SHEET SHEET NO.	-180 (06-3.78-1)BM-1	ILLINOIS	15	11
STA. TO STA.				
FED. ROAD DIST. NO.	ILLINOIS	FED. AID PROJECT	Putnam Counties	

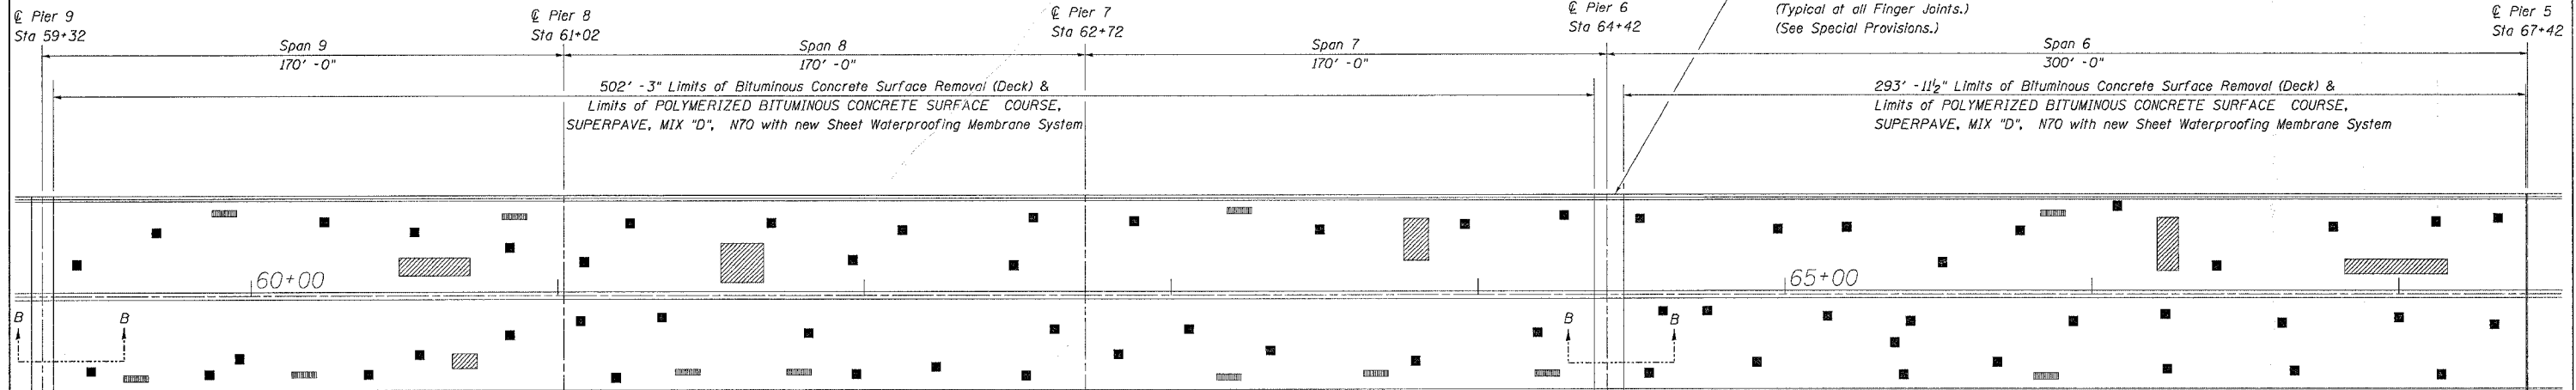

- Legend
- Deck Slab Repair (Partial)
 - ▨ Deck Slab Repair (Full Depth - Type I)
 - ▩ Deck Slab Repair (Full Depth - Type II)

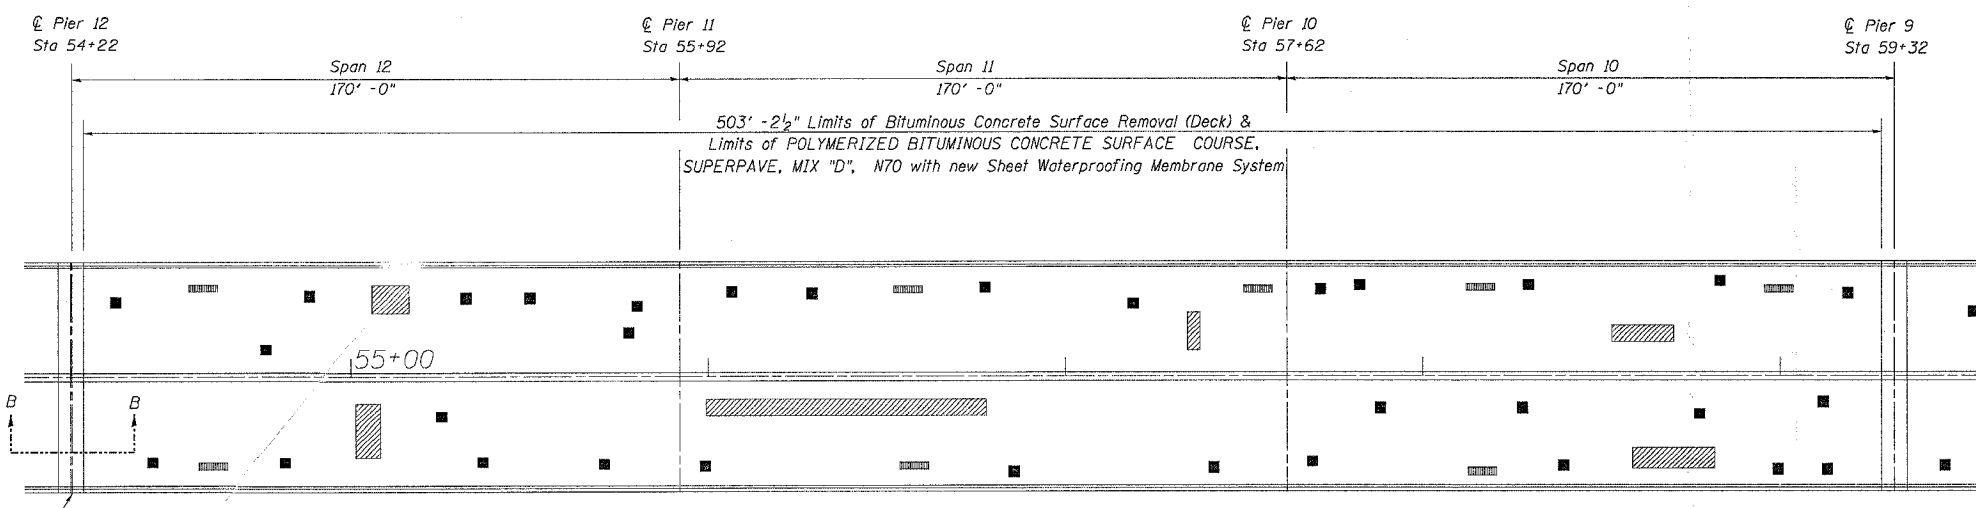

Bill of Material

Item	Unit	Quantity
Bituminous Concrete Surface Removal (Deck)	Sq. Yd.	19935
Sheet Waterproofing Membrane System	Sq. Yd.	19935
POLYMERIZED BITUMINOUS CONCRETE SURFACE COURSE, SUPERPAVE, MIX "D", N70	Ton	2671
Deck Slab Repair (Partial)	Sq. Yd.	300
Deck Slab Repair (Full Depth - Type I)	Sq. Yd.	100
Deck Slab Repair (Full Depth - Type II)	Sq. Yd.	100

Date of Deck Survey: 4/22/2005

Note: The plan quantities for Deck Slab Repair (Partial and Full Depth) are estimated quantities. The areas shown on the deck repair plans are potential areas of Deck Slab Repair. The Deck Slab Repair quantities in the Bill of Materials are included as contingencies to be used as directed by the engineer during construction. The actual locations and quantity of Deck Slab Repair on all structures shall be determined by the Resident Engineer in the field after removal of the existing wearing surface. Actual repair locations shall be shown on the same as-built plans.

Deck Plan - Spans 6-15
 FAI 180 (I-180)
 Section (06-3.78-1)BM-1
 Bureau & Putnam Counties
 Structure No. 078-0001

PLOT DATE = Mon, Dec 19, 2005 13:41:13
 FILE NAME = D:\SRV\p1\m1\0780001\0780001.dgn
 PLOT SCALE = 50.0000 / IN.
 REFERENCE = SHEET#