


EXISTING SECTION AT SOUTH ABUTMENT

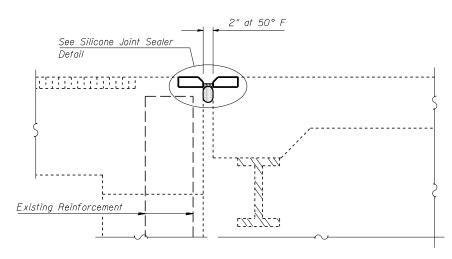


<u>PROPOSED SECTION</u> AT SOUTH ABUTMENT

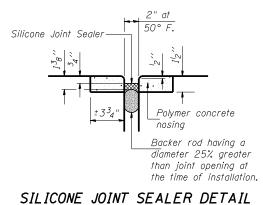

JOINT REPAIR AT SOUTH ABUTMENT S.N. 020-0005

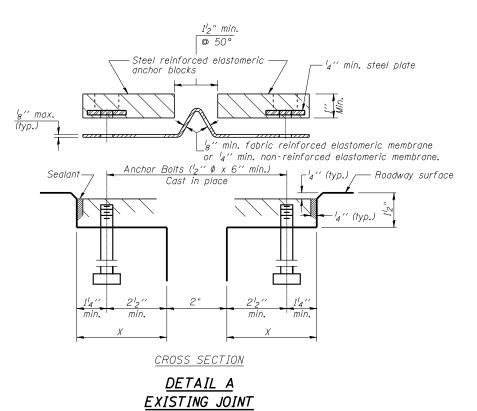


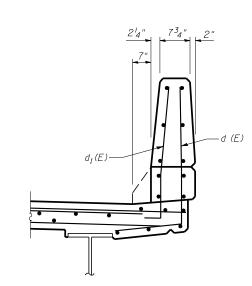

EXISTING SECTION THRU PARAPET

CONTRACT NO. 70593

SHEET 7 OF 8

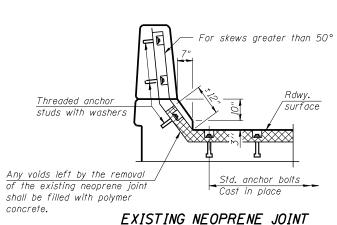

AT PARAPET

BILL OF MATERIALS

Item	Unit	Total
Polymer Concrete	Cu. Ft.	3.4
Silicone Joint Sealer, 2"	Foot	45.4

Notes:

Remove existing neoprene expansion joint leaving existing anchor bolts, replace with Silicone Joint Sealer and Polymer Concrete.

Removal of the existing anchor blocks and neoprene membrane is included in the cost of Polymer Concrete.

Note

For proposed end of seal treatment at abutment, see sheet 8 of 8.

ILLINOIS DEPARTMENT OF TRANSPORTATION

JOINT REPAIR AT SOUTH ABUTMENT

F.A.P. ROUTE 322
SECTION (52BR-1 & 53R-B)BJR
DEWITT COUNTY

S.N. 020-0005

SCALE: NA DATE: 11/08/06 DRAWN BY: JRP CHECKED BY: