




STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

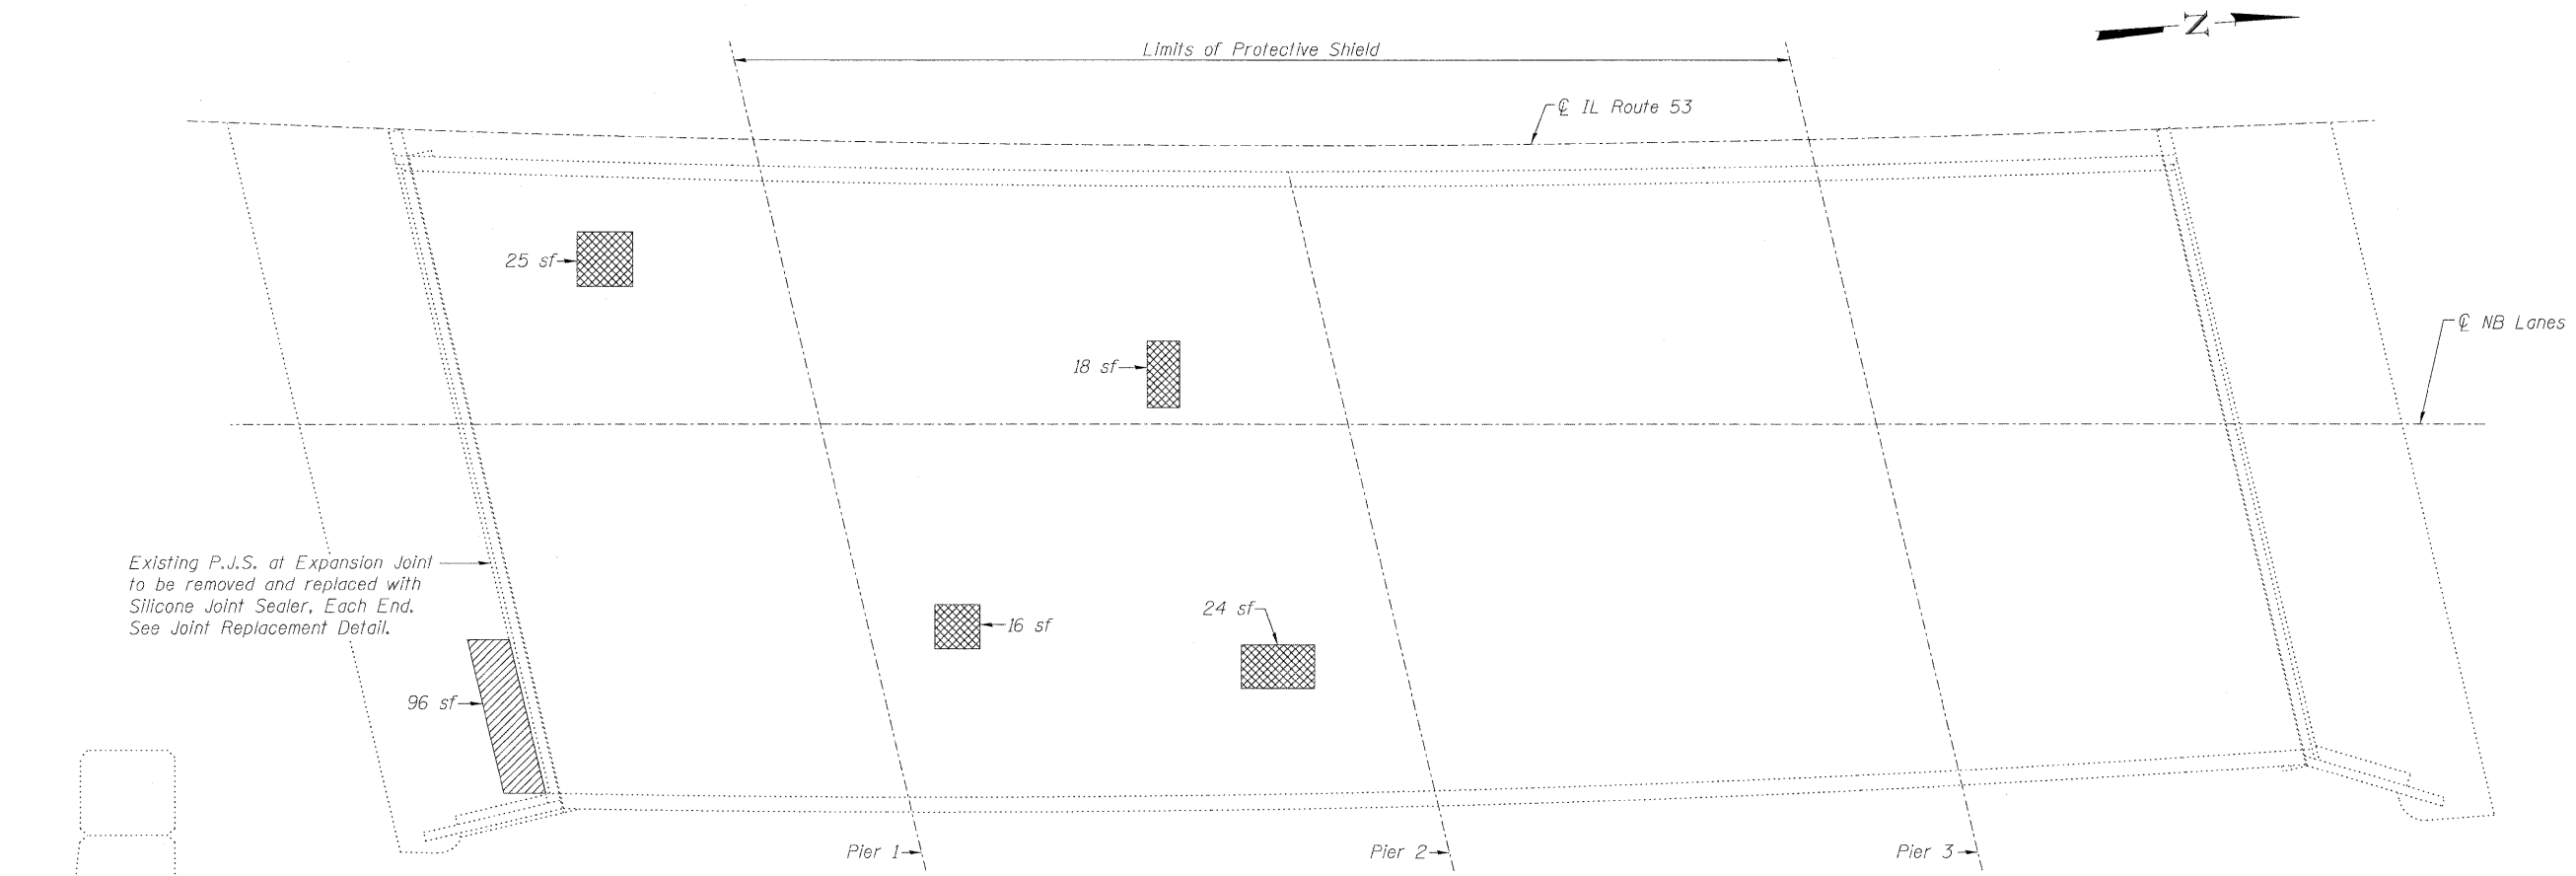

PLAN

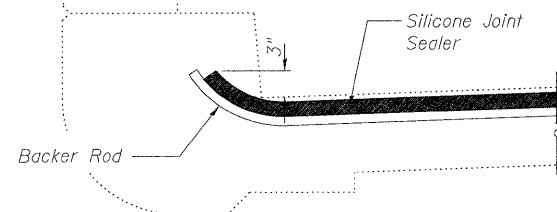

END OF SEAL TREATMENT

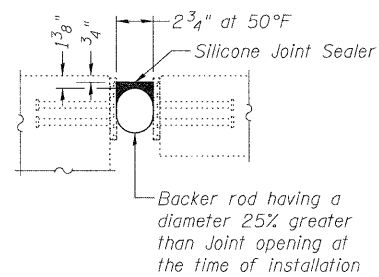

JOINT REPLACEMENT DETAIL
Dimensions at Rt L's to the Joint

BILL OF MATERIAL

Item	Unit	Total
Protective Shield	Sq. Yd.	927
Approach Slab Repair (Partial Depth)	Sq. Yd.	12.3
Deck Slab Repair (Full Depth, Type II)	Sq. Yd.	10.6
Silicone Joint Sealer, 3"	Foot	145

Note:
Contractor shall verify that the type of concrete selected shall achieve required strength within the time allotted for construction. See Special Provisions, Deck Slab Repair (Special).

DECK SLAB REPAIR
STRUCTURE NO. 016-0373

LEGEND

- Deck Slab Repair (Full Depth, Type II)
- Approach Slab Repair (Partial Depth)
- sf Square Feet

Lin Engineering, Ltd.
Consulting Engineers
Chatham, Illinois

Designed By: KKH Checked By: MTH Drawn By: KKH
Date: 12/2/03 File: 016-0373.dgn

SHEET NO. 2
7 SHEETS

F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
290	(531-3.1,0305-302)RS-5	COOK	314	170
FED. ROAD DIST. NO. - ILLINOIS			CONTRACT NO. 60138	
FED. AID PROJECT				