


EAST FACE ELEVATION (Looking West)

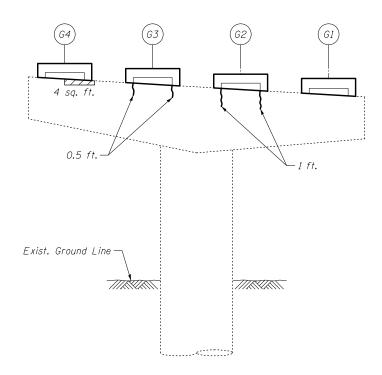

WEST FACE ELEVATION

(Looking East)

NOTES:

1. Actual quantities of repairs shall be approved by the Engineer.

<u>LEGEND</u>

Structural Repair of Concrete (Depth equal to or less than 5 inches)

— Epoxy Crack Injection

BILL OF MATERIAL

ITEM	UNIT	QUANTITY
Structural Repair of Concrete (Depth equal to or less than 5 inches)	Sq. Ft.	4
Epoxy Crack Injection	Foot	5
Jack and Remove Existing Bearings	Each	4

BOWMAN, BARRETT & ASSOCIATES INC.
CONSULTING ENGINEERS
Chicago, Illinois
312.228.0100
www.bbandainc.com

USER NAME =	DESIGNED - TL	REVISED -
	CHECKED - BAK	REVISED -
PLOT SCALE =	DRAWN - MTR	REVISED -
PLOT DATE = 11/08/2012	CHECKED - TL	REVISED -

PIER 11 REPAIR DETAILS	F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
STRUCTURE NO. 016-2437	94	2012-060-BR	соок	285	222
			CONTRACT	NO. F	60V61
SHEET NO. S-59 OF S-83 SHEETS		ILLINOIS FED. A	D PROJECT		