

BITUMINOUS PAVEMENT REMOVAL AND REPLACEMENT

(ITEM AR401910)


BITUMINOUS/BITUMINOUS SEAL

3/8" ± 1/8"

EXISTING BITUMINOUS PAVEMENT OR

STAGE 2A OVERLAY


- 1-1/2" ± 1/8"

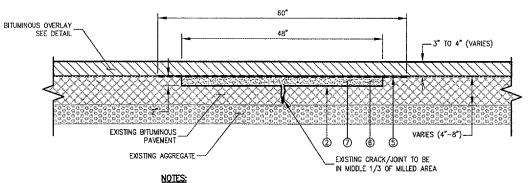


1. TACK COAT ALL VERTICAL FACES.

2. MILLING AND BITUMINOUS SAND MIX QUANTITIES BASED ON 52" WIDTH.

TYPICAL SECTION - PARTIAL DEPTH BITUMINOUS CRACK REPAIR AND PATCH

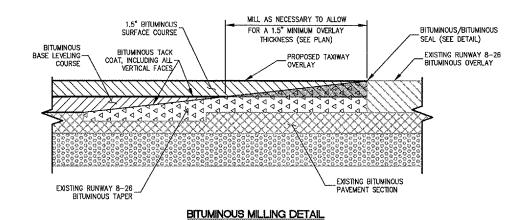

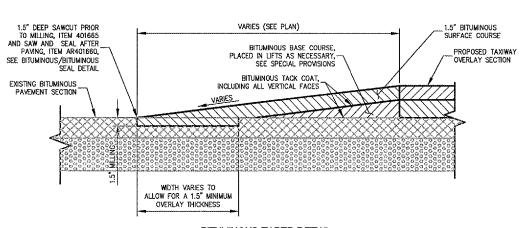

BITUMINOUS TAPER DETAIL

DETAILS SHOWN ARE NOT TO SCALE



815 Commerce Drive Suite 200 Oak Brook, Illinois 60523 Telephone: 630.990.3800 Fax: 630.990.3801




CITY OF DIXON, ILLINOIS

Post Office Box 386 Dixon, Illinois 61021 Telephone: 815.288.1485

DIXON MUNICIPAL AIRPORT CHARLES R. WALGREEN FIELD

REPAIR AND OVERLAY PORTIONS OF RUNWAY 12-30

AIP PROJECT NO. 3-17-0036-B10 IDA PROJECT NO. C73-3686

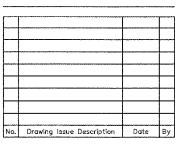

APRIL 20, 2007

Sheet Title

TYPICAL SECTIONS AND PAVEMENT DETAILS

| 843-061 | 38013 |
|---------------|----------|
| Project Numbe | |
| LDH | 09/14/06 |
| Layout By | Date |
| LDH | 09/14/06 |
| Dealgned By | Date |
| RMH | 04/20/07 |
| Reviewed By | Date |

LDH |---|---