


**EAST ABUTMENT ELEVATION**

Looking East

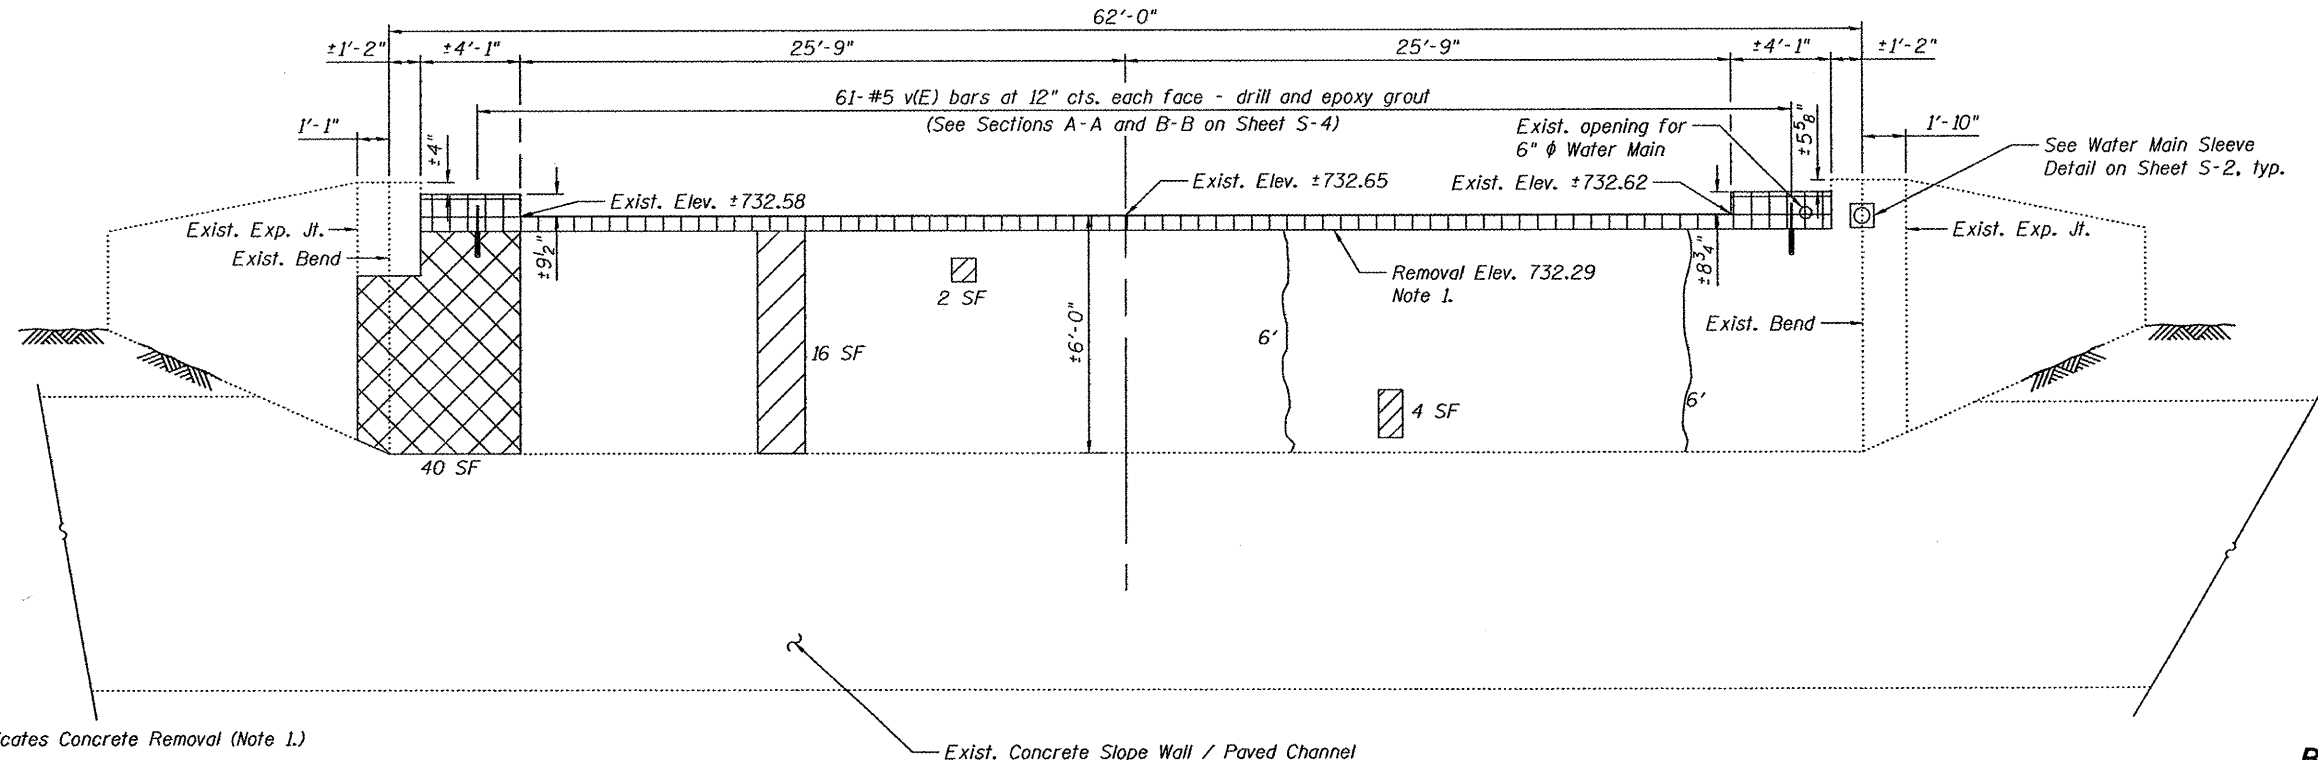

**WEST ABUTMENT ELEVATION**

Looking West


- Indicates Concrete Removal (Note 1.)
- Indicates Structural Repair of Concrete (Depth Greater than 5")
- Indicates Structural Repair of Concrete (Depth Less than or equal to 5")
- Indicates Epoxy Crack Injection

**BILL OF MATERIAL**

Item	Unit	Quantity
Epoxy Crack Injection	Foot	24
Structural Repair of Concrete (Depth Less than or equal to 5")	Sq. Ft.	40
Structural Repair of Concrete (Depth Greater than 5")	Sq. Ft.	75

Notes:  
 1. Concrete removal shall conform to the applicable portions of Section 501 of the Standard Specifications. Cost included with Removal of Existing Superstructures.

COMPANY NAME: HRGreen  
 PROJECT CONTACT: K. Wood  
 CITY: Rockford  
 DATE PLOTTED: 3/23/2012 11:00:00 AM  
 FILE NAME: 86110071-abut.dgn  
 PLOT DRIVER: pdfplot  
 PEN TABLE: standard-trans.tbl

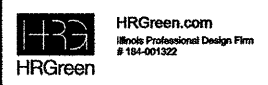

USER NAME = wood	DESIGNED - KMA	REVISED -
	CHECKED - WJH	REVISED -
PLOT SCALE =	DRAWN - RGD	REVISED -
PLOT DATE = 3/23/2012	CHECKED - 3/26/12	REVISED -

**CITY OF ROCKFORD**

**PIERCE AVENUE OVER NORTHWEST DRAINAGEWAY  
 ABUTMENT REPAIR DETAILS**

F.A. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
5033	11-00581-00-BR	WINNEBAGO	17	15
CONTRACT NO.				
ILLINOIS FED. AID PROJECT				

SHEET NO. 5-8 OF 5-8 SHEETS