




EXISTING TYPICAL SECTION
 STA. 280+71 TO STA. 283+89 NO CURB ON LEFT STA. 332+51 TO STA. 334+27
 STA. 283+90 TO STA. 310+36 STA. 335+75 TO STA. 338+47
 STA. 323+18 TO STA. 325+30 NO CURB ON RIGHT STA. 338+48 TO STA. 341+87 NO CURB ON RIGHT
 STA. 325+31 TO STA. 330+91

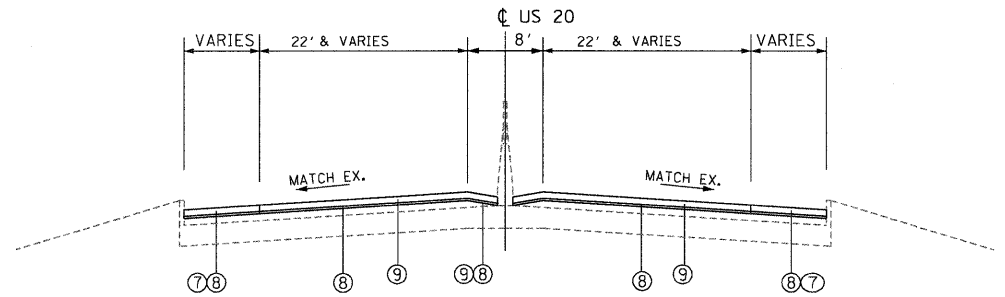


PROPOSED TYPICAL SECTION
 STA. 280+71 TO STA. 283+89 NO CURB ON LEFT STA. 332+51 TO STA. 334+27
 STA. 283+90 TO STA. 310+36 STA. 335+75 TO STA. 338+47
 STA. 323+18 TO STA. 325+30 NO CURB ON RIGHT STA. 338+48 TO STA. 341+87 NO CURB ON RIGHT
 STA. 325+31 TO STA. 330+91

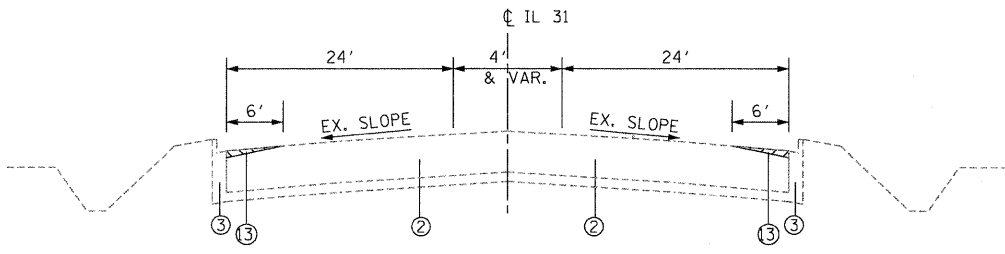


EXISTING TYPICAL SECTION
 STA. 99+00 TO STA. 100+70
 STA. 100+99 TO STA. 102+34
 STA. 102+62 TO STA. 103+65

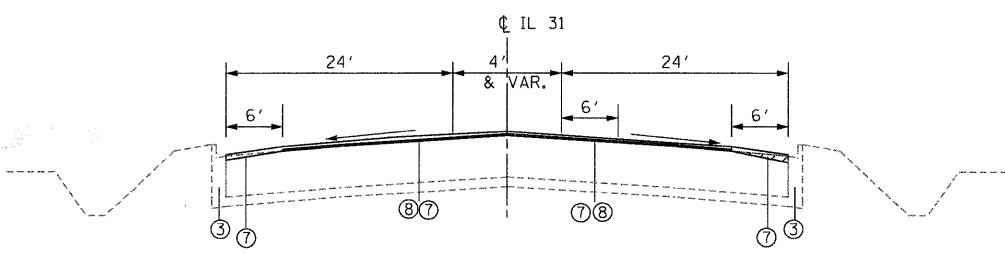


PROPOSED TYPICAL SECTION
 STA. 99+00 TO STA. 100+70
 STA. 100+99 TO STA. 102+34
 STA. 102+62 TO STA. 103+65

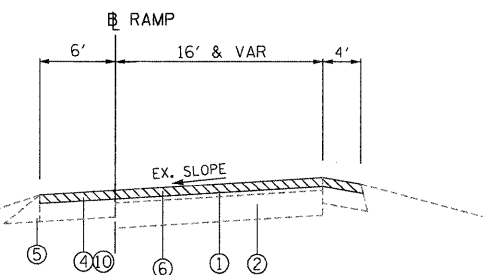


EXISTING TYPICAL SECTION
 US 20 AT RANDALL RD
 RAMP A, B, C & D

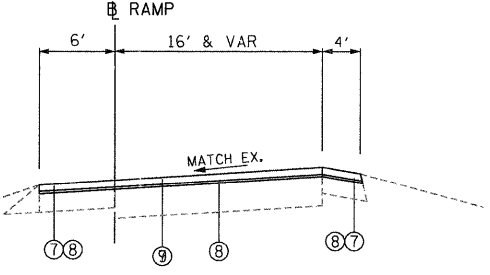

PROPOSED TYPICAL SECTION
 US 20 AT RANDALL RD
 RAMP A, B, C & D

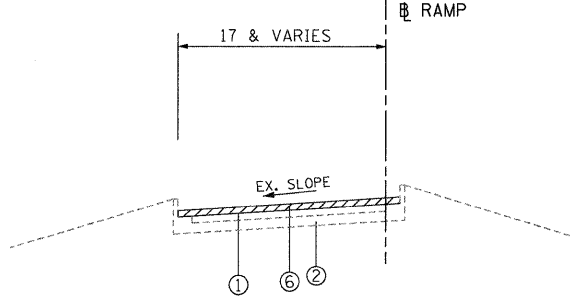

EXISTING TYPICAL SECTION
 US 20 AT IL 31 (STATE ST)
 RAMP K, L, M & N

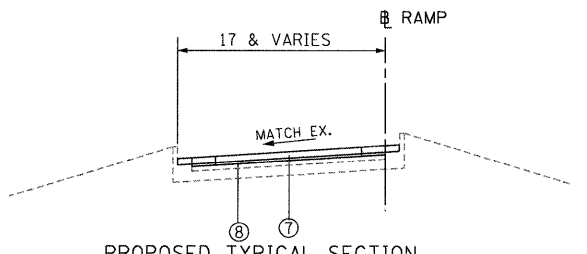

PROPOSED TYPICAL SECTION
 US 20 AT IL 31 (STATE ST)
 RAMP K, L, M & N

LEGEND

- ① EXISTING +/-3" HMA
- ② EXISTING +/-10" P.C.C. BASE
- ③ EXISTING B-6.24 CURB AND GUTTER
- ④ EXISTING BITUMINOUS SHOULDER +/-8"
- ⑤ EXISTING +/- 8" AGGREGATE SHOULDER, TYPE B
- ⑥ HMA SURFACE REMOVAL - 3"
- ⑦ HOT-MIX ASPHALT SURFACE COURSE, MIX "D", N70 (IL-9.5MM) -1 1/2"
- ⑧ POLYMERIZED LEVELING BINDER (MACHINE METHOD), IL-4.75, N50 -1"
- ⑨ POLYMERIZED HOT-MIX ASPHALT SURFACE COURSE, STONE MATRIX ASPHALT, N80 -2" (SEE NOTE 2)
- ⑩ HMA SURFACE REMOVAL - 2 1/2"
- ⑪ POLYMERIZED HOT-MIX ASPHALT SURFACE COURSE, MIX "F", N90 (IL-9.5MM) -1 1/2"
- ⑫ RUMBLE STRIP
- ⑬ P.P.C. SURFACE REMOVAL (VAR. DEPTH)
- ⑭ LEVELING BINDER (MACHINE METHOD), N70

NOTES

- 1. SEE DISTRICT ONE DETAIL (BD33) HMA TAPER AT EDGE OF P.C.C. PAVEMENT. MILLING AT GUTTER FLAG PER DETAIL SHALL B3 1 3/4".

P:\2009\ME\09006_Ver-Yar-Phi\CADD\W021.US20\Shs\07-typical.dgn
 USER NAME: Millennium Professional Services

200 22ND Street, Suite 216, Lombard, IL 60148
 630.705.8110 voice, 630.839.2566 fax
 www.mps-ill.com
MILLENNIA PROFESSIONAL SERVICES

DESIGNED - CJD	REVISED -
DRAWN - CJD	REVISED -
CHECKED - TVN	REVISED -
DATE - 4/1/2011	REVISED -

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

US ROUTE 20 (LAKE STREET)
RANDALL RD TO SHALES PARKWAY

TYPICAL SECTIONS

SCALE: N/A	SHEET NO. OF SHEETS	STA. TO STA.
------------	---------------------	--------------

F.A.P. RTE. 345	SECTION BR-1-RS-4	COUNTY KANE/COOK	TOTAL SHEETS 124	SHEET NO. 8
CONTRACT NO. 60M46				
FED. ROAD DIST. NO. 1 ILLINOIS FED. AID PROJECT				

P:\2009\ME\09006_Ver-Yar-Phi\CADD\W021.US20\Shs\07-typical.dgn