



STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

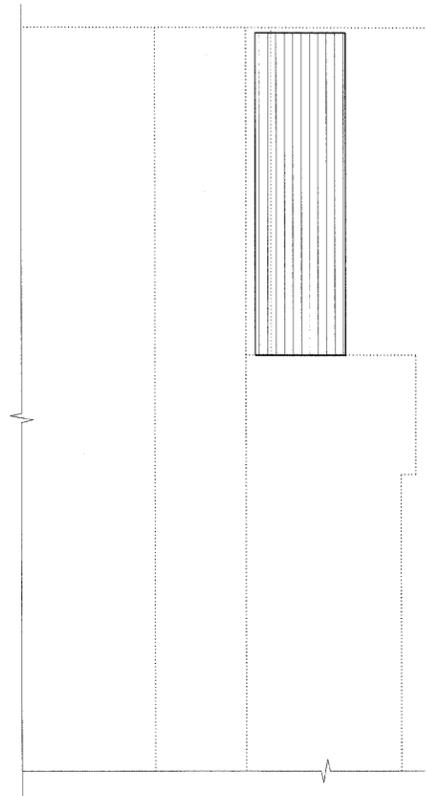

**EAST ABUTMENT REPAIRS**  
(Looking South)

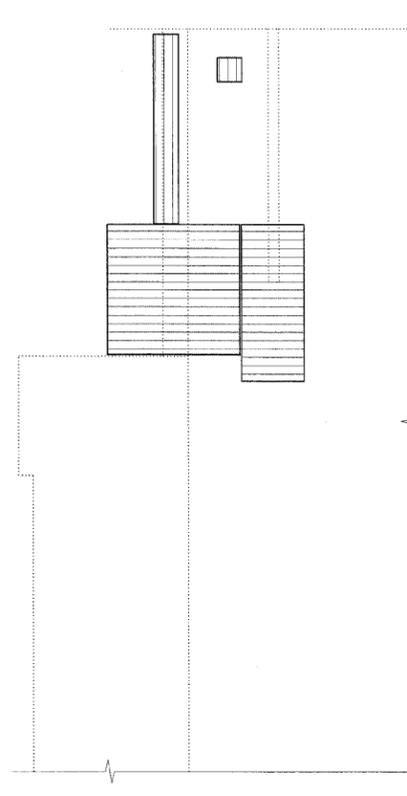

**WEST ABUTMENT REPAIRS**  
(Looking South)

**BILL OF MATERIAL**

SYMBOL	ITEM	UNIT	QUANTITY
	Structural Repair of Concrete (Depth Equal to or Less than 5')	Sq. Ft.	18
	Structural Repair of Concrete (Depth Greater than 5')	Sq. Ft.	9

**Notes:**

1. Repair areas are estimated based upon visual inspection in June 2009. Actual repair areas shall be determined by the Engineer and shown on As-Built plans.
2. The Contractor shall exercise extreme care with the existing conduits located near the repair areas. The Contractor will be required to repair any damage done to the conduit to the satisfaction of the Engineer, at no additional cost to the Department. No splicing will be allowed to any cable damage resulting from this work. Instead the Contractor will be required to repair the entire span of any damaged cable at no additional cost to the Department.

DESIGNED -	KWS
CHECKED -	MFB
DRAWN -	RMG
CHECKED -	KWS

**SUBSTRUCTURE REPAIRS**  
**STRUCTURE NO. 022-0101**

**benesch**

alfred benesch & company  
Engineers • Surveyors • Planners  
205 North Michigan Avenue, Suite 2400  
Chicago, Illinois 60601  
312-565-0450 Job No. 10050

SHEET NO. 8	F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
	290 355	22(1, 1-1, 2&3)RS-7	DUPAGE	546	288
9 SHEETS	CONTRACT NO. 60651				
FED. ROAD DIST. NO.		ILLINOIS	FED. AID PROJECT		