

JOINT REPAIR AT EAST ABUTMENT S.N. 092-0048

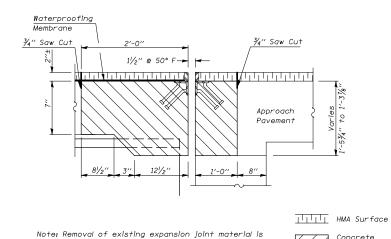


EXISTING SECTION AT EAST ABUTMENT


included in the cost of Concrete Removal.

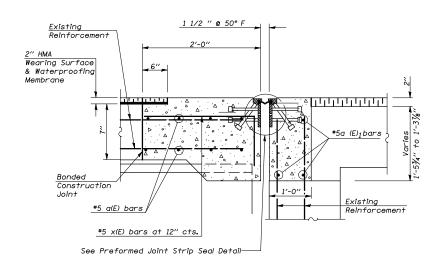

PROPOSED SECTION AT EAST ABUTMENT

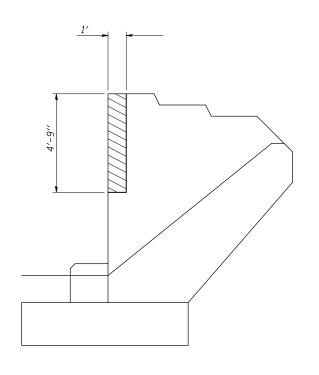


SECTION THRU WING

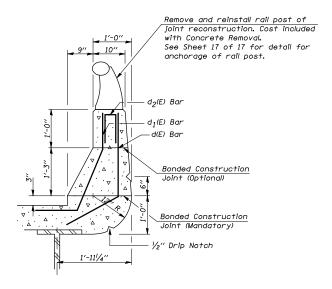

PARAPET DETAIL

* Granular or solid flux filled headed studs conforming to Article 1006.32 of the Std. Specs., automatically end welded.

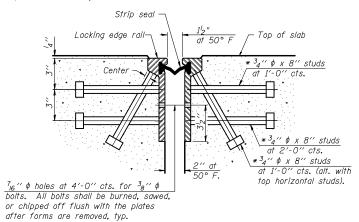

PREFORMED JOINT STRIP SEAL DETAIL

FILE NAME =	USER NAME = cearlockjd	DESIGNED	-	REVISED -	
c:\pw_work\PWIDOT\CEARLOCKJD\dms87656\	590866-Hyd.dgn	DRAWN	-	REVISED -	
	PLOT SCALE = 40.0000 '/ IN.	CHECKED	-	REVISED -	
	PLOT DATE = 2/6/2009	DATE	-	REVISED -	

STATE OF	ILLINOIS
DEPARTMENT OF	TRANSPORTATION

	JOINT REPAIR AT EAST ABUTMENT - S.N. 092-0048			SECTION	COUNTY	TOTAL	SHEET NO.
				46RS-8&1RS-2&46BDR	VERMILION	75	52
				CONTRACT	NO. 9	90866	
	SCALE: SHEET NO. 13 OF 17 SHEETS STA.	90866 TO STA.	FED, RO	AD DIST. NO. ILLINOIS FED. A	ID PROJECT		